

# EXHIBIT A

# **EXHIBIT A-1**

Date Started: 2-12-20  
Patrolled By: [REDACTED]  
Date Completed: 2-14-20  
Signed: [REDACTED]

10

Date Started: 02-12-20 80  
Patrolled By: [REDACTED]  
Date Completed: 02-19-2020  
Signed: [REDACTED]

Date Started: 2-13-20  
Patrolled By: [REDACTED]  
Date Completed: 2-13-20  
Signed: [REDACTED]

15

Date Started: 2/11/2020  
Patrolled By: [REDACTED]  
Date Completed: 4/23/2020  
Signed: [REDACTED]

20

Date Started: 2/12/2020  
Patrolled By: [REDACTED]  
Date Completed: 2/15/2020  
Signed: [REDACTED]

30

Date Started: 2/12/2020 40  
Patrolled By: [REDACTED]  
Date Completed:  
Signed: 2/24/2020

40

Date Started: 3-4-20 50  
Patrolled By: [REDACTED]  
Date Completed:  
Signed: 4-3-20

50

Zogg Mine

Date Started: 2-18-20 60  
Patrolled By: [REDACTED]  
Date Completed: 2-30-20  
Signed: [REDACTED]

60

Date Started: 2-18-2020 70  
Patrolled By: [REDACTED]  
Date Completed: 2-24-2020  
Signed: [REDACTED]

70

70.2/18/2020

Approved by [REDACTED]

[REDACTED]

2-11-20

**ELECTRIC CIRCUIT MAP****AM108-E**

PGE Universal Map Grid Number



NORTH VALLEY DIVISION  
A legend will show below for  
GGNRA lands and SRA/FRA,  
but ONLY when one of these exists  
somewhere on this map.

**High Fire Threat District**  
 Tier 2 - Elevated

500 Scale sized for 11"x17" sheets

1 inch represents 1100 feet


0 1100 2200 3300 Feet

WARNING: Confidential Proprietary Information. This document contains confidential proprietary information.  
It is a trade secret of Pacific Gas and Electric Company (PG&E) and is intended for use only by  
authorized PG&E employees and agents. Copyright  
Pacific Gas and Electric Company 2018.

MAP LOCATION

EDGIS database accessed: 5/26/2018

Adjacent Map: AM108-A

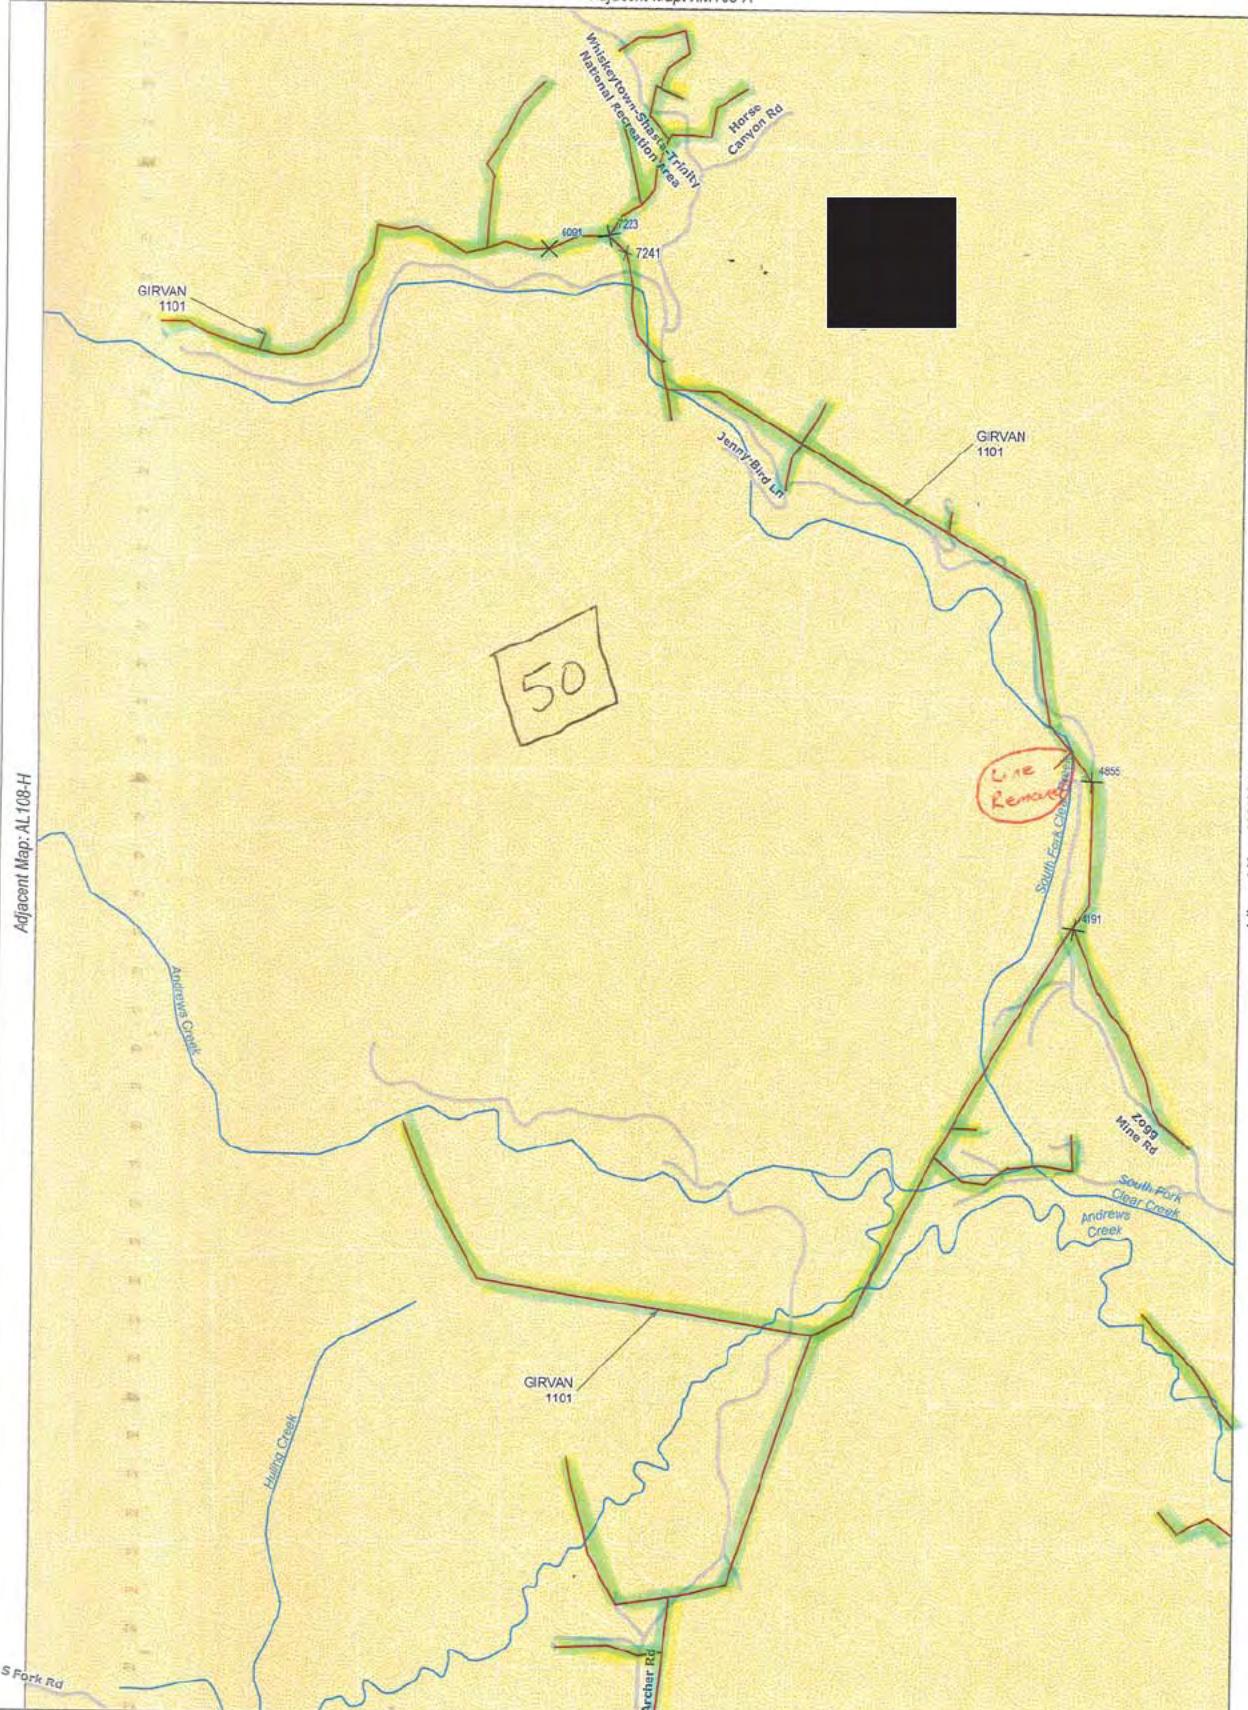

Adjacent Map: AM108-I

# **EXHIBIT A-2**



**Pacific Gas & Electric  
Vegetation Management**

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address				City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone	
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.
4855	50	1,380		C-6	P-25		40.538043/-122.560788	041430023000	4051296	Maintenance		CN Utility
Alerts	Dog:	Locked Gate;	Notify First;	PI Notify First;	Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt
Loc Comments	P58 TP ON DRWY, 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD. CUST WANTS TO KNOW WHO IS ON PROPERTY. MUST CALL TO GET KEY [REDACTED] PLEASE CHIP BRUSH FROM TREES THAT ARE NEXT TO DRIVEWAY ;						TROW:	Slope%	Length	Width	Acres	App. Method
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt
Loc Comments	P58 TP ON DRWY, 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD. CUST WANTS TO KNOW WHO IS ON PROPERTY. MUST CALL TO GET KEY [REDACTED] PLEASE CHIP BRUSH FROM TREES THAT ARE NEXT TO DRIVEWAY ;						TROW:	Slope%	Length	Width	Acres	App. Method
Tree Number 1	Tree Type, Species	Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private		Work Request SHNV1020838
	Live Oak	1	Routine	TopDirecti	30	12	14					T Line
	Tree Alerts	Tree Restrictions		VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %
	Tree Comments	1SW/IO P58 TP; XSTEM				Prescription Comments			Lat/Lon	Proximity Outside	Pole Owner PG&E	Wire Type None
	Crew	iHFDTier		Dt Cmplt 10/15/14	Act. Qty 1	Act. Trim TopDirecti	Act. Clr 14	Worked By	Worked Reason		Worked Comments	
Tree Number 2	Tree Type, Species	Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private		Work Request SHNV1029070
	Gray Pine	1	Routine	Rmv 2-B	60	17	99	Ok				T Line
	Tree Alerts	Tree Restrictions		VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %
	Tree Comments	1SW/IO P58 TP				Prescription Comments PLEASE CHIP BRUSH FROM THIS TREE; TREE IS NEXT TO DRIVEWAY			Lat/Lon 40.538144/-122.5 0976	Proximity Outside	Pole Owner PG&E	Wire Type None
	Crew	iHFDTier	2	Dt Cmplt 4/9/20	Act. Qty 1	Act. Trim Rmv 2-B	Act. Clr 0	Worked By	Worked Reason		Worked Comments	
Tree Number 3	Tree Type, Species	Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private		Work Request C1NV1000714
	Gray Pine	1	Routine	FP-Ov B	75	17	18					T Line
	Tree Alerts	Tree Restrictions		VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %
	Tree Comments	FP; LIMB IS 18' ABOVE LINE; SQUIRT BOOM				Prescription Comments LIMB IS 18' ABOVE LINE; SQUIRT BOOM			Lat/Lon 40.538181/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None
	Crew	iHFDTier	2	Dt Cmplt 12/19/17	Act. Qty 1	Act. Trim FP-Ov B	Act. Clr 18	Worked By	Worked Reason		Worked Comments	

Total Records: 25

= Brush Cut

= Removal

= Fac Prot

Page 9 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address					City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone			
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone		
4855	50	1,360	C-6	P-25			40.538043/-122.560788	041430023000	4051296	Maintenance		CN Utility	/		
Alerts	Restrictions				Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	Cust 3 Name / Phone				
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt	Cust 4 Name / Phone		
Loc Comments	P58 TP ON DRWY, 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD. CUST WANTS TO KNOW WHO IS ON PROPERTY. MUST CALL TO GET KEY [REDACTED] PLEASE CHIP BRUSH FROM TREES THAT ARE NEXT TO DRIVEWAY ;							TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Alerts	Restrictions				Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	Cust 3 Name / Phone				
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt	Cust 4 Name / Phone		
Loc Comments	P58 TP ON DRWY, 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD. CUST WANTS TO KNOW WHO IS ON PROPERTY. MUST CALL TO GET KEY [REDACTED] PLEASE CHIP BRUSH FROM TREES THAT ARE NEXT TO DRIVEWAY ;							TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Tree Number 4	Tree Type, Species Gray Pine	Est Qty 1	Priority No Trim	Trim Type Side	Height 75	DBH 30	Clearance	Notification	Cycle Routine	Owned By Private	Work Request			T Line	
	Tree Alerts	Tree Restrictions		VELB	MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	Inside ROW	
	Tree Comments 25/WIO P58 TP				Prescription Comments			Lat/Lon /	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date	Inspector / Date, Time 6/14/12 1:38 PM [REDACTED]		
	Crew	iHFTDTier		Dt Cmplt	Act. Qty	Act. Trim	Act. Clr	Worked By	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/23/20		
Tree Number 5	Tree Type, Species Live Oak	Est Qty 1	Priority Routine	Trim Type TopDirect	Height 40	DBH 14	Clearance 12	Notification	Cycle Routine	Owned By Private	Work Request SHNV1018802			T Line	
	Tree Alerts	Tree Restrictions		VELB	MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	Inside ROW	
	Tree Comments 35/WIO P58 TP				Prescription Comments			Lat/Lon /	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date	Inspector / Date, Time 6/14/12 1:37 PM [REDACTED]		
	Crew	iHFTDTier		Dt Cmplt 8/7/12	Act. Qty 1	Act. Trim TopDirect	Act. Clr 12	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/23/20		

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

Page 10 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address					City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone	
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	Cust 3 Name / Phone
Environ mnd:	VELB Yes	HCP Area	MBZ ID #	e10c No	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	Cust 4 Name / Phone
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 IS/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.					TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Alerts						Restrictions	Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	Cust 3 Name / Phone
Environ mnd:	VELB Yes	HCP Area	MBZ ID #	e10c No	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	Cust 4 Name / Phone
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 IS/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.					TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Tree Number 1	Tree Type, Species		Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private	Work Request SHNV1024545	T Line
	Live Oak		1	Routine	TopDirecti	23	7	16					
	Tree Alerts		Tree Restrictions		VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %
	Tree Comments 1S/E/OF P59					Prescription Comments			Lat/Lon 40.538868/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date 11/2/17 2:02 PM
	Crew	iHFDTier 2			Dt Cmplt 12/20/17	Act. Qty 1	Act. Trim TopDirecti	Act. Clr 16	Worked By	Worked Reason		Worked Comments	
Tree Number 2	Tree Type, Species		Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private	Work Request C1NV1001887	T Line
	Gray Pine		1	Routine	FP-Rmv2 B	80	22	99					
	Tree Alerts		Tree Restrictions		VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %
	Tree Comments 2S/E/OF P59					Prescription Comments			Lat/Lon 40.544415/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date 11/15/19 4:48 PM
	Crew	iHFDTier 2			Dt Cmplt 5/31/19	Act. Qty 1	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By	Worked Reason		Worked Comments	
Tree Number 3	Tree Type, Species		Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private	Work Request SHNV1022889	T Line
	Live Oak		1	Routine	Side	35	12	13					
	Tree Alerts		Tree Restrictions		VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %
	Tree Comments 2S/E/OF P59					Prescription Comments			Lat/Lon /	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date 6/20/16 3:46 PM
	Crew	iHFDTier			Dt Cmplt 11/21/16	Act. Qty 1	Act. Trim Side	Act. Clr 13	Worked By	Worked Reason		Worked Comments	

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

Page 17 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address					City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone	
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone
4855	50	1,365	C-6	P-25			40.537256/-122.560898	041-430-022-000	4051296	Maintenance	CN Utility	/	
Alerts					Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name
Environ mnd:	VELB Yes	HCP Area	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 IS/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST CALL TO HAVE GT OPENED.					TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name GIRVAN 1101-ZOGG MINE	
Environ mnd:	VELB Yes	HCP Area	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 IS/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST CALL TO HAVE GT OPENED.					TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Tree Number 4	Tree Type, Species	Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private		Work Request C1NV1002839	T Line
	Black Oak	1	Routine	FP-Rmv2 B	35	12	99	Ok					
	Tree Alerts	FP:	Tree Restrictions	VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.
	Tree Comments 25/E/OF P58:DEAD				Prescription Comments				Lat/Lon 40.544472/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	Inspector / Date, Time 3/26/20 2:35 PM [REDACTED]
Tree Number 5	Crew	iHFDTier	2	Dt Cmplt 4/14/20	Act. Qty 1	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20
	Tree Type, Species	Est Qty	Priority	Trim Type	Height	DBH	Clearance	Notification	Cycle Routine	Owned By Private		Work Request C1NV1001887	T Line
	Gray Pine	1	Routine	FP-Rmv2 B	80	14	99						
	Tree Alerts	FP:	Tree Restrictions	VELB	MWS	MWS Num	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.
Tree Comments 25/E/OF P58				Prescription Comments				Lat/Lon 40.539343/-122.5	Proximity Connect	Pole Owner PG&E	Wire Type None	Inspector / Date, Time 4/15/19 4:52 PM [REDACTED]	
Crew		iHFDTier	2	Dt Cmplt 5/31/19	Act. Qty 1	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/23/20
Address					City	County	Circuit	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone
4855	50	1,370	(none)	C-6	P-25		40.538997/-122.56292	041710004000	3785898	Maintenance	CN Utility	/	

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

Page 18 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address				City	County	Circuit	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone		
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone	
Alerts				Restrictions			Tag Type		Tag #	How Notified	U Bld No	Project #	Project Name	
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes		Trans:	Struct1	Struct2	Length	Esmt	Cust 4 Name / Phone
Loc Comments P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 1SW/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.														
Alerts				Restrictions			Tag Type		Tag #	How Notified	U Bld No	Project #	Project Name	
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes		Trans:	Struct1	Struct2	Length	Esmt	Cust 4 Name / Phone
Loc Comments P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 1SW/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.														
Tree Alerts				Tree Restrictions			Tag Type		Tag #	How Notified	U Bld No	Project #	Project Name	
Tree Number 1														
Tree Type, Species Canyon Live Oak		Est Qty 1	Priority Routine	Trim Type FS-R2B+Trt	Height 40	DBH 16	Clearance 99	Notification Ok	Cycle Routine	Owned By Private		Work Request C1NV1002839	T Line	
Tree Alerts FP;		Tree Restrictions			VELB Yes	MWS N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	
Tree Comments 3SW/OF P58; DEAD				Prescription Comments			Lat/Lon 40.538877/-122.5		Proximity Outside	Pole Owner	Wire Type None	TGR Date	Inspector / Date, Time 3/26/20 2:37 PM	
Crew [REDACTED]		iHFDTier 2		Dt Cmplt 4/14/20	Act. Qty 1	Act. Trim FP-Rmv3 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 4/1/20	
Tree Number 2														
Tree Type, Species Gray Pine		Est Qty 1	Priority Routine	Trim Type FP-Rmv1 A	Height 45	DBH 8	Clearance 99	Notification Ok	Cycle Routine	Owned By Private		Work Request C1NV1001518	T Line	
Tree Alerts FP;		Tree Restrictions			VELB Yes	MWS N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	
Tree Comments @ P58; DEAD, UP HILL				Prescription Comments			Lat/Lon 40.538868/-122.56		Proximity Outside	Pole Owner	Wire Type None	TGR Date	Inspector / Date, Time 10/12/18 9:15 AM	
Crew [REDACTED]		iHFDTier 2		Dt Cmplt 2/15/19	Act. Qty 1	Act. Trim FP-Rmv1 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20	
Tree Number 3														
Tree Type, Species Gray Pine		Est Qty 1	Priority Routine	Trim Type Rmv 1-A	Height 35	DBH 9	Clearance 99	Notification	Cycle Routine	Owned By Private		Work Request SHNV1026375	T Line	
Tree Alerts		Tree Restrictions			VELB No	MWS N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	
Tree Comments 3SW/OF P58; TREE HAS DOT, NO X				Prescription Comments TREE HAS DOT, NO X			Lat/Lon 40.521655/-122.5		Proximity Connect	Pole Owner	Wire Type None	TGR Date	Inspector / Date, Time 4/15/19 4:57 PM	
Crew [REDACTED]		iHFDTier 2		Dt Cmplt 5/24/19	Act. Qty 1	Act. Trim Rmv 1-A	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20	

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

Page 28 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address				City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone		
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone
4855	50	1,370	C-6	P-25			40.538997/-122.56292	041710004000	4051296	Maintenance		CN Utility	/
Alerts					Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt	
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 IS/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.						TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle Work Type
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	Cust 3 Name / Phone
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt	
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 IS/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.						TROW:	Slope%	Length	Width	Acres	App. Method	Cust 4 Name / Phone
Tree Number 4	Tree Type, Species Gray Pine	Est Qty 1	Priority Routine	Trim Type FP-Ov A	Height 85	DBH 24	Clearance 15	Notification	Cycle Routine	Owned By Private		Work Request: C1NV1001518	T Line
	Tree Alerts FP;	Tree Restrictions VELB			MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox. Inside ROW
	Tree Comments 3S/W/OF P58; REMOVE DEAD LIMB				Prescription Comments			Lat/Lon 40.538878/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date	Inspector / Date, Time 10/12/18 9:20 AM semr
	Crew [REDACTED]	iHTFTD Tier 2		Dt Cmplt 2/15/19	Act. Qty 1	Act. Trim FP-Ov A	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/28/20
Tree Number 5	Tree Type, Species Canyon Live Oak	Est Qty 1	Priority Routine	Trim Type FP-Trim B	Height 34	DBH 32	Clearance 14	Notification Ok	Cycle Routine	Owned By Private		Work Request: C1NV1002830	T Line
	Tree Alerts FP;	Tree Restrictions VELB			MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox. Inside ROW
	Tree Comments 7S/W/OF P58; XSTM				Prescription Comments			Lat/Lon 40.532147/-122.5	Proximity Outside	Pole Owner	Wire Type None	TGR Date	Inspector / Date, Time 3/26/20 2:39 PM [REDACTED]
	Crew [REDACTED]	iHTFTD Tier 2		Dt Cmplt 4/14/20	Act. Qty 1	Act. Trim FP-Trim B	Act. Clr 14	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 4/1/20
Tree Number 6	Tree Type, Species Gray Pine	Est Qty 1	Priority Routine	Trim Type FS-R3B+Trt	Height 40	DBH 24	Clearance 99	Notification Ok	Cycle Routine	Owned By Private		Work Request: C1NV1002830	T Line
	Tree Alerts FP;	Tree Restrictions VELB			MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox. Inside ROW
	Tree Comments .0S/W/OF P58; S/SD/LNS				Prescription Comments			Lat/Lon 40.539843/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date	Inspector / Date, Time 3/26/20 2:41 PM [REDACTED]
	Crew [REDACTED]	iHTFTD Tier 2		Dt Cmplt 4/14/20	Act. Qty 1	Act. Trim FS-R3B+Trt	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20

Total Records: 25

= Brush Cut

= Removal

= Fac Prot

Page 29 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address					City	County	Division	X Street	Directions			Insp Dt	Cust 1 Name / Phone
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone
4855	50	1,370	C-6	P-25			40.538997/-122.56292	041710004000	4051296	Maintenance	CN Utility	/	
Alerts					Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project # 0	Project Name
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt	
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 1SW/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.												Cust 3 Name / Phone
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project # 181,383	Project Name GIRVAN 1101-ZOGG MINE	Cust 3 Name / Phone
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length	Esmt	
Loc Comments	P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT. P58 1SW/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO HAVE GT OPENED.												Cust 4 Name / Phone
Tree Number 7	Tree Type, Species Canyon Live Oak	Est Qty 1	Priority Routine	Trim Type FS-R2B+Trt	Height 33	DBH 15	Clearance 99	Notification Ok	Cycle Routine	Owned By Private		Work Request C1NV1002839	T Line
	Tree Alerts FP;	Tree Restrictions VELB		MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	TROW Brush	Defect %		Span Prox.	Inside ROW
	Tree Comments 9SW/OF P58;				Prescription Comments				Lat/Lon 40.538212/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	Inspector / Date, Time 3/26/20 2:43 PM [REDACTED]
	Crew [REDACTED]	iHTFTier 2		Dt Cmplt 4/14/20	Act. Qty 1	Act. Trim FS-R2B+Trt	Act. Clr 0	Worked By [REDACTED]	Worked Reason	Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20	

Address					City	County	Circuit	Division	X Street	Directions			Insp Dt	Cust 1 Name / Phone
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone	
4855	50	1,380	(none)	C-6	P-25		40.53931/-122.562918	041710004000		Maintenance	CN Utility	/		

(R) = TGR

W = Warranty

Printed 10/13/20

Total Records: 25

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

(X) = Brush Cut

(X) = Removal

(X) = Fac Prot

Page 30 of 49

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address				City	County	Division	X Street	Directions			Insp Dt	Cust 1 Name / Phone			
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.			
4855	50	1,380	C-6	P-25			40.53931/-122.562918	041710004000	4051296	Maintenance		CN Utility			
Alerts	Access:	Notify First;	PI Notify First;		Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #			
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID # e10c	e10c Acreage	SRA	Yes		Trans:	Struct1	Struct2	Length 0	Esmt 0			
Loc Comments				P68 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P60 2S/W/OF P68 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL.CUST WANTS TO KNOW WHO IS ON PROPERTY.				TROW:	Slope%	Length	Width	Acres	App. Method		
Alerts				Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name GIRVAN 1101-ZOGG MINE		Cust 3 Name / Phone		
181,363															
Environ mndt:	VELB Yes	HCP Area Sacramento	MBZ ID # e10c	e10c Acreage	SRA	Yes		Trans:	Struct1	Struct2	Length 0	Esmt 0		Cust 4 Name / Phone	
Loc Comments				P68 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P60 2S/W/OF P68 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL.CUST WANTS TO KNOW WHO IS ON PROPERTY.				TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Tree Number 1				Tree Type, Species Canyon Live Oak	Est Qty 1	Priority Routine	Trim Type Rmv2-B+Trt	Height 32	DBH 12	Clearance 99	Notification Ok	Cycle Routine	Owned By Private	Work Request SHNV1029070	T Line
Tree Alerts				Tree Restrictions	VELB	MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	Inside ROW
Tree Comments 1SW/W/OF P60;				Prescription Comments				Lat/Lon 40.539835/-122.5	Proximity Connect	Pole Owner PG&E	Wire Type None	TGR Date	Inspector / Date, Time 3/26/20 2:44 PM	[REDACTED]	
Crew iHFTDTier 2				Dt Cmplt 4/14/20	Act. Qty 1	Act. Trim Rmv2-B+Trt	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20		
Tree Number 2				Tree Type, Species Knobcone Pine	Est Qty 1	Priority Routine	Trim Type TopDirecti	Height 30	DBH 4	Clearance 10	Notification	Cycle Routine	Owned By Private	Work Request SHNV1022880	T Line
Tree Alerts				Tree Restrictions	VELB	MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	Inside ROW
Tree Comments 1SW/W/OF P60; GROWTH				Prescription Comments				Lat/Lon 40.538878/-122.5	Proximity Outside	Pole Owner	Wire Type None	TGR Date	Inspector / Date, Time 6/20/16 3:52 PM	[REDACTED]	
Crew iHFTDTier 2				Dt Cmplt 11/21/16	Act. Qty 1	Act. Trim TopDirecti	Act. Clr 10	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20		
Tree Number 3				Tree Type, Species Ponderosa Pine	Est Qty 1	Priority Routine	Trim Type FP-Rmv2 B	Height 75	DBH 16	Clearance 99	Notification	Cycle Routine	Owned By Private	Work Request SHNV1026375	T Line
Tree Alerts				Tree Restrictions	VELB	MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	Inside ROW
Tree Comments .75W/W/OF/P60; DEAD DOWN HILL				Prescription Comments				Lat/Lon 40.539203/-122.5	Proximity Outside	Pole Owner	Wire Type None	TGR Date	Inspector / Date, Time 4/24/19 1:16 PM	[REDACTED]	
Crew iHFTDTier 2				Dt Cmplt 5/8/19	Act. Qty 1	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20		

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

Page 38 of 49

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address				City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone		
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	
4855	50	1,380	C-6	P-25			40.53931/-122.562918	041710004000	4051296	Maintenance		CN Utility	
Alerts					Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #	
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	
Loc Comments	P68 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P60 2S/W/OF P68 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL. CUST WANTS TO KNOW WHO IS ON PROPERTY.						TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	Cust 3 Name / Phone
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	
Loc Comments	P68 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] LGD GT P60 2S/W/OF P68 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL. CUST WANTS TO KNOW WHO IS ON PROPERTY.						TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle
Tree Number 4	Tree Type, Species Gray Pine	Est Qty 1	Priority Routine	Trim Type FP-Rmv2 B	Height 85	DBH 21	Clearance 99	Notification	Cycle Routine	Owned By Private		Work Request SHNV1026375	T Line
	Tree Alerts FP;	Tree Restrictions VELB			MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.
	Tree Comments 75S/W/OF P60; DEAD, DOWN HILL				Prescription Comments			Lat/Lon 40.539155/-122.5	Proximity Connect	Pole Owner PG&E	Wire Type None	TGR Date 4/24/19 1 17 PM	
	Crew	iHFDTier 2		Dt Cmplt 5/8/19	Act. Qty 1	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20
Tree Number 5	Tree Type, Species Knobcone Pine	Est Qty 1	Priority Routine	Trim Type FP-Rmv2 B	Height 60	DBH 22	Clearance 99	Notification	Cycle Routine	Owned By Private		Work Request C1NV1001887	T Line
	Tree Alerts FP;	Tree Restrictions VELB			MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.
	Tree Comments 85S/W/OF P60; DEAD, UP HILL				Prescription Comments			Lat/Lon 40.53935/-122.58	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date 4/26/19 1 39 PM	
	Crew	iHFDTier 2		Dt Cmplt 6/3/19	Act. Qty 1	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20
Tree Number 6	Tree Type, Species Live Oak	Est Qty 1	Priority Routine	Trim Type TopDirect	Height 30	DBH 13	Clearance 14	Notification	Cycle Routine	Owned By Private		Work Request SHNV1021775	T Line
	Tree Alerts	Tree Restrictions VELB			MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.
	Tree Comments 85S/W/OF P60; NSD				Prescription Comments			Lat/Lon /	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date 6/30/15 9 39 AM	
	Crew	iHFDTier		Dt Cmplt 8/16/15	Act. Qty 1	Act. Trim TopDirect	Act. Clr 14	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

= TGR

= Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees

Page 39 of 49



**Pacific Gas & Electric  
Vegetation Management**

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address					City	County	Division	X Street	Directions			Insp Dt	Cust 1 Name / Phone	
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone	
4855	50	1,380	C-6	P-25			40.53931/-122.562918	041710004000	4051296	Maintenance	CN Utility	/		
Alerts					Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name	
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0		
Loc Comments	P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P60 2S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL.CUST WANTS TO KNOW WHO IS ON PROPERTY.					TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type	
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name GIRVAN 1101-ZOGG MINE		Cust 3 Name / Phone
Environ mnd:	VELB Yes	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0		Cust 4 Name / Phone
Loc Comments	P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P60 2S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL.CUST WANTS TO KNOW WHO IS ON PROPERTY.					TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type	
Tree Number 7	Tree Type, Species Ponderosa Pine		Est Qty 2	Priority Routine	Trim Type FP-Rmv2 B	Height 95	DBH 22	Clearance 99	Notification	Cycle Routine	Owned By Private		Work Request SHIV1026375	T Line
	Tree Alerts FP;	Tree Restrictions	VELB No	MWS N	MWS Num	TROW Ht	TROW Width	TROW Length	TROW Brush	Cover %	Defect %	Span Prox.		Inside ROW
	Tree Comments 9S/W/OF P60; DEAD, DOWN HILL @P61				Prescription Comments				Lat/Lon 40.53914/-122.56	Proximity Connect	Pole Owner PG&E	Wire Type None	TGR Date 4/24/19 1 10 PM	[REDACTED]
	Crew [REDACTED]	iHFDTier 2		Dt Cmplt 5/8/19	Act. Qty 2	Act. Trim FP-Rmv2 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason	Worked Comments			Last Modified By / Date [REDACTED] / 3/26/20	

Address					City	County	Circuit	Division	X Street	Directions			Insp Dt	Cust 1 Name / Phone
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone	
4855	50	1,390	(none)	C-6	P-25		40.539087/-122.563743	041710004000		Maintenance	CN Utility	/		

(R) = TGR

Total Records: 25

W = Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

= Brush Cut

(X) = Removal

(X) = Fac Prot

Page 40 of 49

VMD Location - Trees



**Pacific Gas & Electric**  
Vegetation Management

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address				City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone	
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.
4855	50	1,390	C-6	P-25			40.539067/-122.563743	041710004000	4051296	Maintenance	/	CN Utility
Alerts	Access:	Locked Gate;	Notify First;	PI Notify First;	Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #
Environ mndt:	VELB No	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0
Loc Comments	P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P61 3S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UP HILL CUST WANTS TO KNOW WHO IS ON PROPERTY.						TROW:	Slope%	Length	Width	Acres	App. Method
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name GIRVAN 1101-ZOGG MINE
Environ mndt:	VELB No	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0
Loc Comments	P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P61 3S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UP HILL CUST WANTS TO KNOW WHO IS ON PROPERTY.						TROW:	Slope%	Length	Width	Acres	App. Method
Tree Number 1	Tree Type, Species Canyon Live Oak		Est Qty 1	Priority Routine	Trim Type FS-R2B+Trt	Height 35	DBH 15	Clearance 99	Notification Ok	Cycle Routine	Owned By Private	Work Request C1NV1002839
	Tree Alerts FP;		Tree Restrictions VELB No		MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	TROW Brush	Defect %	Span Prox. Inside ROW
	Tree Comments 1SW/W/OF P61; DEAD				Prescription Comments				Lat/Lon 40.539322/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None TGR Date Inspector / Date, Time 3/26/20 2:46 PM [REDACTED]
	Crew	iHFDTier 2		Dt Cmplt 4/30/20	Act. Qty 1	Act. Trim FS-R2B+Trt	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments	
	Last Modified By / Date [REDACTED] / 3/26/20											
Tree Number 2	Tree Type, Species Knobcone Pine		Est Qty 1	Priority No Trim	Trim Type TopDirecti	Height 20	DBH 4	Clearance	Notification	Cycle Routine	Owned By Private	Work Request [REDACTED]
	Tree Alerts		Tree Restrictions VELB No		MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	TROW Brush	Defect %	Span Prox. Inside ROW
	Tree Comments 1SW/W/OF P61				Prescription Comments				Lat/Lon /	Proximity Outside	Pole Owner PG&E	Wire Type None TGR Date Inspector / Date, Time 6/25/12 1:15 PM [REDACTED]
	Crew	iHFDTier		Dt Cmplt	Act. Qty	Act. Trim	Act. Clr	Worked By	Worked Reason		Worked Comments	
Tree Number 3	Tree Type, Species Ponderosa Pine		Est Qty 2	Priority Routine	Trim Type FP-Rmv3 B	Height 100	DBH 31	Clearance 99	Notification	Cycle Routine	Owned By Private	Work Request SHNV1026375
	Tree Alerts FP;		Tree Restrictions VELB No		MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	TROW Brush	Defect %	Span Prox. Inside ROW
	Tree Comments 4-6SW/W/OF P61; AVG DBH AND HT				Prescription Comments				Lat/Lon 40.539495/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None TGR Date Inspector / Date, Time 4/24/19 12:49 PM [REDACTED]
	Crew	iHFDTier 2		Dt Cmplt 5/8/19	Act. Qty 2	Act. Trim FP-Rmv3 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments	
Last Modified By / Date [REDACTED] / 3/26/20												

Total Records: 25

= Brush Cut

= Removal

=Fac Prot

Page 48 of 49

(R) = TGR

W = Warranty

Printed 10/13/20

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

VMD Location - Trees



**Pacific Gas & Electric  
Vegetation Management**

**VMD Location - Trees**

Division NORTH VALLEY  
Circuit GIRVAN 1101 (0103401101)

Division:NV; Acct Type:M; Inspection:All; Circuit Name Equal 0103401101; Insp Date (Loc) Between 09/27/2015,10/13/2020; SSD Route Num Equal 50; Loc Route Num

Address					City	County	Division	X Street	Directions		Insp Dt	Cust 1 Name / Phone			
SSD	SSD RT #	Loc RT #	Map Type	Quad Map	Area	Group	Loc Lat/Lon	APN	Removal Num	Acct Type	Inspector	Inspection Co.	Cust 2 Name / Phone		
4855	50	1,390	C-6	P-25			40.539067/-122.563743	041710004000	4051296	Maintenance		CN Utility	/		
Alerts					Restrictions			Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name		
Environ mndt:	VELB No	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	Cust 3 Name / Phone		
Loc Comments	P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] LGD GT P61 3S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UP HILL CUST WANTS TO KNOW WHO IS ON PROPERTY.							TROW:	Slope%	Length	Width	Acres	App. Method		
Alerts					Restrictions		Tag Type	Tag #	How Notified	U Bld No	Project #	Project Name GIRVAN 1101-ZOGG MINE		Cust 3 Name / Phone	
Environ mndt:	VELB No	HCP Area Sacramento	MBZ ID #	e10c	e10c Acreage	SRA	Yes	Trans:	Struct1	Struct2	Length 0	Esmt 0	Cust 4 Name / Phone		
Loc Comments	P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] LGD GT P61 3S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UP HILL CUST WANTS TO KNOW WHO IS ON PROPERTY.							TROW:	Slope%	Length	Width	Acres	App. Method	Maint. Cycle	Work Type
Tree Number 4	Tree Type, Species Gray Pine		Est Qty 1	Priority Routine	Trim Type FP-Rmv1 B	Height 35	DBH 11	Clearance 99	Notification Ok	Cycle Routine	Owned By Private	Work Request C1NV1002839	T Line		
	Tree Alerts FP;		Tree Restrictions VELB		MWS	MWS	MWS Num N	TROW Ht	TROW Width	TROW Length	Cover %	TROW Brush	Defect %	Span Prox.	Inside ROW
	Tree Comments 7S/W/OF P61				Prescription Comments				Lat/Lon 40.539067/-122.5	Proximity Outside	Pole Owner PG&E	Wire Type None	TGR Date	Inspector / Date, Time 3/26/20 2:47 PM [REDACTED]	
	Crew [REDACTED]	iHTDTier 2		Dt Cmplt 4/30/20	Act. Qty 1	Act. Trim FP-Rmv1 B	Act. Clr 0	Worked By [REDACTED]	Worked Reason		Worked Comments		Last Modified By / Date [REDACTED] / 3/26/20		

(R) = TGR

W = Warranty

Printed 10/13/20

Total Records: 25

= Brush Cut

X = Removal

[REDACTED] = Fac Prot

Confidential - Pacific Gas and Electric Company

Do not copy or distribute without written permission of Pacific Gas and Electric Company

Page 49 of 49

VMD Location - Trees

# **EXHIBIT A-3**



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 1**

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/16/20 4:08 PM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company	
SHASTA			555			Wright Tree	
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD			/				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Traffic Issue							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:	NTW Number		
Yes	AddedTree	A		3489			

**Loc Comments:**

This is a copy of the original location record. It was added as a TAG to support work complete tree records added by the contractor.

**Location Summary: Units: 0 Notification:**

<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
	Alder	Top	Routine	0	0	0	0	4/8/20	8	TR	0	0		950
Com: Added by contractor.														

**Alerts:**

X	Oak	Rmv 1-B	Routine	0	0	0	0	4/8/20	1	R1	0	0		951
Com: Added by contractor.														

**Alerts:**

	Oak	TopDirecti	Routine	0	0	0	0	4/8/20	1	TR	0	0		952
Com: Added by contractor.														

**Alerts:**

	Oak	Side	Routine	0	0	0	0	4/8/20	1	TR	0	0		953
Com: Added by contractor.														

**Alerts:**



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 1**

Address		City IGO		Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/16/20 4:08 PM
XStreet		Group		Loc Rt: 555	U-Bld	Insp	Inspection Company Wright Tree
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD		County SHASTA		Loc Lat/Lon /	Customer Name #1	Customer Name #1	Customer Phone #1
Alerts Traffic Issue		Struct1		Struct2	Customer Name #2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number AddedTree	Tag Type A	Packet Project #	SSD #: 3489	NTW Number		

**Loc Comments:**

This is a copy of the original location record. It was added as a TAG to support work complete tree records added by the contractor.

**Location Summary: Units: 0 Notification:**

<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Ctr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Oak	Rmv 1-B	Routine	0	0	0	0	4/8/20	1	R1	0	0		954

Com: Added by contractor.

**Alerts:**

Oak	Side	Routine	0	0	0	0	4/8/20	1	TR	0	0			955
-----	------	---------	---	---	---	---	--------	---	----	---	---	--	--	-----

**Alerts:**

Oak	Top	Routine	0	0	0	0	4/15/20	1	TR	0	0			957
-----	-----	---------	---	---	---	---	---------	---	----	---	---	--	--	-----

**Alerts:**

Oak	Side	Routine	0	0	0	0	4/22/20	2	TR	0	0			958
-----	------	---------	---	---	---	---	---------	---	----	---	---	--	--	-----

**Alerts:**



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 1

Address		City IGO		Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/16/20 4:08 PM	
XStreet		Group		Loc Rt: 555	U-Bld	Insp	Inspection Company Wright Tree	
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD		County SHASTA		Loc Lat/Lon /	Customer Name #1		Customer Phone #1	
Alerts		Struct1		Struct2	Customer Name #2		Customer Phone #2	
Traffic Issue		SRA Yes	Tag Number AddedTree	Tag Type A	Packet Project # 3489	SSD #:		NTW Number

Loc Comments:

This is a copy of the original location record. It was added as a TAG to support work complete tree records added by the contractor.

Location Summary: Units: 0 Notification:														
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Ctr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
██████	Oak	FP-Trim B	Routine	0	0	0	0	4/23/20	1	BA	0	0	██████	959
Com: Added by contractor.														

Alerts:

██████	Oak	Side	Routine	0	0	0	0	4/23/20	1	TR	0	0	██████	960
Com: Added by contractor.														

Alerts:

██████	Oak	Side	Routine	0	0	0	0	4/27/20	1	TR	0	0	██████	961
Com: Added by contractor.														

Alerts:

██████	Oak	TopDirecti	Routine	0	0	0	0	4/30/20	1	TR	0	0	██████	963
Com: Added by contractor.														

Alerts:



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 1**

Address		City IGO		Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/16/20 4:08 PM	
XStreet		Group		Loc Rt: 555	U-Bld	Insp	Inspection Company Wright Tree	
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD		County SHASTA		Loc Lat/Lon /	Customer Name #1		Customer Phone #1	
Alerts		Struct1		Struct2	Customer Name #2		Customer Phone #2	
Traffic Issue		SRA Yes	Tag Number AddedTree	Tag Type A	Packet Project # 3489	SSD #:		NTW Number

**Loc Comments:**

This is a copy of the original location record. It was added as a TAG to support work complete tree records added by the contractor.

**Location Summary: Units: 0 Notification:**

<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Ctr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Oak	TopDirecti	Routine	0	0	0	0	4/30/20	3	TR	0	0	[REDACTED]	964

Com: Added by contractor.

**Alerts:**

[REDACTED]	Oak	Side	Routine	0	0	0	0	5/4/20	1	TR	0	0	[REDACTED]	965
------------	-----	------	---------	---	---	---	---	--------	---	----	---	---	------------	-----

**Alerts:**

[REDACTED]	Alder	TopDirecti	Routine	0	0	0	0	5/5/20	2	TR	0	0	[REDACTED]	966
------------	-------	------------	---------	---	---	---	---	--------	---	----	---	---	------------	-----

Com: Added by contractor.

**Alerts:**

[REDACTED]	Fir, True	TopDirecti	Routine	0	0	0	0	5/6/20	1	TR	0	0	[REDACTED]	967
------------	-----------	------------	---------	---	---	---	---	--------	---	----	---	---	------------	-----

Com: Added by contractor.

**Alerts:**

**Notes:**

**Location Num: 2**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 2

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/16/20 4:08 PM
XStreet			Group County SHASTA	Loc Rt: 555	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD			Loc Lat/Lon 40.505397 / -122.547127		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
Traffic Issue			SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489 NTW Number
[REDACTED]			IGO		C-6	-	Q-25 3/16/20 4:08 PM
XStreet			Group County SHASTA	Loc Rt: 555	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD			Loc Lat/Lon 40.505397 / -122.547127		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
Traffic Issue			SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489 NTW Number

## Loc Comments:

P0 SSD#3489 1ST POLE RDSD ON ZOGG MINE RD. ROUTE DIVISION BETWEEN 50 &amp; 40.

Location Summary: Units: 1			Notification:											
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	TopDirecti	Routine	23	7	14	1	4/6/20	1	TR	0		[REDACTED] 1	
Com:														

Tline:

Owner: Private

Clearance: 14

Wire Type: None

VELB Area: Yes Tree Lat/Lon: 40.505542/-122.547118

Worked Reason:

Tree Com: .2S/N/OF P0 SSD#3489; 2XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 3



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 200  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 3

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/17/20 7:55 AM
XStreet			County SHASTA	Loc Rt: 570	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD			Loc Lat/Lon 40.508143 / -122.547193		Customer Name #1		Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2
Access Concerned Customer			SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489 NTW Number
			IGO			C-6 - P-25	3/17/20 7:55 AM
XStreet			County SHASTA	Loc Rt: 570	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE RD			Loc Lat/Lon 40.508143 / -122.547193		Customer Name #1		Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2
Access Concerned Customer			SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489 NTW Number

Loc Comments:  
P4 LB A/F 1ST HSE ON ZOGG MINE RD.

Location Summary: Units: 2			Notification:																		
			Completed																		
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #							
██████	Plum	TopDirecti	Routine	34	12	14	1	4/6/20	1	TR	0		██████	4							
Com:																					
Tline:			Owner: Private			Clearance: 14															
Wire Type: None	VELB Area: Yes	40.508215/-122.547332	Tree Lat/Lon:																		
Worked Reason:																					

Tree Com: .1S/N/OF P4 LB XSTM; FLAGGED

Worked Comments:

Psc Com:

Alerts:

██████	Willow	TopDirecti	Routine	35	26	14	1	4/6/20	1	TR	0		██████	5							
Com:																					
Tline:			Owner: Private			Clearance: 14															
Wire Type: None	VELB Area: Yes	40.508593/-122.547099	Tree Lat/Lon:																		
Worked Reason:																					

Tree Com: .2S/N/OF P4 LB XSTM. FLGD/PTD

Worked Comments:

Psc Com: WIND SWAY AND LINE SAG

Alerts:

Notes:

Location Num: 4



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 4

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 8:35 AM
XStreet			County SHASTA	Loc Rt: 600	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON CLOVERDALE RD>S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE			Loc Lat/Lon /		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/17/20 8:35 AM
XStreet			County SHASTA	Loc Rt: 600	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON CLOVERDALE RD>S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE			Loc Lat/Lon /		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: AX DRWY @ PSTD ADD P1 ON DRWY GATE CODE# █████ P2 W/O/P1/NEAR ROAD

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Interior Live Oak Top	Routine	28	20	12	1	4/6/20	1	TR	0		██████████	9	
Com:														
Tline:														
Wire Type: None	VELB Area: Yes	Owner: Private												
		Tree Lat/Lon: 40.512037/-122.548843												
		Worked Reason:												

Tree Com: .9S/W/O/P2/ XSTEM; ROADSIDE AT P9;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 5



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Work Order  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 5

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 8:37 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 605	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON CLOVERDALE RD>S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE			Loc Lat/Lon /		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 8:37 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 605	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON CLOVERDALE RD>S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE			Loc Lat/Lon /		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: AX DRWY @ PSTD ADD P1 ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 1			Notification:											
			Completed											
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Overhang	Routine	65	52	15	1	4/6/20	1	BO	0	[REDACTED]	11	
Com:														
Tline: Owner: Private			Clearance: 15											
Tree Lat/Lon: 40.512341/-122.548481														
Wire Type: None		VELB Area: Yes		Worked Reason:										

Tree Com: .8S/W/OF P1 2XSTEM; SD 12'-14' TTB TOO

Worked Comments:

Psc Com: RAIN AND SNOW SAG AND GROWTH; REMOVE 4 VERY FLOPPY TOPS.

Alerts:

Notes:

Location Num: 6

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 204  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 6

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:00 AM
XStreet			Group SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/4/20 8:00 AM
XStreet			County SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: P1 1ST POLE ON DRWY CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ANY ACCESS. HE IS VERY ACCOMMODATING , PLEASE TRY TO CHIP ALL BRUSH, AND THROW BIGGER PIECES NEXT TO DRIVEWAY ; THANK YOU ; YOU CAN CROSS WIDE FENCE AT ELACS

Location Summary: Units: 19 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	TopDirecti	Routine	25	8	12	1	4/8/20	1	TR	0		[REDACTED]	12

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon: 40.512107/-122.549495

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .2S/W/OF P1

Worked Comments:

Psc Com: FLAGGED

Alerts:

X [REDACTED]	Interior Live Oa Rmv1-B+Trt	Routine	27	4	1	4/8/20	1	R1	0		[REDACTED]			14
Com:	Tline:	Owner: Private	Clearance:											

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon: 40.512217/-122.549642

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .4S/W/OF P1 FLGD/PTD; UNDR LN;

Worked Comments:

Psc Com:

Alerts:



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 6

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:00 AM
XStreet			Group SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/4/20 8:00 AM
XStreet			County SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

**Loc Comments:** P1 1ST POLE ON DRWY CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ANY ACCESS. HE IS VERY ACCOMMODATING , PLEASE TRY TO CHIP ALL BRUSH, AND THROW BIGGER PIECES NEXT TO DRIVEWAY ; THANK YOU ; YOU CAN CROSS WIDE FENCE AT PLACES

Location Summary: Units: 19 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Valley Oak	Rmv1-B+Trt	Routine	30	5		1	4/8/20	1	R1	0		[REDACTED]	15

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512178/-122.549683 Worked Reason:

Tree Com: .4S/W/OF P1; N/OF FNC, FLGD/PTD

Worked Comments:

Psc Com:

Alerts:

■ [REDACTED]	Valley Oak	Side	Routine	45	10	14	1	4/8/20	1	TR	0		[REDACTED]	16
Com:														

Tline:

Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512138/-122.549751 Worked Reason:

Tree Com: .4S/W/OF P1; N/OF FNC, N/SD/LNS PTD

Worked Comments:

Psc Com: 1ABOVE AND BELOW

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 6

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:00 AM
XStreet			Group SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/4/20 8:00 AM
XStreet			County SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: P1 1ST POLE ON DRWY CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ANY ACCESS. HE IS VERY ACCOMMODATING , PLEASE TRY TO CHIP ALL BRUSH, AND THROW BIGGER PIECES NEXT TO DRIVEWAY ; THANK YOU ; YOU CAN CROSS WIDE FENCE AT PLACES

Location Summary: Units: 19 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Br Rmv	Routine	28	3	1		1	4/8/20	1	BR	0		[REDACTED]	18

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512159/-122.549907 Worked Reason:

Tree Com: .5S/W/OF P1 ; 1 STEM

Worked Comments:

Psc Com: FLAGGED/PTD

Alerts:

[REDACTED]	Interior Live Oa TopDirecti	Routine	27	40	12	1	4/8/20	1	TR	0		[REDACTED]		20
Com:	Tline:	Owner: Private	Clearance: 12											

Tree Lat/Lon: 40.512212/-122.549795

Worked Reason:

Tree Com: .4-.5S/W/OF P1 XSTM FLGD/PTD; UNDR LN;

Worked Comments:

Psc Com: TREE HAS 2 SECTIONS UNDER LINES

Alerts:



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 6

Address		City	Quad Map	Thomas Guide	Area	Inspection Date / Time
		IGO	C-6	-	Q-25	3/4/20 8:00 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	620	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		40.512162 / -122.549648				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			00000-0000	3489		4048796
		IGO	C-6	-	Q-25	3/4/20 8:00 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	620	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		40.512162 / -122.549648				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			0018-1363	3489		4048796

**Loc Comments:** P1 1ST POLE ON DRWY CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ANY ACCESS. HE IS VERY ACCOMMODATING , PLEASE TRY TO CHIP ALL BRUSH, AND THROW BIGGER PIECES NEXT TO DRIVEWAY ; THANK YOU ; YOU CAN CROSS WIDE FENCE AT PLACES

Location Summary: Units: 19 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oa Br Rmv+Trt	Routine	25	3	8		8	4/8/20	8	BX	0		[REDACTED]	21

Com:

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.512223/-122.549818

Clearance:

Worked Reason:

Tree Com: .4-6S/W/OF P1 FLGD/PTD; UNDR LN; 5 STEMS

Worked Comments:

Psc Com: 5 STEMS

Alerts:

[REDACTED]	Interior Live Oa Top	Routine	25	13	12	1	4/8/20	1	TR	0		[REDACTED]	22
Com:													

Tline:

Owner: Private

Clearance: 12

Wire Type: None VELB Area: Yes 40.512220/-122.549967

Worked Reason:

Tree Com: .7S/W/OF P1 XSTM FLGD/PTD; UNDR LN;

Worked Comments:

Psc Com:

Alerts:



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 6

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:00 AM
XStreet			Group County SHASTA	Loc Rt: 620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4048796
[REDACTED]			IGO	C-6	-	Q-25	3/4/20 8:00 AM
XStreet			Group County SHASTA	Loc Rt: 620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

**Loc Comments:** P1 1ST POLE ON DRWY CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ANY ACCESS. HE IS VERY ACCOMMODATING , PLEASE TRY TO CHIP ALL BRUSH, AND THROW BIGGER PIECES NEXT TO DRIVEWAY ; THANK YOU ; YOU CAN CROSS WIDE FENCE AT ELACS

Location Summary: Units: 19 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Interior Live Oak Rmv1-B+Trt	Routine	25	5	1	[REDACTED]	1	4/8/20	1	R1	0		[REDACTED]	23
<b>Com:</b>														
Tline: Owner: Private Clearance:														
Wire Type: None VELB Area: Yes Tree Lat/Lon: 40.512232/-122.549993 Worked Reason:														

Tree Com: .7S/W/OF P1 XSTM FLGD/PTD; UNDR LN;

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Interior Live Oak Rmv1-B+Trt	Routine	24	7	1	4/8/20	1	R1	0		[REDACTED]			24
<b>Com:</b>														
Tline: Owner: Private Clearance:														
Wire Type: None VELB Area: Yes Tree Lat/Lon: 40.512262/-122.550025 Worked Reason:														

Tree Com: .8S/W/OF P1 XSTM FLGD; UNDR LN; BHD SML V OAK

Worked Comments:

Psc Com:

Alerts:



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 6

Address		City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:00 AM
XStreet		Group SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1	Customer Phone #1	
Alerts Locked Gate Notify First PI Notify First		Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489	NTW Number 4048796	
		IGO		C-6	-	Q-25 3/4/20 8:00 AM
XStreet		Group SHASTA	Loc Rt: 620	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		Loc Lat/Lon 40.512162 / -122.549648		Customer Name #1	Customer Phone #1	
Alerts Locked Gate Notify First PI Notify First		Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489	NTW Number 4048796	

**Loc Comments:** P1 1ST POLE ON DRWY CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ANY ACCESS. HE IS VERY ACCOMMODATING , PLEASE TRY TO CHIP ALL BRUSH, AND THROW BIGGER PIECES NEXT TO DRIVEWAY ; THANK YOU ; YOU CAN CROSS WIDE FENCE AT ELACS

Location Summary: Units: 19 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Br Rmv+Trt	Routine	25	3		1	4/8/20	1	BX	0		[REDACTED]	25

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512217/-122.550247 Worked Reason:

Tree Com: .8S/W/OF/P1; FLGD/PTD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Interior Live Oa Top	Routine	24	15	12	1	4/8/20	1	TR	0		[REDACTED]	26
Com:													

Tline:

Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512227/-122.550065 Worked Reason:

Tree Com: .8S/W/OF P1 XSTM FLGD; UNDR LN; BHD SML V OAK

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 7

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 204  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 7

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/5/20 9:29 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	630	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.512897 / -122.550262				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			00000-0000	3489			4048796
			IGO	C-6	-	Q-25	3/5/20 9:29 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	630	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.512897 / -122.550262				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048796

Loc Comments: P2 LB 2ND POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS PLEASE DO VERY GOOD CLEANUP , AND LEAVE LARGER PIECES NEXT TO DRIVEWAY ; THANK YOU

Location Summary: Units: 5 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Gray Pine	Rmv 2-B	Routine	55	12		1	4/8/20	1	R2	0			29

Com:

Tline: Owner: Private Clearance:

Wire Type: None VELB Area: Yes Tree Lat/Lon: 40.512412/-122.550250

Worked Reason:

Tree Com: .2S/N/OF P2 LB

Worked Comments:

Psc Com:

Alerts:

Interior Live On Side	Routine	30	25	14	1	4/8/20	1	TR	0					30
Com:	Tline:	Owner: Private	Clearance: 14											

Wire Type: None

VELB Area: Yes Tree Lat/Lon: 40.512383/-122.550200

Worked Reason:

Tree Com: .2S/N/OF P2 LB;

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 204  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 7

Address		City	Quad Map	Thomas Guide	Area	Inspection Date / Time
		IGO	C-6	-	Q-25	3/5/20 9:29 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	630	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		40.512897 / -122.550262				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			00000-0000	3489		4048796
		IGO	C-6	-	Q-25	3/5/20 9:29 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	630	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		40.512897 / -122.550262				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			0018-1363	3489		4048796

Loc Comments: P2 LB 2ND POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS PLEASE DO VERY GOOD CLEANUP , AND LEAVE LARGER PIECES NEXT TO DRIVEWAY ; THANK YOU

Location Summary: Units: 5 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Interior Live Oak Rmv1-B+Trt	Routine	30	8	1		1	4/8/20	1	R1	0			34
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.512777/-122.550163 Worked Reason:														
Wire Type: None VELB Area: Yes														

Tree Com: .8S/N/OF P2 LB. XSTM

Worked Comments:

Psc Com: LEANING OVER DRIVEWAY

Alerts:

Interior Live Oak Side	Routine	30	20	14	1	4/8/20	1	TR	0					35
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.512857/-122.550243 Worked Reason:														
Wire Type: None VELB Area: Yes														

Tree Com: .9S/N/OF P2 LB. 2XSTM; DOWN HILL

Worked Comments:

Psc Com: FLAGGED AT DRIVEWAY

Alerts:



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 200  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 7

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time		
			IGO	C-6	-	Q-25	3/5/20 9:29 AM		
XStreet	Group	County			Loc Rt:	U-Bld	Insp		
		SHASTA			630	No			
Location Directions			Loc Lat/Lon		Customer Name #1		Customer Phone #1		
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.512897 / -122.550262						
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2		
Locked Gate Notify First PI Notify First									
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number		
Yes			00000-0000	3489			4048796		
			IGO	C-6	-	Q-25	3/5/20 9:29 AM		
XStreet	Group	County			Loc Rt:	U-Bld	Insp		
		SHASTA			630	No			
Location Directions			Loc Lat/Lon		Customer Name #1		Customer Phone #1		
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.512897 / -122.550262						
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2		
Locked Gate Notify First PI Notify First									
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number		
Yes			0018-1363	3489			4048796		

**Loc Comments:** P2 LB 2ND POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS PLEASE DO VERY GOOD CLEANUP , AND LEAVE LARGER PIECES NEXT TO DRIVEWAY ; THANK YOU

Location Summary: Units: 5 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Gray Pine	Rmv 1-B	Routine	28	5		1	4/8/20	1	R1	0			36

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512860/-122.550247

Worked Reason:

Tree Com: .9S/N/OF P2 LB

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 8

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Work Order  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 8

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/5/20 9:50 AM
XStreet			Group County SHASTA	Loc Rt: 640	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.513638 / -122.550887		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/5/20 9:50 AM
XStreet			Group County SHASTA	Loc Rt: 640	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.513638 / -122.550887		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: P3 3RD POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR JUST CALL [REDACTED] HE IS VERY ACCOMMODATING ; PLEASE DO VERY GOOD CLEANUP , AND LEAVE ANY LARGER PIECES NEXT TO DRIVEWAY

Location Summary: Units: 10 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	25	8		1	4/8/20	1	R1	0		[REDACTED]	38
Com:														
Tline: Owner: Private Clearance:														
Wire Type: None VELB Area: Yes Tree Lat/Lon: 40.512888/-122.550230 Worked Reason:														

Tree Com: .1S/N/OF P3

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Gray Pine	Rmv 1-B	Routine	24	4		1	4/8/20	1	R1	0		[REDACTED]	41
Com:														
Tline: Owner: Private Clearance:														
Wire Type: None VELB Area: Yes Tree Lat/Lon: 40.513154/-122.550394 Worked Reason:														

Tree Com: .2S/NF P3; PAINTED/FLAGGED

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 8

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/5/20 9:50 AM
XStreet			County SHASTA	Loc Rt: 640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.513638 / -122.550887		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
[REDACTED]			IGO	C-6	-	Q-25	3/5/20 9:50 AM
XStreet			County SHASTA	Loc Rt: 640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.513638 / -122.550887		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: P3 3RD POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR JUST CALL [REDACTED] HE IS VERY ACCOMMODATING ; PLEASE DO VERY GOOD CLEANUP , AND LEAVE ANY LARGER PIECES NEXT TO DRIVEWAY

Location Summary: Units: 10 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak TopDirecti	Routine	26	12	12	1	1	4/8/20	1	TR	0		[REDACTED]	42

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.512997/-122.550323 Worked Reason:

Tree Com: .2S/N/OF P3; 2XSTEM;

Worked Comments:

Psc Com: TREE AT GAS PIPELINE POST

Alerts:

[REDACTED]	Interior Live Oak TopDirecti	Routine	28	33	12	1	1	4/8/20	1	TR	0		[REDACTED]	43
Com:	Tline:	Owner: Private	Clearance: 12											

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513012/-122.550302 Worked Reason:

Tree Com: .2S/N/OF P3; 5XSTEM; AT GAS POST

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 8

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/5/20 9:50 AM
XStreet			Group County SHASTA	Loc Rt: 640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.513638 / -122.550887		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
[REDACTED]			IGO	C-6	-	Q-25	3/5/20 9:50 AM
XStreet			Group County SHASTA	Loc Rt: 640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.513638 / -122.550887		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: P3 3RD POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR JUST CALL [REDACTED] HE IS VERY ACCOMMODATING ; PLEASE DO VERY GOOD CLEANUP , AND LEAVE ANY LARGER PIECES NEXT TO DRIVEWAY

Location Summary: Units: 10 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	27	4		1	4/8/20	1	R1	0		[REDACTED]	44
Com:														
Tline: Owner: Private Clearance:														
Wire Type: None Tree Lat/Lon: 40.513115/-122.550362 Worked Reason:														

Tree Com: .2S/NF P3; PAINTED/FLAGGED

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Gray Pine	Rmv 1-B	Routine	21	6		1	4/8/20	1	R1	0		[REDACTED]	45
Com:														
Tline: Owner: Private Clearance:														
Wire Type: None Tree Lat/Lon: 40.513202/-122.550435 Worked Reason:														

Tree Com: .2S/NF P3; PAINTED/FLAGGED

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 8

Address		City	Quad Map	Thomas Guide	Area	Inspection Date / Time
		IGO	C-6	-	Q-25	3/5/20 9:50 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	640	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		40.513638 / -122.550887				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			00000-0000	3489		4048796
		IGO	C-6	-	Q-25	3/5/20 9:50 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	640	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE		40.513638 / -122.550887				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			0018-1363	3489		4048796

Loc Comments: P3 3RD POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR JUST CALL [REDACTED] HE IS VERY ACCOMMODATING ; PLEASE DO VERY GOOD CLEANUP , AND LEAVE ANY LARGER PIECES NEXT TO DRIVEWAY

Location Summary: Units: 10 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
W [REDACTED]	Interior Live Oak ReTreatment	Routine	2	12	1		1	4/8/20	1	XX	0		[REDACTED]	46

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513107/-122.550365 Worked Reason:

Tree Com: .3S/N/OF P3; 2XSTEM; FLGD/PTD

Worked Comments:

Psc Com:

Alerts:

Gray Pine	Br Rmv	Routine	26	3	2	4/8/20	2	BR	0		[REDACTED]			47
Com:														

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513220/-122.550502 Worked Reason:

Tree Com: .5S/N/OF P3; 1 STEM

Worked Comments:

Psc Com: WINDSWAY

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 8

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time		
			IGO	C-6	-	Q-25	3/5/20 9:50 AM		
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company		
			SHASTA	640	No		CN Utility		
Location Directions			Loc Lat/Lon		Customer Name #1		Customer Phone #1		
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.513638 / -122.550887						
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2		
Locked Gate Notify First PI Notify First									
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number		
Yes			00000-0000	3489			4048796		
			IGO	C-6	-	Q-25	3/5/20 9:50 AM		
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company		
			SHASTA	640	No		CN Utility		
Location Directions			Loc Lat/Lon		Customer Name #1		Customer Phone #1		
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.513638 / -122.550887						
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2		
Locked Gate Notify First PI Notify First									
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number		
Yes			0018-1363	3489			4048796		

Loc Comments: P3 3RD POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR JUST CALL [REDACTED] HE IS VERY ACCOMMODATING ; PLEASE DO VERY GOOD CLEANUP , AND LEAVE ANY LARGER PIECES NEXT TO DRIVEWAY

Location Summary: Units: 10 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	Side	Routine	50	28	12	1	4/8/20	1	TR	0		[REDACTED]	53

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513475/-122.550742 Worked Reason:

Tree Com: .8S/N/OF P3; E/SD/DOWN HILL

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 9



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 9

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/5/20 10:20 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	650	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.513635 / -122.552023				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			00000-0000	3489			4048796
			IGO	C-6	-	Q-25	3/5/20 10:20 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	650	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.513635 / -122.552023				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048796

Loc Comments: P4 LB 4TH POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ACCESS , HE IS VERY ACCOMMODATING ; ALSO, PLEASE DO VERY GOOD CLEANUP , THANK YOU

Location Summary: Units: 4 Notification:

<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	TopDirecti	Routine	30	12	12	1	4/8/20	1	TR	0		[REDACTED]	54

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon: 40.513610/-122.550885

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .1S/W/OF P4 LB

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Gray Pine	Rmv 1-B	Routine	25	6	1	4/8/20	1	R1	0		[REDACTED]		55
Com:														

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon: 40.513635/-122.551023

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .2S/W/OF P4 LB; S/SD/DRIVEWAY

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 9

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/5/20 10:20 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	650	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.513635 / -122.552023				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			00000-0000	3489			4048796
			IGO	C-6	-	Q-25	3/5/20 10:20 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	650	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.513635 / -122.552023				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048796

Loc Comments: P4 LB 4TH POLE ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ACCESS , HE IS VERY ACCOMMODATING ; ALSO, PLEASE DO VERY GOOD CLEANUP , THANK YOU

Location Summary: Units: 4 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	40	8		1	4/8/20	1	R1	0		[REDACTED]	56
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon:														
Wire Type: None VELB Area: Yes 40.513602/-122.551395 Worked Reason:														

Tree Com: .5S/W/O P4 LB; DOWN HILL

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Gray Pine	Rmv 1-B	Routine	30	10		1	4/8/20	1	R1	0		[REDACTED]	57
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon:														
Wire Type: None VELB Area: Yes 40.513625/-122.551103 Worked Reason:														

Tree Com: .3S/W/O P4 LB

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 10

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 10

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/5/20 10:36 AM
XStreet			Group SHASTA	Loc Rt: 660	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.514318 / -122.552250		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/5/20 10:36 AM
XStreet			County SHASTA	Loc Rt: 660	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.514318 / -122.552250		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: EP ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ACCESS , HE IS VERY ACCOMMODATING

Location Summary: Units: 7 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	32	5	1	1	4/8/20	1	R1	0		[REDACTED]	65
Com:														
Tline: Owner: Private Clearance:														
Wire Type: Raychem VELB Area: Yes Tree Lat/Lon: 40.513718/-122.552055 Worked Reason:														

Tree Com:.9S/S/OF EP.

Worked Comments:

Psc Com: BENT UNDER LINE

Alerts:

[REDACTED]	Interior Live On TopDirecti	Routine	38	45	14	1	4/8/20	1	TR	0		[REDACTED]	[REDACTED]	66
Com:														
Tline: Owner: Private Clearance: 14														
Wire Type: Raychem VELB Area: Yes Tree Lat/Lon: 40.513790/-122.552098 Worked Reason:														

Tree Com:.8S/S/OF EP. FLAGGED XSTEM; E/SD/DOWN HILL

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 10

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/5/20 10:36 AM
XStreet			County SHASTA	Loc Rt: 660	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.514318 / -122.552250		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/5/20 10:36 AM
XStreet			County SHASTA	Loc Rt: 660	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.514318 / -122.552250		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: EP ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ACCESS , HE IS VERY ACCOMMODATING

Location Summary: Units: 7 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Live Oak	TopDirecti	Routine	35	19	14	1	4/8/20	1	TR	0		[REDACTED]	67

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: Raychem VELB Area: Yes 40.513907/-122.552108 Worked Reason:

Tree Com: .7S/S/OF EP. FLAGGED/PTD 2 XSTEM

Worked Comments:

Psc Com: DOWN HILL

Alerts:

[REDACTED]	Gray Pine	Side	Routine	55	12	14	1	4/8/20	1	TR	0		[REDACTED]	69	
Com:															
Tline:	Owner: Private Clearance: 14														
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.513867/-122.552210 Worked Reason:													

Tree Com: .6S/S/OF EP; W/SD/DRIVEWAY

Worked Comments:

Psc Com: GET FLOPPY LIMBS ABV LINE AND LINESIDE

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Work Order  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 10

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/5/20 10:36 AM
XStreet			County SHASTA	Loc Rt: 660	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.514318 / -122.552250		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048796
			IGO	C-6	-	Q-25	3/5/20 10:36 AM
XStreet			County SHASTA	Loc Rt: 660	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			Loc Lat/Lon 40.514318 / -122.552250		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048796

Loc Comments: EP ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ACCESS , HE IS VERY ACCOMMODATING

Location Summary: Units: 7 Notification:

&lt;-----Completed-----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	Top	Routine	39	8	14	1	4/8/20	1	TR	0		[REDACTED]	70

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514090/-122.552257 Worked Reason:

Tree Com: .3S/S/O EP

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Interior Live On Top	Routine	37	7	14	1	4/8/20	1	TR	0		[REDACTED]	71
------------	----------------------	---------	----	---	----	---	--------	---	----	---	--	------------	----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514087/-122.552275 Worked Reason:

Tree Com: .3S/S/OF EP

Worked Comments:

Psc Com:

Alerts:



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 10

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/5/20 10:36 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	660	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.514318 / -122.552250				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	Customer Phone #2
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			
Yes			00000-0000	3489			
			IGO	C-6	-	Q-25	3/5/20 10:36 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	660	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF ZOGG MINE			40.514318 / -122.552250				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	Customer Phone #2
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			
Yes			0018-1363	3489			
Loc Comments: EP ON DRWY PAST GATE CALL ONE DAY IN ADVANCE. DO SAME DAY AS [REDACTED] OR CALL [REDACTED] FOR ACCESS , HE IS VERY ACCOMMODATING							

Location Summary: Units: 7 Notification:

<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	TopDirecti	Routine	42	22	14	1	4/8/20	1	TR	0		[REDACTED]	73

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514072/-122.552150 Worked Reason:

Tree Com: .3S/S/OF EP

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 11



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 11

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:00 AM
XStreet			Group	County SHASTA	Loc Rt: 670	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513842 / -122.548012		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 10:00 AM
XStreet			Group	County SHASTA	Loc Rt: 670	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513842 / -122.548012		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number

Loc Comments: P2 RDSD S/OF PSTD ADD

Location Summary:		Units: 1	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Ctr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak	TopDirect	Routine	24	9	12	1	4/23/20	1	TR	0		[REDACTED]	74

Com:

Tline: Owner: Private

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514061/-122.548157

Worked Reason:

Tree Com: .1S/W/OFP2; ROADSIDE

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 12

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 12

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:02 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 680	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513852 / -122.548012		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
[REDACTED] IGO			C-6	-	Q-25		3/17/20 10:02 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 680	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513852 / -122.548012		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT AX [REDACTED] POLES THRU GATE PG&amp;E LOCK

Location Summary:		Units: 2	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Overhang	Accelerat	65	18	16	1	4/9/20	1	TR	0		[REDACTED]	77

Com:	Tline: Owner: Private	Clearance: 16
Wire Type: None	VELB Area: Yes Tree Lat/Lon: 40.514219/-122.547739	Worked Reason:

Tree Com: .1S/E/OF P2 TTB ABV&BLW LN	Worked Comments:
--------------------------------------	------------------

Psc Com:	
----------	--

Alerts:	
---------	--

Com:	Canyon Live O TopDirecti Routine	27 13 14 1	4/9/20	1	TR	0		[REDACTED]	79
------	----------------------------------	------------	--------	---	----	---	--	------------	----

Tline: Owner: Private	Clearance: 14
Wire Type: None	VELB Area: Yes Tree Lat/Lon: 40.514209/-122.547522

Tree Com: .3S/E/OF P2	Worked Comments:
-----------------------	------------------

Psc Com:	
----------	--

Alerts:	
---------	--

Notes:	
--------	--

Location Num: 13

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 13

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:11 AM
XStreet			County SHASTA	Loc Rt: 690	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514197 / -122.547498		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/17/20 10:11 AM
XStreet			County SHASTA	Loc Rt: 690	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514197 / -122.547498		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P3 1S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 3	Notification:
			<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Ctr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Blue Oak	Top	Routine	55	20	14	1	4/23/20	1	TR	0		██████████	82
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.514227/-122.547305														
Wire Type: Raychem VELB Area: Yes Worked Reason:														

Tree Com: .2S/E/OF P3; N/SD,

Worked Comments:

Psc Com: REMOVE TO FLOPPY TOPS TO BELOW LINES

Alerts:

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Ctr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Valley Oak	Top	Routine	50	25	14	1	4/23/20	1	TR	0		██████████	86
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.514379/-122.547423														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .4S/E/OFP3; NXT TO DRWY S/SD

Worked Comments:

Psc Com: TOP SINGLE FLOPPY LIMB TO BELOW LINES

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 13

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:11 AM
XStreet		Group	County SHASTA	Loc Rt: 690	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514197 / -122.547498		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/17/20 10:11 AM
XStreet		Group	County SHASTA	Loc Rt: 690	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514197 / -122.547498		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P3 1S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 3	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Valley Oak	Top	Routine	40	16	14	1	4/23/20	1	TR	0		██████████	87
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: Tree Type: None VELB Area: Yes 40.514549/-122.547248 Worked Reason:														

Tree Com: .4S/E/OFP3; NXT TO DRWY N/SD

Worked Comments:

Psc Com: REMOVE FLOPPY LIMB TO BELOW LINES

Alerts:

Notes:

Location Num: 14



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 14

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:20 AM
XStreet			County SHASTA	Loc Rt: 720	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4051289
			IGO	C-6	-	Q-25	3/17/20 10:20 AM
XStreet			County SHASTA	Loc Rt: 720	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4051289

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P5 3S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 5	Notification:
			<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Gray Pine	Top	Routine	33	8	14	1	4/23/20	1	TR	0		██████████	94
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.515054/-122.546395														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/E/OF P5;

Worked Comments:

Psc Com: N/SD/LINES, NXT TO ROUGH ROAD

Alerts:

██████████	Blue Oak	Side	Routine	39	14	12	1	4/23/20	1	TR	0		██████████	95
Com:														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: 40.515045/-122.546010														

Tree Com: .3S/E/OF P5; N/SD,

Worked Comments:

Psc Com: NXT TO ROUGH ROAD

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 14

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:20 AM
XStreet		Group	County SHASTA	Loc Rt: 720	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4051289
			IGO	C-6	-	Q-25	3/17/20 10:20 AM
XStreet		Group	County SHASTA	Loc Rt: 720	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4051289

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P5 3S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 5	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Blue Oak	Top	Routine	43	16	14	1	4/23/20	1	TR	0		██████████	96
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.515196/-122.546161														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .AS/E/OF P5;

Worked Comments:

Psc Com: NEXT TO ROUGH ROAD

Alerts:

████	Blue Oak	Slope	Routine	35	14	10	1	4/23/20	1	TR	0		██████████	100
Com:														
Tline: Owner: Private Clearance: 10														
Tree Lat/Lon: 40.515268/-122.545720														

Tree Com: .9S/E/OF P5 ; TTB

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 14

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/17/20 10:20 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
XStreet			SHASTA	720	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.516560 / -122.549347				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Access Locked Gate							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	3489			4051289
			IGO	C-6	-	Q-25	3/17/20 10:20 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
XStreet			SHASTA	720	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.516560 / -122.549347				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Access Locked Gate							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4051289

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P5 3S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 5	Notification:	Completed										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
	Gray Pine	Br Trim	Routine	33	3	16	1	4/23/20	1	BT	0			101

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515320/-122.545954

Worked Reason:

Tree Com: .9S/E/OF P5; UNDR LINES

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 15


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 15**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 8:11 AM
XStreet			County SHASTA	Loc Rt: 730	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.515388 / -122.545512		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/19/20 8:11 AM
XStreet			County SHASTA	Loc Rt: 730	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.515388 / -122.545512		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P6 4S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 4	Notification:
			<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Blue Oak	Top	Routine	40	16	12	1	4/23/20	1	TR	0		██████████	102

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515402/-122.545425

Worked Reason:

Tree Com: .1S/E/OF P6

Worked Comments:

Psc Com: TOP TREE BELOW LINES. TAKE BIG WOOD; MAY BE █████ ROAD ROUGH.

Alerts:

████	Gray Pine	Overhang	Routine	80	28	15	1	4/23/20	1	B3	0		██████████	103
------	-----------	----------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515463/-122.545483

Worked Reason:

Tree Com: .2S/E/OF P6; TTB

Worked Comments:

Psc Com: REMOVE LARGE AND SMALL OV LIMB.

Alerts:



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 15

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 8:11 AM
XStreet		Group	County SHASTA	Loc Rt: 730	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.515388 / -122.545512		Customer Name #1		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/19/20 8:11 AM
XStreet		Group	County SHASTA	Loc Rt: 730	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.515388 / -122.545512		Customer Name #1		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P6 4S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 4	Notification:
			<----- Completed ----->

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
	Blue Oak	Top	Routine	40	17	12	1	4/23/20	1	TR	0			104

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515367/-122.545220 Worked Reason:

Tree Com: .3S/E/OF P6

Worked Comments:

Psc Com: LIFT ACCESS IF DRY. ROAD ROUGH; TREE SIGNED UP FOR 12' CLEARANCE LAST YEAR. CLEARANCE NOT MET. TAKE BIG WOOD AND TOP BELOW LINES .

Alerts:

Com:	Blue Oak	Top	Routine	45	17	14	1	4/23/20	1	TR	0			105
Tline:														

Tree Com: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515532/-122.545202 Worked Reason:

Tree Com: .7S/E/OF P6; N/SD/LN, SD/TOO 12'

Worked Comments:

Psc Com: TOP BELOW LINES. TAKE BIG WOOD; SIDE 12' ALSO

Alerts:

Notes:

Location Num: 16



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 16

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 8:36 AM
XStreet			County SHASTA	Loc Rt: 735	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 ██████████		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/19/20 8:36 AM
XStreet			County SHASTA	Loc Rt: 735	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 ██████████		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			
Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P7 LB 5S/E THRU GATE S/OF PSTD ADD PG&E LOCK							

Location Summary: Units: 1			Notification:											
Completed													>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Interior Live Oa Top	Routine	30	14	16	1	4/23/20	1	TR	0		██████████		107
Com:														
Tline:			Owner: Private			Clearance: 16								
Wire Type: None			VELB Area: No			Tree Lat/Lon: 40.515713/-122.545032								
Worked Reason:														

Tree Com: .1S/N/OF P7 LB FLGD/PTD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 17

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 17

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:14 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 740	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513173 / -122.549132		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 530-243-6882	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
[REDACTED] IGO			C-6	-	Q-25	3/4/20 8:14 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 740	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513173 / -122.549132		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 530-243-6882	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

**Loc Comments:** AX 1ST DRWY N/OF ADD [REDACTED] N/SD/OF RD TO P10 TP S/OF HSE PI 1S/E/OF P10 TP. NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. PI [REDACTED] MUST BE PRESENT FOR ALL DRWNS.

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pine Side	Routine	32	8	11	1	1	4/9/20	1	TR	0		[REDACTED]	110

Com:

Tline: Owner: Private Clearance: 11

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513672/-122.548253

Worked Reason:

Tree Com: .7S/E/OF P1; S/SD; TRM BELOW LINES

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Gray Pine	Br Rmv	Routine	22	3	11	1	4/9/20	1	BR	0		[REDACTED]	111
Com:														

Tline: Owner: Private Clearance: 11

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513637/-122.548312

Worked Reason:

Tree Com: .7S/E/OF P1; S/SD; 2 STEMS ; S/SD/LNS

Worked Comments:

Psc Com: BE VERY CAREFUL OF CALIFORNIA WILD ROSE AT BASE OF TREE.

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 17

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:14 AM		
XStreet		Group	County SHASTA	Loc Rt: 740	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513173 / -122.549132		Customer Name #1	Customer Phone #1			
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2	Customer Phone #2 530-243-6882			
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489					
			IGO	C-6	-	Q-25	3/4/20 8:14 AM		
XStreet		Group	County SHASTA	Loc Rt: 740	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513173 / -122.549132		Customer Name #1	Customer Phone #1			
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2	Customer Phone #2 530-243-6882			
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489					
Loc Comments: AX 1ST DRWY N/OF ADD [REDACTED] W/SD/OF RD TO P10 TP S/OF HSE PI 1S/E/OF P10 TP. NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. PI [REDACTED] MUST BE PRESENT FOR ALL DRWNS.									

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Side	Routine	42	14	9	1	4/9/20	1	TR	0		[REDACTED]	112

Com:

Tline: Owner: Private Clearance: 9

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513757/-122.548257

Worked Reason:

Tree Com: .8S/E/OF P1;

Worked Comments:

Psc Com: LINE SIDE

Alerts:

Notes:

Location Num: 18

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 18

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:53 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513575 / -122.549677		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
[REDACTED] IGO			C-6	-	Q-25	3/4/20 8:53 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513575 / -122.549677		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			
Loc Comments: NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P11 IS S O HSE IN PASTURE. NF: PI & TT CONTACT AHEAD OF T ME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LN'S							

Location Summary: Units: 9 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Overhang	Routine	55	20	15	1	4/9/20	1	TR	0		[REDACTED]	114
Com:														
Tline:	Owner: Private				Clearance: 15									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.513482/-122.550025				Worked Reason:								

Tree Com: .2S/N/OF P11

Worked Comments:

Psc Com: 2 LIMBS

Alerts:

[REDACTED]	Valley Oak	TopDirecti	Routine	30	6	14	1	4/9/20	1	TR	0		[REDACTED]	115
Com:														
Tline:	Owner: Private				Clearance: 14									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.513680/-122.549912				Worked Reason:								

Tree Com: .2S/N/OF P11

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 18

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/4/20 8:53 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	760	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.513575 / -122.549677				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	3489			4048795
			IGO	C-6	-	Q-25	3/4/20 8:53 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	760	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.513575 / -122.549677				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048795

Loc Comments: NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P11 IS S O HSE IN PASTURE. NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED.  
CUST WILL LEAD YOU TO THE LN'S

Location Summary: Units: 9 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Top	Routine	30	13	12	1	4/9/20	1	TR	0		[REDACTED]	117
Com:														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: [REDACTED]														
Wire Type: None VELB Area: Yes 40.513826/-122.549909 Worked Reason:														

Tree Com: .3S/N/OF P11; UNDR LINES

Worked Comments:

Psc Com: PTD

Alerts:

X [REDACTED]	Gray Pine	Rmv 1-B	Routine	25	6	1	4/9/20	1	R1	0		[REDACTED]		118
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: [REDACTED]														
Wire Type: None VELB Area: Yes 40.513902/-122.549828 Worked Reason:														

Tree Com: .4S/N/OF P11

Worked Comments:

Psc Com: BE CAREFUL OF SURROUNDING VEGETATION, ESPECIALLY INTERIOR LIVE OAK AND WILD ROSE

Alerts:




**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 18

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 8:53 AM
XStreet		Group	County SHASTA	Loc Rt: 760	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513575 / -122.549677		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4048795
			IGO	C-6	-	Q-25	3/4/20 8:53 AM
XStreet		Group	County SHASTA	Loc Rt: 760	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513575 / -122.549677		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P11 IS S O HSE IN PASTURE. NF: PI & TT  
CONTACT AHEAD OF T ME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED.  
CUST WILL LEAD YOU TO THE LN'S

Location Summary: Units: 9 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Overhang	Routine	70	24	15	1	4/9/20	1	TR	0		[REDACTED]	122

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513973/-122.550008 Worked Reason:

Tree Com: .8S/N/OF P11

Worked Comments:

Psc Com: REMOVE 3 LIMBS ABOVE LINE

Alerts:

[REDACTED]	Gray Pine	Side	Routine	55	11	14	1	4/9/20	1	TR	0		[REDACTED]	123
Com:														

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.513988/-122.550002 Worked Reason:

Tree Com: .8S/N/OF P11; W/SD/LINES

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 18

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/4/20 8:53 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	760	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.513575 / -122.549677				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	3489			4048795
			IGO	C-6	-	Q-25	3/4/20 8:53 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	760	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.513575 / -122.549677				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P11 IS S O HSE IN PASTURE. NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED.  
CUST WILL LEAD YOU TO THE LN'S

Location Summary: Units: 9 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	TopDirecti	Routine	35	14	16	1	4/9/20	1	TR	0		[REDACTED]	124

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514082/-122.550088

Worked Reason:

Tree Com: .9S/N/OF P11 3XSTM

Worked Comments:

Psc Com: TREE TAGGED OUT 10-26-18

Alerts:

Notes:

Location Num: 19

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 19

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 9:26 AM
XStreet			County SHASTA	Loc Rt: 770	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514078 / -122.550007		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048795
██████████			IGO	C-6	-	Q-25	3/4/20 9:26 AM
XStreet			County SHASTA	Loc Rt: 770	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514078 / -122.550007		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD █████ ON W/SD OF ZOGG MINE RD TO HSE, P12 IS S O HSE IN PASTURE. NF: PI & TT  
CONTACT AHEAD OF T ME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED.  
CUST WILL LEAD YOU TO THE LN'S

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Valley Oak	TopDirecti	Routine	35	7	14	1	4/9/20	1	TR	0		██████████	128

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514110/-122.550037

Worked Reason:

Tree Com: .1S/N/OF P12;

Worked Comments:

Psc Com:

Alerts:

██████████	Gray Pine	Rmv 1-B	Routine	35	11	1	4/9/20	1	R1	0		██████████	129
Com:													

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514183/-122.550105

Worked Reason:

Tree Com: .1S/N/OFP12

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 19

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/4/20 9:26 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
SHASTA			770	No			CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.514078 / -122.550007				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	3489			4048795
			IGO	C-6	-	Q-25	3/4/20 9:26 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
SHASTA			770	No			CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.514078 / -122.550007				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P12 IS S O HSE IN PASTURE. NF: PI & TT  
CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED.  
CUST WILL LEAD YOU TO THE LN'S

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Poplar	TopDirecti	Routine	50	25	18	1	4/9/20	1	TR	0		[REDACTED]	136

Com:

Tline: Owner: Private Clearance: 18

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.514557/-122.550298

Worked Reason:

Tree Com: .5S/N/OF P12;

Worked Comments:

Psc Com: FLAGGED ON BERRIES IFO

Alerts:

Notes:

Location Num: 20

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 20

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 9:45 AM
XStreet			County SHASTA	Loc Rt: 780	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514848 / -122.550270		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			
			IGO	C-6	-	Q-25	3/4/20 9:45 AM
XStreet			County SHASTA	Loc Rt: 780	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514848 / -122.550270		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N O PSTD ADD █████ ON W SD O ZOGG MINE RD TO HSE, P13 IS S O HSE IN PASTURE, NF: PI & TT CONTACT AHEAD OF T ME TO SCHEDULE AN APPOINTMENT. IC: PI █████ MUST BE PRESENT FOR ALL PRUNES.

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Blue Oak	Overhang	Routine	45	50	12	1	4/9/20	1	BO	0		██████████	140
<b>Com:</b>														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: 40.515125/-122.550717														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .6S/N/OF P13; BKYD

Worked Comments:

Psc Com: REMOVE SINGLE OV BRANCH THAT IS DANGLING OVER LINE

Alerts:

██████████	Blue Oak	Slope	Routine	50	28	12	1	4/9/20	1	XX	0		██████████	143
<b>Com:</b>														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: 40.515170/-122.550846														

Tree Com: .9S/N/OF P13; BKYD NXT/SHED

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 21


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 21

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 10:13 AM
XStreet			County SHASTA	Loc Rt: 790	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.515728 / -122.551473		Customer Name #1		Customer Phone #1
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4048795
			IGO	C-6	-	Q-25	3/4/20 10:13 AM
XStreet			County SHASTA	Loc Rt: 790	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.515728 / -122.551473		Customer Name #1		Customer Phone #1
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P14 IS N OF HSE, NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LIN'S.

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak TopDirecti	Routine	25	12	12	1	1	4/9/20	1	TR	0		[REDACTED]	144

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515393/-122.551431 Worked Reason:

Tree Com: .1S/N/OF/P14;

Worked Comments:

Psc Com: PLEASE CUT AT NODES

Alerts:

X [REDACTED]	Interior Live Oak Rmv1-B+Trt	Routine	35	5	2	4/9/20	2	R1	0		[REDACTED]			148
Com:	Tline: Owner: Private Clearance:	Tree Lat/Lon:	Wire Type: None VELB Area: Yes 40.515695/-122.551565 Worked Reason:											

Tree Com: .9S/N/OF P14;

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts:

Notes:

Location Num: 22

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 22

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 10:31 AM
XStreet			County SHASTA	Loc Rt: 810	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516562 / -122.552003		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 3489			NTW Number 4048795
██████████			IGO	C-6	-	Q-25	3/4/20 10:31 AM
XStreet			County SHASTA	Loc Rt: 810	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516562 / -122.552003		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048795

Loc Comments: NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD █████ ON W/SD OF ZOGG MINE RD TO HSE, P16 IS N OF HSE, NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LN'S.

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #	
██████████	Interior Live Oak Side	Routine	40	26	12	1	1	4/9/20	1	TR	0		██████████	150	
Com:															
Tline:	Owner: Private			Clearance: 12											
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.516092/-122.551762			Worked Reason:										

Tree Com: .2S/N/OF P16 XSTM; FLGD/PTD

Worked Comments:

Psc Com: LOTS OF POISON OAK

Alerts:

██████████	Gray Pine	Rmv 1-B	Routine	25	9	1	1	4/9/20	1	R1	0		██████████	155	
Com:															
Tline:	Owner: Private			Clearance:											
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.516277/-122.551832			Worked Reason:										

Tree Com: .9S/N/OF P16

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 22

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/4/20 10:31 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
		SHASTA	810	No			CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.516562 / -122.552003				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	3489			4048795
			IGO	C-6	-	Q-25	3/4/20 10:31 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
		SHASTA	810	No			CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.516562 / -122.552003				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First PI Notify First							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048795

Loc Comments: NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P16 IS N OF HSE, NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LN'S.

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Interior Live Oak Rmv1-B+Trt	Routine	27	7	1		1	4/9/20	1	R1	0		[REDACTED]	156

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.516280/-122.551877

Worked Reason:

Tree Com: .9S/N/OF P16; XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 23

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 23

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/4/20 10:54 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 830	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516810 / -122.552230		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4048795
[REDACTED] IGO			C-6	-	Q-25		3/4/20 10:54 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 830	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516810 / -122.552230		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P18 IS N OF HSE, NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LIN'S.

Location Summary: Units: 5 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Live Oak	Rmv1-B+Trt	Routine	30	4		1	4/9/20	1	R1	0		[REDACTED]	157

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.516695/-122.552292 Worked Reason:

Tree Com: .1S/N/OF P18;

Worked Comments:

Psc Com: PLEASE BE CAREFUL OF SURROUNDING VEGETATION . CUSTOMER VERY SENSITIVE

Alerts:

X [REDACTED]	Live Oak	Br Rmv+Trt	Routine	28	3	3	4/9/20	3	BX	0		[REDACTED]	168
Com:													

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.517017/-122.552728 Worked Reason:

Tree Com: .8S/N/OF P18; UNDER LINES, 2 STEMS

Worked Comments:

Psc Com: REMOVE BIG POISON OAK VINE TOO

Alerts:



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 23

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	Q-25	3/4/20 10:54 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			830	No			CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.516810 / -122.552230				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Concerned Customer Notify First Poison-Oak							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	3489			4048795
			IGO	C-6	-	Q-25	3/4/20 10:54 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			830	No			CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.516810 / -122.552230				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Concerned Customer Notify First Poison-Oak							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	3489			4048795

**Loc Comments:** NO PSTD ADD, AXS 1ST DRWY N OF PSTD ADD [REDACTED] ON W/SD OF ZOGG MINE RD TO HSE, P18 IS N OF HSE, NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT. IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LIN'S.

Location Summary: Units: 5 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Blue Oak	Rmv1-B+Trt	Routine	30	6		1	4/9/20	1	R1	0		[REDACTED]	169

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.517027/-122.552742

Worked Reason:

Tree Com: .8S/N/OF P18

Worked Comments:

Psc Com: PLEASE BE CAREFUL OF SURROUNDING VEGETATION

Alerts:

Notes:

Location Num: 24


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 24**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/18/20 4:03 PM		
XStreet			County SHASTA	Loc Rt: 880	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.517115 / -122.546328		Customer Name #1	Customer Phone #1			
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489					
			IGO	C-6	-	Q-25	3/18/20 4:03 PM		
XStreet			County SHASTA	Loc Rt: 880	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.517115 / -122.546328		Customer Name #1	Customer Phone #1			
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489					
Loc Comments: AX GATE @ PSTD ADD. GO RIGHT @ FORK WALK UP HILL TO EP TURN AROUND @ END/OF DRWY PG&E LOCK; P1 AT BOTTOM , ROADSIDE ;									

**Location Summary: Units: 2 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
█████	Blue Oak	Side	Routine	45	14	12	1	4/7/20	2	TR	0		██████████	170

Com:

Tline: Owner: Private  
Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.517412/-122.546258 Worked Reason:

Tree Com: IBO EP

Worked Comments:

Psc Com:

Alerts:

█████	Blue Oak	Rmv 2-B	Routine	40	12	1	4/7/20	1	R2	0		██████████	173
Com:	Tline:	Owner: Private	Clearance:										

Tree Lat/Lon: 40.517412/-122.546258

Worked Reason:

Tree Com: .4S/E/OF EP; N/SD

Worked Comments:

Psc Com: PLEASE PILE BRUSH. THANK YOU

Alerts:

Notes:

**Location Num: 25**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 25

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 12:42 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522163 / -122.557282		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051282
[REDACTED] IGO			C-6	-	Q-25		3/17/20 12:42 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522163 / -122.557282		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051282

Loc Comments: AX DRWY @ PSTD ADD RIGHT @ FORK TO EP S/OF HSE. STEEP DRWY SMALL TA! BE VERY CAREFUL OF FLAGGED PIPELINE NEAR TREES!

Location Summary:	Units: 6	Notification:
<----- Completed ----->		

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Canyon Live O	Rmv4-B+Trt	Routine	40	37		1	4/7/20	1	R3	0		[REDACTED]	180

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522045/-122.557285

Worked Reason:

Tree Com: IBO EP XSTM

Worked Comments:

Psc Com: SMALL TA; REM9VE ALL STEMS AND TREAT

Alerts:

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Blue Oak	Rmv1-B+Trt	Routine	28	10		1	4/7/20	1	R1	0		[REDACTED]	181

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522135/-122.557221

Worked Reason:

Tree Com: AT EP; E/SD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 25

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 12:42 PM
XStreet		Group	County SHASTA	Loc Rt: 890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522163 / -122.557282		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 12:42 PM
XStreet		Group	County SHASTA	Loc Rt: 890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522163 / -122.557282		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: AX DRWY @ PSTD ADD RIGHT @ FORK TO EP S/OF HSE. STEEP DRWY SMALL TAI! BE VERY CAREFUL OF FLAGGED PIPELINE NEAR TREES!

Location Summary: Units: 6 Notification: ← Completed →

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Blue Oak	Rmv2-B+Trt	Routine	35	20		1	4/8/20	1	R2	0		[REDACTED]	182

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522130/-122.557267 Worked Reason:

Tree Com: AT EP; E/SD

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Blue Oak	Rmv2-B+Trt	Routine	35	18		1	4/7/20	1	R2	0		[REDACTED]	183
Com:														

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522123/-122.557290 Worked Reason:

Tree Com: AT EP; E/SD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 25

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 12:42 PM
XStreet		Group	County SHASTA	Loc Rt: 890	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522163 / -122.557282		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051282
			IGO	C-6	-	Q-25	3/17/20 12:42 PM
XStreet		Group	County SHASTA	Loc Rt: 890	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522163 / -122.557282		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051282

Loc Comments: AX DRWY @ PSTD ADD RIGHT @ FORK TO EP S/OF HSE. STEEP DRWY SMALL TAI! BE VERY CAREFUL OF FLAGGED PIPELINE NEAR TREES!

Location Summary: Units: 6 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Ponderosa Pin	Rmv 1-B	Routine	38	9		1	4/7/20	1	R1	0		██████████	184

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522130/-122.557275

Worked Reason:

Tree Com: .1S/S/OF EP; E/SD

Worked Comments:

Psc Com:

Alerts:

█	Blue Oak	Overhang	Routine	45	24	14	1	4/8/20	1	TR	0		██████████	185
---	----------	----------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522087/-122.557310

Worked Reason:

Tree Com: .2S/S/OF EP; E/SD; TOP TO LINE HT; IGNORE X

Worked Comments:

Psc Com: PLEASE PILE BRUSH; PLEASE BE CAREFUL OF ORACLE OAK NEXT TO BLUE OAK. PLEASE BE VERY CAREFUL OF FLAGGED PIPELINE; IGNORE X ON TREE

Alerts:

Notes:

Location Num: 26


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 26

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 3:37 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521237 / -122.557390		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 3:37 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521237 / -122.557390		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P5 LB ON HILL W/OF BRDG.

Location Summary: Units: 2		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live Oak	Slope	Routine	50	18	16	1	4/14/20	1	TR	0		[REDACTED]	188
Com:														
Tline: Owner: Private Clearance: 16														
Tree Lat/Lon: 40.521832/-122.556587 Worked Reason:														
Wire Type: None VELB Area: Yes														

Tree Com: .1S/N/OF P5 LB

Worked Comments:

Psc Com: FLAGGED BELOW; TREE IS STRAIGHT UP HILL FROM FLAG. IT HAS 4 STRANDS OF BARBED WIRE WRAPPED IN IT

Alerts:

[REDACTED]	Live Oak	Side	Accelerat	50	40	16	1	4/14/20	1	TR	0		[REDACTED]	189
Com:														
Tline: Owner: Private Clearance: 16														
Tree Lat/Lon: 40.521828/-122.556711 Worked Reason:														

Tree Com: .1S/N/OF P5 LB; XSTEM

Worked Comments:

Psc Com: ALSO REMOVE FLOPPY TOP

Alerts:

Notes:

Location Num: 27

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 27

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 3:41 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 910	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521237 / -122.557390		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 3:41 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 910	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521237 / -122.557390		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P5 LB ON HILL W/OF BRDG

Location Summary: Units: 2		Notification:											
		<----- Completed ----->											

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	Side	Routine	52	15	14	1	4/14/20	1	TR	0		[REDACTED]	193
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.521772/-122.556991														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/W/OF P5 LB;

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Valley Oak	Side	Routine	65	18	14	1	4/14/20	1	TR	0		[REDACTED]	194
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.521818/-122.557445														

Tree Com: .7S/W/OF P5 LB TBL,TTB

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 28



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 28

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 3:58 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 920	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED] IGO			C-6	-	Q-25		3/17/20 3:58 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 920	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P4 ON DRWY.

Location Summary:		Units: 9	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #

X [REDACTED]	Canyon Live O Rmv2-B+Trt	Routine	35	17	1	4/8/20	1	R2	0			[REDACTED]	201
--------------	--------------------------	---------	----	----	---	--------	---	----	---	--	--	------------	-----

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.521860/-122.557858

Worked Reason:

Tree Com: .2S/W/OF P4;	Worked Comments:
------------------------	------------------

Psc Com:

Alerts:

X [REDACTED]	Canyon Live O Rmv1-B+Trt	Routine	30	11	1	4/8/20	1	R2	0			[REDACTED]	202
--------------	--------------------------	---------	----	----	---	--------	---	----	---	--	--	------------	-----

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.521850/-122.557978

Worked Reason:

Tree Com: .3S/W/OF P4; XSTEM	Worked Comments:
------------------------------	------------------

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 28

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 3:58 PM
XStreet		Group	County SHASTA	Loc Rt: 920	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 3:58 PM
XStreet		Group	County SHASTA	Loc Rt: 920	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P4 ON DRWY.

Location Summary: Units: 9		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Br Rmv	Routine	20	3	2		2	4/6/20	2	BR	0		[REDACTED]	203

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.521828/-122.558083

Worked Reason:

Tree Com: .3S/W/OF P4, 2 STEMS

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Br Rmv+Trt	Routine	20	3	1	4/6/20	1	BX	0		[REDACTED]		204
------------	--------------------------	---------	----	---	---	--------	---	----	---	--	------------	--	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.521357/-122.558890

Worked Reason:

Tree Com: .3S/W/OF P4; 1 STEM

Worked Comments:

Psc Com:

Alerts:



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 28

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 3:58 PM
XStreet		Group	County SHASTA	Loc Rt: 920	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2 ██████████
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 1861			NTW Number 4051281
			IGO	C-6	-	Q-25	3/17/20 3:58 PM
XStreet		Group	County SHASTA	Loc Rt: 920	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2 ██████████
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P4 ON DRWY.

Location Summary:		Units: 9	Notification:		<----- Completed ----->									
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Canyon Live O	Rmv1-B+Trt	Accelerat	30	7	2	2	4/14/20	2	R1	0		██████████	206
Com:														
Tline: Owner: Private Tree Lat/Lon:														
Wire Type: None VELB Area: Yes 40.521353/-122.558763 Worked Reason:														

Tree Com: .4S/W/OF P4;

Worked Comments:

Psc Com: 1 TREE IS ACCELERATE

Alerts:

X	Black Oak	Rmv1-B+Trt	Routine	33	11	2	4/14/20	2	R2	0		██████████		212
Com:														
Tline: Owner: Private Tree Lat/Lon:														
Wire Type: None VELB Area: Yes 40.521262/-122.559162 Worked Reason:														

Tree Com: .8S/W/OF P4; 2 XSTEM, N/SD

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts:

Notes:

Location Num: 29



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 29

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 4:15 PM
XStreet			County SHASTA	Loc Rt: 930	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
			IGO	C-6	-	Q-25	3/17/20 4:15 PM
XStreet			County SHASTA	Loc Rt: 930	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521275 / -122.559370		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P3 ON DRWY

Location Summary: Units: 5			Notification:												
Completed															
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #	
	Canyon Live O Br Rmv+Trt	Routine	20	3	4		4	4/6/20	4	BX	0				216
Com:															
Tline:	Owner: Private			Clearance:											
Wire Type: None	VELB Area: Yes			Tree Lat/Lon: 40.521182/-122.559505											
Worked Reason:															

Tree Com: .3S/W/OF P3; XSTEM

Worked Comments:

Psc Com:

Alerts:

	Black Oak	Br Rmv+Trt	Routine	22	2	1	4/6/20	1	BX	0					218
Com:															
Tline:	Owner: Private			Clearance:											
Wire Type: None	VELB Area: Yes			Tree Lat/Lon: 40.521140/-122.559677											

Tree Com: .3S/W/OF P3; 1STEM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 30



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 30

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 4:18 PM
XStreet			County SHASTA	Loc Rt: 940	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.520997 / -122.559813		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
			IGO	C-6	-	Q-25	3/17/20 4:18 PM
XStreet			County SHASTA	Loc Rt: 940	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.520997 / -122.559813		Customer Name #1		Customer Phone #1
Alerts Locked Gate Notify First Poison-Oak			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P2 AP ON DRWY

Location Summary: Units: 1			Notification:											
			Completed											
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Canyon Live O Rmv2-B+Trt		Routine	25	16	1	1	4/6/20	1	R2	0			227
Com:														
Tline:	Owner: Private		Clearance:											
Wire Type: None	VELB Area: No		Tree Lat/Lon: 40.521346/-122.559841										Worked Reason:	

Tree Com: .2S/W/OF P2 XSTM; RDSD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 31



Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 31

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/17/20 4:23 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 960	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521425 / -122.561828		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/17/20 4:23 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 960	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.521425 / -122.561828		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P1 @ END/OF DRWY P33 TP 1SW X CREEK

Location Summary: Units: 2			Notification:											
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Side	Routine	60	40	14	1	4/14/20	1	TR	0		[REDACTED]	230
Com:														
Tline:	Owner: Private			Clearance: 14										
Wire Type: None	VELB Area: No 40.521782/-122.561419			Worked Reason:										

Tree Com: .2S/S/OF P33 TP; E/SD

Worked Comments:

Psc Com: ABOVE LINES

Alerts:

[REDACTED]	Alder	Top	Routine	35	7	16	1	4/14/20	1	TR	0		[REDACTED]	231
Com:														
Tline:	Owner: Private			Clearance: 16										
Wire Type: None	VELB Area: No 40.521493/-122.561685			Worked Reason:										

Tree Com: .2S/S/OF P33 TP; NXT TO CREEK

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 32

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division Work Order  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 32

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/17/20 4:26 PM
XStreet			County SHASTA	Loc Rt: 990	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522885 / -122.560815		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number
██████████			IGO	C-6	-	P-25	3/17/20 4:26 PM
XStreet			County SHASTA	Loc Rt: 990	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522885 / -122.560815		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P1 @ END/OF DRWY P33 TP 1SW X CREEK P35 2S/N

Location Summary:		Units: 2	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Locust, Black	TopDirecti	Routine	30	15	14	2	4/16/20	2	R2	0		██████████	233
Com:														
Tline:														
Wire Type: None	VELB Area: No													

Tree Com: .9S/N/OF P35; GROWTH

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts:

Notes:

Location Num: 33


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 33

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/17/20 4:28 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1000	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.523498 / -122.560403		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number [REDACTED]
[REDACTED] IGO			C-6	-	P-25	3/17/20 4:28 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1000	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.523498 / -122.560403		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number [REDACTED]

Loc Comments: AX DRWY @ PSTD ADD LEFT @ FORK TO P1 @ END/OF DRWY P33 TP 1SW X CREEK P36 3S/N

Location Summary: Units: 1			Notification:											
			Completed											
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	TopDirecti	Routine	30	20	14	1	4/16/20	1	R2	0		[REDACTED]	235
Com:														
Tline: Owner: Private			Clearance: 14											
Tree Lat/Lon: 40.523752/-122.560187			Worked Reason:											
Wire Type: None VELB Area: Yes														

Tree Com: .4S/N/OF P36; UNDERLINE

Worked Comments:

Psc Com: GROWTH AND LINE SAG

Alerts:

Notes:

Location Num: 34



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 34

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/17/20 4:30 PM
XStreet [REDACTED]			County SHASTA	Loc Rt: 1010	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.523693 / -122.560223		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number [REDACTED]
[REDACTED]			IGO	C-6	-	P-25	3/17/20 4:30 PM
XStreet [REDACTED]			County SHASTA	Loc Rt: 1010	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.523693 / -122.560223		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number [REDACTED]

**Loc Comments:** AX DRWY @ PSTD ADD LEFT @ FORK TO P1 @ END/OF DRWY P33 TP 1S/W X CREEK P37 4S/N TREES FLGD. STOP @ .5S/N/OF P37.  
PICK UP LATER

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Top	Accelerat	35	10	16	1	4/14/20	1	TR	0		[REDACTED]	238

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon: [REDACTED]

Wire Type: None VELB Area: No 40.524131/-122.559730 Worked Reason:

Tree Com: .3S/N/OF P37; W/SD/NXT/TO CRK; XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 35



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

Division 1101 #0103401101  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 35

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 11:54 AM
XStreet			County SHASTA	Loc Rt: 1020	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522272 / -122.552565		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			NTW Number
██████████			IGO	C-6	-	P-25	3/19/20 11:54 AM
XStreet			County SHASTA	Loc Rt: 1020	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522272 / -122.552565		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			NTW Number

Loc Comments: EP RDSD E/OF PSTD ADD. REC 2/2.

Location Summary:		Units: 1	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Gray Pine	Top	Routine	27	6	16	1	4/6/20	1	TR	0		██████████	250

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon: 40.522643/-122.553060

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .9S/W/OF EP

Worked Comments:

Psc Com: GROWTH

Alerts:

Notes:

Location Num: 36

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 36

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 12:31 PM
XStreet			County SHASTA	Loc Rt: 1030	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522690 / -122.553227		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			
			IGO	C-6	-	P-25	3/19/20 12:31 PM
XStreet			County SHASTA	Loc Rt: 1030	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.522690 / -122.553227		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			

Loc Comments: P1 RDSD W/OF PSTD ADD

Location Summary:		Units: 3	Notification:
		<----- Completed ----->	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Interior Live Oak Side	Routine	65	30	15	1	4/6/20	1	TR	0			██████████	254
Com:														
Tline:	Owner: Private				Clearance: 15									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.522895/-122.553458				Worked Reason:								

Tree Com: .3S/W/OF P1

Worked Comments:

Psc Com: ABOVE LINES. CUT BACK POODLE TOPS

Alerts:

██████████	Interior Live Oak Side	Routine	65	22	15	1	4/6/20	1	TR	0			██████████	255
Com:														
Tline:	Owner: Private				Clearance: 15									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.522933/-122.553493				Worked Reason:								

Tree Com: .4S/W/OF P1

Worked Comments:

Psc Com: ABOVE LINES. CUT BACK FLOPPY TOPS

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 36

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	P-25	3/19/20 12:31 PM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
XStreet			SHASTA	1030	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.522690 / -122.553227				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Traffic Issue							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	4191			
			IGO	C-6	-	P-25	3/19/20 12:31 PM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
XStreet			SHASTA	1030	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			40.522690 / -122.553227				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Traffic Issue							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	4191			

Loc Comments: P1 RDSD W/OF PSTD ADD

Location Summary:		Units: 3	Notification:	<-----Completed----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
	Interior Live Oa Side	Routine	55	29	15	1		4/6/20	1	TR	0			256

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.522968/-122.553500

Worked Reason:

Tree Com: .4S/W/OF P1

Worked Comments:

Psc Com: CUT BACK POODLE TOPS

Alerts:

Notes:

Location Num: 37

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 37

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 1:00 PM
XStreet			County SHASTA	Loc Rt: 1050	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.523603 / -122.554777		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			
			IGO	C-6	-	P-25	3/19/20 1:00 PM
XStreet			County SHASTA	Loc Rt: 1050	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.523603 / -122.554777		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			

Loc Comments: P3 RDSD W/OF PSTD ADD

Location Summary: Units: 2			Notification:											
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Blue Oak	Side	Routine	55	18	12	1	4/6/20	1	TR	0		██████████	262
Com:														
Tline:			Owner: Private			Clearance: 12								
Wire Type: None			VELB Area: No			Tree Lat/Lon: 40.523985/-122.554912								
Worked Reason:														

Tree Com: .6S/N/OF P3 FLGD

Worked Comments:

Psc Com:

Alerts:

████	Blue Oak	Top	Accelerat	30	7	14	1	4/6/20	1	TR	0		██████████	263
Com:														
Tline:			Owner: Private			Clearance: 14								
Wire Type: None			VELB Area: No			Tree Lat/Lon: 40.524272/-122.554957								
Worked Reason:														

Tree Com: .9S/N/OF P3; E/SD/RD

Worked Comments:

Psc Com: FLGD IFO ON LIVE OAK

Alerts:

Notes:

Location Num: 38

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 38

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 1:08 PM
XStreet			County SHASTA	Loc Rt: 1060	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.524253 / -122.555038		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			
			IGO	C-6	-	P-25	3/19/20 1:08 PM
XStreet			County SHASTA	Loc Rt: 1060	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.524253 / -122.555038		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			

Loc Comments: P4 RDSD W/OF PSTD ADD

Location Summary:		Units: 1	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Blue Oak	TopDirecti	Routine	30	13	14	1	4/6/20	1	TR	0		██████████	266

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.524707/-122.555242

Worked Reason:

Tree Com: .8S/N/OF P4

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 39


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 39

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 2:49 PM
XStreet			County SHASTA	Loc Rt: 1070	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.524725 / -122.555055		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			
			IGO	C-6	-	P-25	3/19/20 2:49 PM
XStreet			County SHASTA	Loc Rt: 1070	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.524725 / -122.555055		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			

Loc Comments: P5 RDSD W/OF PSTD ADD

Location Summary:		Units: 1	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Interior Live Oak Slope	Routine	35	26	12	1	1	4/6/20	1	TR	0		██████████	268

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.525288/-122.555567

Worked Reason:

Tree Com: .7S/N/OF P5; 2XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 40



**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

Division Number: 20  
Circuit: GIRVAN 1101 #0103401101

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 40

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 2:52 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1080	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.525343 / -122.555710		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			
[REDACTED] IGO			C-6	-	P-25	3/19/20 2:52 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1080	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.525343 / -122.555710		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			

Loc Comments: P6 RDSD W/OF PSTD ADD

Location Summary: Units: 1		Notification:												
		Completed											>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	TopDirecti	Routine	30	18	12	1	4/6/20	1	TR	0		[REDACTED]	280
Com:														
Tline: Owner: Private			Clearance: 12											
Tree Lat/Lon: 40.525828/-122.556462			Worked Reason:											
Wire Type: None VELB Area: Yes														

Tree Com: .9S/W/OF P6; 2XSTEM; FLGD RDSD ON LIVE OAK

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 41



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 41

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 2:57 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1100	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526290 / -122.556715		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			NTW Number
[REDACTED]			IGO		C-6	-	Q-25 3/19/20 2:57 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1100	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526290 / -122.556715		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			NTW Number

Loc Comments: P8 RDSD S/OF PSTD ADD. REC 1/2

Location Summary: Units: 1		Notification:										
		<----- Completed ----->										

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak Side	Routine	35	13	12	1	1	4/6/20	1	TR	0		[REDACTED]	282

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.526462/-122.556832

Worked Reason:

Tree Com: .3S/N/OF P8;

Worked Comments:

Psc Com: FLGD AT FNC AND PTD; RMV SNOW BENT LIMB

Alerts:

Notes:

Location Num: 42



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 42

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 3:02 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1120	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.524760 / -122.559463		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First Riparian Area Riparian			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number
[REDACTED]			IGO		C-6	-	Q-25 3/19/20 3:02 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1120	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.524760 / -122.559463		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First Riparian Area Riparian			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number

Loc Comments: THRU GATE RIGHT @ FORK TO P40 P38 2S/S/OF P40 GATE CODE [REDACTED] VERY NICE PEOPLE

Location Summary: Units: 1			Notification:											
			Completed										>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oa Br Trim	Routine	26	3	14	1	1	4/9/20	1	BT	0	[REDACTED]	[REDACTED]	286

Com:

Tline: Owner: Private Clearance: 14  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.524598/-122.559593 Worked Reason:

Tree Com: AT P38; GROWTH

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 43



Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 43

Address		City	Quad Map	Thomas Guide	Area	Inspection Date / Time
		IGO	C-6	-	P-25	3/19/20 3:20 PM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	1130	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		40.525315 / -122.559068				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			0000-0000	1861		4051290
		IGO		C-6	-	3/19/20 3:20 PM
XStreet	Group	County	Loc Rt:	U-Bld	Insp	Inspection Company
		SHASTA	1130	No		CN Utility
Location Directions		Loc Lat/Lon		Customer Name #1	Customer Phone #1	
S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		40.525315 / -122.559068				
Alerts		Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate Notify First						
SRA	Tag Number	Tag Type	Packet Project #	SSD #:		NTW Number
Yes			0018-1363	1861		4051290

Loc Comments: THRU GATE RIGHT @ FORK TO P40 P39 1S/S/OF P40 SEC EP 1S/E/OF P39 GATE CODE [REDACTED]

Location Summary:		Units: 1	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Sec Strain	Routine	38	16	6	1	4/16/20	1	TR	0		[REDACTED]	294
Com:														
Tline: Owner: Private Clearance: 6														
Tree Lat/Lon: 40.525267/-122.559133 Worked Reason:														

Tree Com: .7S/W/OF SEC EP; AT CREEK

Worked Comments:

Psc Com: TREE NOT PAINTED OR FLAGGED

Alerts:

Notes:

Location Num: 44

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 44

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 8:10 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1160	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526073 / -122.558590		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED] IGO			C-6	-	P-25	3/23/20 8:10 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1160	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526073 / -122.558590		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: THRU GATE RIGHT @ FORK TO P40 P41 1S/N/OF P40 GATE CODE [REDACTED]

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	Top	Routine	30	14	14	1	4/9/20	1	TR	0		[REDACTED]	296

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.526296/-122.558098

Worked Reason:

Tree Com: .3S/N/OF P41

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Ponderosa Pin Overhang	Routine	70	24	16	1	4/9/20	1	TR	0		[REDACTED]	297
Com:													

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.526438/-122.557924

Worked Reason:

Tree Com: .7S/N/OF P41

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 44

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 8:10 AM
XStreet		Group	County SHASTA	Loc Rt: 1160	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526073 / -122.558590		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 8:10 AM
XStreet		Group	County SHASTA	Loc Rt: 1160	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526073 / -122.558590		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: THRU GATE RIGHT @ FORK TO P40 P41 1S/N/OF P40 GATE CODE [REDACTED]

Location Summary: Units: 3		Notification:												
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Top	Routine	28	7	16	1	4/9/20	1	TR	0		[REDACTED]		298
Com:														

Tline: Owner: Private Clearance: 16  
Tree Lat/Lon:  
Wire Type: None VELB Area: No 40.526057/-122.558251 Worked Reason:

Tree Com: .7S/N/OF P41

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 45

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 45

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 4:23 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1170	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527822 / -122.556895		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			
[REDACTED] IGO			C-6	-	Q-25		3/19/20 4:23 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1170	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527822 / -122.556895		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			

Loc Comments: P9 RDSD N/OF PSTD ADD [REDACTED] REC 1/2, W/SD/OF RD

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	Side	Routine	45	26	14	1	4/7/20	1	TR	0		[REDACTED]	299

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527105/-122.556788

Worked Reason:

Tree Com: .2S/W/OF P9

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Valley Oak	Side	Routine	60	26	12	1	4/7/20	1	TR	0		[REDACTED]	300
------------	------------	------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527292/-122.557060

Worked Reason:

Tree Com: .3S/W/OF P9; E/SD/RD

Worked Comments:

Psc Com: TRIM ABV AND BELOW

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 45

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/19/20 4:23 PM
XStreet		Group	County SHASTA	Loc Rt: 1170	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527822 / -122.556895		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4191			NTW Number
[REDACTED]			IGO	C-6	-	Q-25	3/19/20 4:23 PM
XStreet		Group	County SHASTA	Loc Rt: 1170	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527822 / -122.556895		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4191			NTW Number

Loc Comments: P9 RDSD N/OF PSTD ADD [REDACTED] REC 1/2, W/SD/OF RD

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Side	Routine	70	29	12	1	4/7/20	1	TR	0		[REDACTED]	303

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527435/-122.556938 Worked Reason:

Tree Com: .5S/W/OF P9 TTB; FLGD IFO

Worked Comments:

Psc Com: TREE HAS POSTED SIGN

Alerts:

[REDACTED]	Interior Live Oa Side	Routine	32	21	14	1	4/7/20	1	TR	0		[REDACTED]	304
------------	-----------------------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527493/-122.557012 Worked Reason:

Tree Com: .6S/W/OF P9;

Worked Comments:

Psc Com: SNOW BENT EAST SIDE OF ROAD

Alerts:

Notes:

Location Num: 46


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 46

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 4:49 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1190	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527707 / -122.557128		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED] IGO			C-6	-	P-25	3/19/20 4:49 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1190	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527707 / -122.557128		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] TREE CREW CALL [REDACTED] FOR ACCESS. [REDACTED] SHE WILL LET YOU IN

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Blue Oak	Side	Routine	45	14	12	1	4/7/20	1	TR	0		[REDACTED]	310

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon: 40.527200/-122.557215

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .7S/S/OF P44 TP SSD#4191 ; W/SD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 47


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 47**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 7:50 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bee/Wasp Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED] IGO			C-6	-	P-25		3/23/20 7:50 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bee/Wasp Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P43 1S/ NO PG&amp;E LOCK

Location Summary: Units: 9		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak Top	Routine	50	16	13	1	4/7/20	1	TR	0			[REDACTED]	312
<b>Com:</b>														
Tline:	Owner: Private				Clearance: 13									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.527095/-122.557678				Worked Reason:								

Tree Com: @ P43 TRIM BOTH LINES

Worked Comments:

Psc Com: TOP TREE DOWN TO LINE HEIGHT . SNOW BENT; SD TOO

Alerts:

[REDACTED]	Blue Oak	Side	Accelerat	55	24	12	1	4/7/20	1	TR	0		[REDACTED]	313
<b>Com:</b>														
Tline:	Owner: Private				Clearance: 12									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.527075/-122.557710				Worked Reason:								

Tree Com: .1S/S/OF P43

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 47

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 7:50 AM
XStreet		Group	County SHASTA	Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bee/Wasp Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED]			IGO	C-6	-	P-25	3/23/20 7:50 AM
XStreet		Group	County SHASTA	Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bee/Wasp Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P43 1S/ NO PG&amp;E LOCK

Location Summary: Units: 9 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Br Rmv	Routine	30	3	3	3	4/7/20	3	BR	0		[REDACTED]	315

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.526883/-122.557977

Worked Reason:

Tree Com: .7-.8S/S/OF P43; UNDR LN; 3 STEMS

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts:

[REDACTED]	Ponderosa Pin Rmv 1-B	Routine	26	5	1	4/7/20	1	R1	0		[REDACTED]		316
Com:	Tline:	Owner: Private	Clearance:										

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.526770/-122.557962

Worked Reason:

Tree Com: .7S/S/OF P43; UNDR LN

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 47

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 7:50 AM
XStreet		Group	County SHASTA	Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bee/Wasp Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED]			IGO	C-6	-	P-25	3/23/20 7:50 AM
XStreet		Group	County SHASTA	Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bee/Wasp Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P43 1S/ NO PG&amp;E LOCK

Location Summary: Units: 9 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	23	5		1	4/7/20	1	R1	0		[REDACTED]	317

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.526765/-122.557977

Worked Reason:

Tree Com: ..8S/S/OF P43; UNDR LN; 3 STEMS

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts:

X [REDACTED]	Ponderosa Pin	Rmv 1-B	Routine	28	7		1	4/7/20	1	R1	0		[REDACTED]	319
--------------	---------------	---------	---------	----	---	--	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.526792/-122.557942

Worked Reason:

Tree Com: .8-.9S/S/OF P43;

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 47

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 7:50 AM
XStreet	Group	County SHASTA		Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Bee/Wasp Locked Gate		Struct1		Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED]		IGO		C-6	-	P-25	3/23/20 7:50 AM
XStreet	Group	County SHASTA		Loc Rt: 1200	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		Loc Lat/Lon 40.526777 / -122.557947		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Bee/Wasp Locked Gate		Struct1		Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P43 1S/ NO PG&amp;E LOCK

Location Summary:		Units: 9	Notification:	<-----Completed----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Ponderosa Pin	Rmv 1-B	Routine	25	4	1	1	4/7/20	1	R1	0	[REDACTED]	[REDACTED]	320

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.526715/-122.557957

Worked Reason:

Tree Com: .9S/S/OF P43;

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts:

Notes:

Location Num: 48


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 48**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 9:31 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED] IGO			C-6	-	P-25		3/23/20 9:31 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] TREES NORTH/EAST.

Location Summary: Units: 7 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Side	Routine	70	15	14	1	4/7/20	1	TR	0		[REDACTED]	323

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527838/-122.557030

Worked Reason:

Tree Com: .2S/N/OF P44 TP SSD#4191; ROADSIDE

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Blue Oak	TopDirecti	Routine	36	10	14	1	4/7/20	1	TR	0		[REDACTED]	325
------------	----------	------------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527898/-122.557012

Worked Reason:

Tree Com: .3S/NE/OF P44 TP SSD#4191;

Worked Comments:

Psc Com: TOP BELOW LINES

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 48

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 9:31 AM
XStreet		Group	County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 9:31 AM
XStreet		Group	County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] TREES NORTH/EAST.

Location Summary: Units: 7 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak Top	Routine	35	17	14	1	1	4/23/20	1	TR	0		[REDACTED]	326

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.527983/-122.556952 Worked Reason:

Tree Com: .3S/NE/OF P44 TP SSD#4191

Worked Comments:

Psc Com: REMOVE FLOPPY TOP

Alerts:

[REDACTED]	Interior Live Oak Top Direct	Routine	26	25	12	1	1	4/23/20	1	TR	0		[REDACTED]	328
------------	------------------------------	---------	----	----	----	---	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.528299/-122.556760 Worked Reason:

Tree Com: .7S/N/OF P44 TP SSD#4191 XSTM

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 48

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 9:31 AM
XStreet		Group	County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 9:31 AM
XStreet		Group	County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] TREES NORTH/EAST.

Location Summary:		Units: 7	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak TopDirecti	Routine	30	26	12	1	1	4/23/20	1	TR	0		[REDACTED]	329

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.528137/-122.556777

Worked Reason:

Tree Com: .7S/N/OF P44 TP SSD#4191 2XSTM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Gray Pine	Overhang	Routine	65	16	16	1	4/23/20	1	TR	0		[REDACTED]	331
Com:														
Tline:	Owner: Private Clearance: 16													
Wire Type: None	VELB Area: Yes	40.528155/-122.556760	Worked Reason:											

Tree Com: .8S/N/OF P44 TP SSD#4191; SD TOO 10'

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 48**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 9:31 AM
XStreet		Group	County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 9:31 AM
XStreet		Group	County SHASTA	Loc Rt: 1210	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527607 / -122.557132		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] TREES NORTH/EAST.

**Location Summary: Units: 7 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak TopDirecti	Routine	26	20	14	1	1	4/23/20	1	TR	0		[REDACTED]	332

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.528220/-122.556740

Worked Reason:

Tree Com: .9S/N/OF P44 TP SSD#4191

Worked Comments:

Psc Com: GROWTH AND LOW LINES

Alerts:

Notes:

**Location Num: 49**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 49

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 10:07 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1220	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.528362 / -122.556693		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051295
[REDACTED]			IGO	C-6	-	P-25	3/23/20 10:07 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1220	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.528362 / -122.556693		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051295

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD; P45 1S/NE UP HILL

Location Summary: Units: 2			Notification:														
Completed																	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #			
[REDACTED]	Gray Pine	Top	Routine	45	15	16	1	4/23/20	1	TR	0		[REDACTED]	339			
Com:																	
Tline:	Owner: Private				Clearance: 16												
Wire Type: None	VELB Area: Yes				Tree Lat/Lon: 40.529105/-122.556605												
Worked Reason:																	

Tree Com: .5S/N/OF P45; E/OF LN; 2XSTM

Worked Comments:

Psc Com: REMOVE FLOPPY TOPS TO BELOW LINE

Alerts:

[REDACTED]	Gray Pine	Top	Routine	34	8	14	1	4/23/20	1	TR	0		[REDACTED]	340			
Com:																	
Tline:	Owner: Private				Clearance: 14												
Wire Type: None	VELB Area: Yes				Tree Lat/Lon: 40.528943/-122.556668												

Tree Com: .8S/N/OF P45; W/OF LN,

Worked Comments:

Psc Com: GROWTH

Alerts:

Notes:

Location Num: 50

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 50

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:27 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1230	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530417 / -122.556358		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED] IGO			C-6	-	P-25	3/23/20 11:27 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1230	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530417 / -122.556358		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			
Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P47 3S/N E/SD/OF RD TREES E/OF FNC.							

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Top	Routine	30	5	15	2	4/23/20	2	TR	0		[REDACTED]	342

Com:

Tline: Owner: Private Clearance: 15  
Tree Lat/Lon: 40.530332/-122.556507

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .1S/S/OF P47

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts:

[REDACTED]	Interior Live Or TopDirecti	Routine	50	24	14	1	4/23/20	1	TR	0		[REDACTED]	347
------------	-----------------------------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14  
Tree Lat/Lon: 40.530319/-122.556503

Wire Type: None VELB Area: Yes Worked Reason:

Tree Com: .3S/S/OF P47; E/SD; 2XSTEM

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 50

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:27 AM
XStreet		Group	County SHASTA	Loc Rt: 1230	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530417 / -122.556358		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 11:27 AM
XStreet		Group	County SHASTA	Loc Rt: 1230	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530417 / -122.556358		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			
Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P47 3S/N E/SD/OF RD TREES E/OF FNC.							

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Side	Routine	60	13	12	1	4/23/20	1	TR	0		[REDACTED]	349

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.529988/-122.556445 Worked Reason:

Tree Com: .3S/S/OF P47; TTB, E/SD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Blue Oak	Side	Routine	40	26	12	1	4/23/20	1	TR	0		[REDACTED]	351
------------	----------	------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.529813/-122.556652 Worked Reason:

Tree Com: .6S/S/OF P47 2XSTM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 51


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 51**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:11 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1240	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530453 / -122.556488		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED] IGO			C-6	-	P-25	3/23/20 11:11 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1240	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530453 / -122.556488		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P47 3S/N E/SD/OF RD TREES E/OF FNC.

Location Summary:	Units: 5	Notification:
-------------------	----------	---------------

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin	Top	Routine	24	8	12	1	4/27/20	1	TR	0		[REDACTED]	352
Com:														
Tline:	Owner: Private				Clearance: 12									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.530440/-122.556428				Worked Reason:								

Tree Com: .1S/N/O P47

Worked Comments:

Psc Com: LOW LINES

Alerts:

[REDACTED]	Interior Live On Slope	Routine	40	25	14	1	4/27/20	1	TR	0		[REDACTED]	[REDACTED]	353
Com:														
Tline:	Owner: Private				Clearance: 14									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.530548/-122.556508				Worked Reason:								

Tree Com: .2S/N/OF P47 2XSTM

Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 51**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:11 AM
XStreet		Group	County SHASTA	Loc Rt: 1240	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530453 / -122.556488		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 11:11 AM
XStreet		Group	County SHASTA	Loc Rt: 1240	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530453 / -122.556488		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P47 3S/N E/SD/OF RD TREES E/OF FNC.

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	Side	Routine	58	28	14	1	4/27/20	1	TR	0		[REDACTED]	354

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.530567/-122.556473 Worked Reason:

Tree Com: .3S/N/OF P47 SD TOO 12';

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Live Oak	Side	Routine	42	21	12	1	4/27/20	1	TR	0		[REDACTED]	356
Com:														

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.530748/-122.556465 Worked Reason:

Tree Com: .3S/N/OF P47;

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 51

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:11 AM
XStreet		Group	County SHASTA	Loc Rt: 1240	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530453 / -122.556488		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 11:11 AM
XStreet		Group	County SHASTA	Loc Rt: 1240	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.530453 / -122.556488		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD [REDACTED] P47 3S/N E/SD/OF RD TREES E/OF FNC.

Location Summary: Units: 5		Notification:													
Completed															
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #	
[REDACTED]	Gray Pine	Side	Routine	55	24	14	1	4/27/20	1	TR	0		[REDACTED]	359	
Com:															

Tline: Owner: Private Clearance: 14  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.531432/-122.556362 Worked Reason:

Tree Com: .8S/N/OF P47; TTB

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 52


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 52**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:56 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1255	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED] IGO			C-6	-	P-25	3/23/20 11:56 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1255	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P48 SSD#4855 RDSD N/OF PSTD ADD [REDACTED] P49 1S/W AX GATE A/F P48; TREE CREW NF FOR ACCESS

Location Summary: Units: 6			Notification:											
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Locust, Black	Side	Routine	60	18	14	1	4/27/20	1	BB	0		[REDACTED] 361	
Com:														
Tline: Owner: Private			Clearance: 14											
Tree Lat/Lon: 40.532427/-122.556982			Worked Reason:											

Tree Com: .2S/E/OF P49;

Worked Comments:

Psc Com: NEW CONSTRUCTION.

Alerts:

[REDACTED]	Interior Live On TopDirecti	Routine	35	16	14	1	4/27/20	1	TR	0		[REDACTED]	364
Com:													
Tline: Owner: Private			Clearance: 14										
Tree Lat/Lon: 40.532108/-122.556707			Worked Reason:										

Tree Com: .4S/E/OF P49 TP

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 52

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:56 AM
XStreet		Group	County SHASTA	Loc Rt: 1255	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED]			IGO	C-6	-	P-25	3/23/20 11:56 AM
XStreet		Group	County SHASTA	Loc Rt: 1255	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

Loc Comments: P48 SSD#4855 RDSD N/OF PSTD ADD [REDACTED] P49 1S/W AX GATE A/F P48; TREE CREW NF FOR ACCESS

Location Summary: Units: 6		Notification:													
Completed														>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #	
[REDACTED]	Cottonwood, B TopDirecti		Routine	35	10	18	4	4/27/20	4	TR	0		[REDACTED]	368	
Com:															

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.532093/-122.556713  
Worked Reason:

Tree Com: .6S/E/OF P49 TP. AVG DBH

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 53

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 53**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 12:18 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1270	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED] IGO			C-6	-	P-25		3/23/20 12:18 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1270	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P48 SSD#4855 RDSD N/OF PSTD ADD [REDACTED] P49 1S/W AX GATE A/F P48.

**Location Summary: Units: 1 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	50	28	12	1	4/27/20	1	TR	0		[REDACTED]		372
Com:														
Tline:		Owner: Private						Clearance: 12						
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.532897/-122.557532						Worked Reason:						

Tree Com: .9S/W/OF P49 TP 2XSTM TTB; FLGD

Worked Comments:

Psc Com: NEW CONSTRUCTION

Alerts:

Notes:

**Location Num: 54**


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 54**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 12:21 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1280	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532975 / -122.557593		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED] IGO			C-6	-	P-25	3/23/20 12:21 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1280	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532975 / -122.557593		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

Loc Comments: P48 SSD#4855 RDSD N/OF PSTD ADD [REDACTED] P50 2S/W AX GATE A/F P48

**Location Summary: Units: 1 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Com:	Routine	46	12	12	1	4/27/20	1	TR	0		[REDACTED]	377

Tline: Owner: Private Clearance: 12

Tree Lat/Lon: 40.533035/-122.557707

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .2S/N/OF P50; W/SD; FLGD/PTD

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 55**

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 55**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 1:57 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1310	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.536350 / -122.558112		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Dog Traffic Issue			Struct1		Struct2	Customer Name #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED]			IGO		C-6	-	P-25
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1310	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.536350 / -122.558112		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Dog Traffic Issue			Struct1		Struct2	Customer Name #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

Loc Comments: P54 RDSD A/F &amp; S/OF PSTD ADD.

**Location Summary: Units: 1 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak Side	Routine	60	40	20	1	4/27/20	1	XX	0		[REDACTED]		380
Com:														
Tline:	Owner: Private				Clearance: 20									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.536795/-122.558015				Worked Reason:								

Tree Com: .8S/N/OF P54; E/SD

Worked Comments:

Psc Com: AT AND ABOVE LINES, SNOW BENT; PLEASE TAKE BIG WOOD. THIS TREE HAS BEEN A CONTINUOUS PROBLEM

Alerts:

Notes:

**Location Num: 56**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 56

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:11 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1335	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.384208 / -122.339382		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED] IGO			C-6	-	P-25	3/23/20 2:11 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1335	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.384208 / -122.339382		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] P57 1S S CAN AXS FRM RD FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY MUST GET KEY FROM [REDACTED]

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	TopDirecti	Routine	42	25	16	1	4/13/20	1	TR	0		[REDACTED]	385

Com:

Tline: Owner: Private Clearance: 16  
Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537263/-122.559713 Worked Reason:

Tree Com: .2S/E/OF P57

Worked Comments:

Psc Com: UP HILL FROM ROAD ; MIGHT BE [REDACTED] 70' LIFT AT LEAST

Alerts:

Notes:

Location Num: 57

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 57

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:54 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/23/20 2:54 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST GET KEY FROM [REDACTED] STEEP DRWY! CAN AXS FRM RD FLGD BEFORE GT

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	23	4	1	1	4/13/20	1	R1	0		[REDACTED]	386

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.538158/-122.560875

Worked Reason:

Tree Com: .1S/E/OF P58 TP; UNDR LINES

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Canyon Live O Br Rmv+Trt	Routine	22	2	1	4/13/20	1	BX	0		[REDACTED]			395
--------------	--------------------------	---------	----	---	---	---------	---	----	---	--	------------	--	--	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537850/-122.560447

Worked Reason:

Tree Com: .6S/E/OF P58 TP- LOOKS DEAD; FLGD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 57

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST GET KEY FROM [REDACTED] STEEP DRWY! CAN AXS FRM RD FLGD BEFORE GT

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Br Rmv	Routine	22	3		1	4/13/20	1	BR	0		[REDACTED]	396

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537857/-122.560288

Worked Reason:

Tree Com: .6S/E/OF P58 TP; 3 TREES, UNDERLINE; DEAD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Gray Pine	Rmv 2-B	Routine	40	20		1	4/13/20	1	R2	0		[REDACTED]	399
Com:	Tline:	Owner: Private	Clearance:											

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537691/-122.559834

Worked Reason:

Tree Com: .9S/E/OF P58 TP

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 58


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 58**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 3:07 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1350	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538220 / -122.560883		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED] IGO			C-6	-	P-25		3/23/20 3:07 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1350	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538220 / -122.560883		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

**Loc Comments:** P58 TP ON DRWY, 1ST DRWY PAST PSTD ADD [REDACTED] FLGD GT EP 1S/N/OF P58 TP CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO GET KEY [REDACTED] LOW SPAN.

**Location Summary: Units: 4 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak Top	Routine	30	38	14	1	1	4/13/20	1	BA	0		[REDACTED]	403
<b>Com:</b>														
Tline:	Owner: Private				Clearance: 14									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.538267/-122.560800				Worked Reason:								

Tree Com: .3S/N/OF P58 TP. SNOW BENT

Worked Comments:

Psc Com: TOP ALL LINE SIDE LEADS TO BELOW LINES. TAKE BIG WOOD; NEW CONSTRUCTION

Alerts:

X [REDACTED]	Blue Oak	Rmv2-B+Trt	Routine	40	13	1	4/9/20	1	R2	0		[REDACTED]		407
<b>Com:</b>														
Tline:	Owner: Private				Clearance:									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.538432/-122.560782				Worked Reason:								

Tree Com: .7S/N/O P58 TP; XSTEM ,FLGD+PNT ON E/SD

Worked Comments:

Psc Com: NEW CONSTRUCTION

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 58

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 3:07 PM
XStreet		Group	County SHASTA	Loc Rt: 1350	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538220 / -122.560883		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/23/20 3:07 PM
XStreet		Group	County SHASTA	Loc Rt: 1350	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538220 / -122.560883		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY, 1ST DRWY PAST PSTD ADD [REDACTED] FLGD GT EP 1S/N/OF P58 TP CUST WANTS TO KNOW WHO IS ON PROPERTY MUST CALL TO GET KEY [REDACTED] LOW SPAN.

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Blue Oak	Rmv2-B+Trt	Routine	40	17		1	4/9/20	1	R2	0		[REDACTED]	409

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.538588/-122.560840

Worked Reason:

Tree Com: .7S/N/OF P58 TP; XSTEM ,FLGD/PTD

Worked Comments:

Psc Com: NEW CONSTRUCTION

Alerts:

X [REDACTED]	Blue Oak	Rmv2-B+Trt	Routine	42	13		1	4/9/20	1	R2	0		[REDACTED]	410
Com:														

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.538775/-122.560808

Worked Reason:

Tree Com: AT EP

Worked Comments:

Psc Com: NEW CONSTRUCTION

Alerts:

Notes:

Location Num: 59


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 59

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 3:33 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1360	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538043 / -122.560788		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/23/20 3:33 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1360	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538043 / -122.560788		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

**Loc Comments:** P58 TP ON DRWY, 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY. MUST CALL TO GET KEY [REDACTED] PLEASE CHIP BRUSH FROM TREES THAT ARE NEXT TO DRIVEWAY;

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 2-B	Routine	60	17	1	1	4/9/20	1	R2	0	[REDACTED]	[REDACTED]	412

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.538144/-122.560976 Worked Reason:

Tree Com: .1S/W/OF P58 TP

Worked Comments:

Psc Com: PLEASE CHIP BRUSH FROM THIS TREE; TREE IS NEXT TO DRIVEWAY

Alerts:

Notes:

Location Num: 60


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 60

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:44 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1380	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539310 / -122.562918		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED] IGO			C-6	-	P-25	3/26/20 2:44 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1380	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539310 / -122.562918		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

**Loc Comments:** P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P60 2S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM ZOGG MINE UP HILL.CUST WANTS TO KNOW WHO IS ON PROPERTY.

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Canyon Live O	Rmv2-B+Trt	Routine	32	12	1	1	4/14/20	1	R2	0		[REDACTED]	416

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon: 40.539835/-122.566328

Wire Type: None VELB Area: Yes

Worked Reason:

Tree Com: .1S/W/OF P60;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 61

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 61

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:49 PM		
XStreet			County SHASTA	Loc Rt: 1400	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539563 / -122.564363		Customer Name #1	Customer Phone #1			
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855					
			IGO	C-6	-	P-25	3/26/20 2:49 PM		
XStreet			County SHASTA	Loc Rt: 1400	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539563 / -122.564363		Customer Name #1	Customer Phone #1			
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855					
Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P62 4S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UPHILL.CUST WANTS TO KNOW WHO IS ON PROPERTY.									

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Knobcone Pine Rmv1-B+Trt	Routine	33	8	1		1	4/14/20	1	R1	0		[REDACTED]	423

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.539607/-122.564530

Worked Reason:

Tree Com: .1S/W/OF P62; 2XSTEM

Worked Comments:

Psc Com:

Alerts:

Com:	Canyon Live O TopDirecti	Routine	35	32	15	1	4/14/20	1	TR	0		[REDACTED]	424
Tline:	Owner: Private	Clearance: 15											

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.539852/-122.566278

Worked Reason:

Tree Com: .1S/W/OF P62; XSTEM; N/SD/LINES

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 61

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:49 PM
XStreet		Group	County SHASTA	Loc Rt: 1400	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539563 / -122.564363		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/26/20 2:49 PM
XStreet		Group	County SHASTA	Loc Rt: 1400	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539563 / -122.564363		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P62 4S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UPHILL. CUST WANTS TO KNOW WHO IS ON PROPERTY.

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 1-B	Routine	30	6	1	1	4/14/20	1	R1	0	[REDACTED]	[REDACTED]	425

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.539847/-122.566313 Worked Reason:

Tree Com: .3S/W/OF P62;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 62


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 62**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 1:01 PM
XStreet			County SHASTA	Loc Rt: 1410	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539270 / -122.566507		Customer Name #1		Customer Phone #1
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
			IGO	C-6	-	P-25	3/24/20 1:01 PM
XStreet			County SHASTA	Loc Rt: 1410	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539270 / -122.566507		Customer Name #1		Customer Phone #1
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: AX DRWY @ PSTD ADD EP ON DRWY.

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
█████	Canyon Live O	TopDirecti	Routine	35	26	12	1	4/27/20	1	TR	0		██████████	426
Com:														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: 40.538917/-122.566394 Worked Reason:														

Tree Com: .1S/N/OF EP 2XSTM

Worked Comments:

Psc Com:

Alerts:

█████	Oracle Oak	TopDirecti	Routine	30	18	12	1	4/27/20	1	TR	0		██████████	428
Com:														
Tline: Owner: Private Clearance: 12														
Wire Type: Raychem VELB Area: No 40.539120/-122.566427 Worked Reason:														

Tree Com: .6S/N/OF EP; UNDERLINE ON RD

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 63**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 63**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 1:38 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1414	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540708 / -122.569018		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051286
[REDACTED]			IGO C-6		-	P-25	3/18/20 1:38 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1414	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540708 / -122.569018		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051286

**Loc Comments:** AX DRWY @ PSTD ADD RIGHT @ FORK X BRDG RIGHT @ FORK TO EP IFO HSE.SMALL TAI DROP CHIPPER. NF IN PERSON. SMALL TRUCK ONLY. NO PHONE, STOP BY, OR CALL CELL PHONE.

**Location Summary: Units: 7 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Vine	Br Rmv+Trt	Routine	55	3		1	4/27/20	1	BX	0		[REDACTED]	435

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.540582/-122.568843

Worked Reason:

Tree Com: .4S/N/OF EP; VINE GROWING ON PONDEROSA PINE

Worked Comments:

Psc Com: CUT AT BASE BELOW FENCE. DON'T WORRY ABOUT REMOVING WOOD, JUST KILL IT!

Alerts:

[REDACTED]	Live Oak	Br Trim	Routine	25	3	14	6	4/27/20	6	BT	0		[REDACTED]	439
Com:														

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.540732/-122.569131

Worked Reason:

Tree Com: .7S/N/OF EP; FLGD/PTD

Worked Comments:

Psc Com: FLAGGED/PTD

Alerts:

Notes:

**Location Num: 64**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 64**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 2:17 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1418	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540972 / -122.569148		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051286
[REDACTED]			IGO	C-6	-	P-25	3/18/20 2:17 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1418	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540972 / -122.569148		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051286

**Loc Comments:** AX DRWY @ PSTD ADD RIGHT @ FORK X BRDG RIGHT @ FORK TO EP IFO HSE P68 TP 1S/N. PLS NOTIFY CUST AT LEAST 1 DAY IN ADVANCE. NO PHONE STOP BY, OR CALL CELL PHONE

**Location Summary: Units: 2 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Alder - White	TopDirecti	Routine	30	12	14	1	4/29/20	1	TR	0		[REDACTED]	443

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.540827/-122.569048

Worked Reason:

Tree Com: .1S/NE/OF P68 TP; IN BERRIES,GROWTH

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Alder - White	Side	Routine	35	12	12	1	4/29/20	1	TR	0		[REDACTED]	444
------------	---------------	------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541022/-122.568957

Worked Reason:

Tree Com: .2S/NE/OF P68 TP; GROWTH

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 65**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 65

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 4:51 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1450	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540480 / -122.565582		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
[REDACTED] IGO			C-6	-	P-25		3/23/20 4:51 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1450	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540480 / -122.565582		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: P64 4WAY ON DRWY @ PSTD ADD P1 1S/N/OF P64 4WAY. STEEP DRWY! SMALL TA.

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak Top	Routine	33	25	14	1	1	4/16/20	1	R3	0		[REDACTED]	447

Com:

Tline: Owner: Private Clearance: 14  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.540475/-122.565665 Worked Reason:

Tree Com: .4S/N/OF P1; 2XSTM

Worked Comments:

Psc Com: TOP BELOW LINES

Alerts:

Gray Pine	Br Rmv	Routine	28	3	1	4/16/20	1	BR	0		[REDACTED]		451
-----------	--------	---------	----	---	---	---------	---	----	---	--	------------	--	-----

Com:

Tline: Owner: Private Clearance:  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.540650/-122.565517 Worked Reason:

Tree Com: .8S/N/OF P1; UNDR LINE

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 66


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 66**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:31 PM
XStreet			County SHASTA	Loc Rt: 1470	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540092 / -122.566132		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Dog			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
			IGO	C-6	-	P-25	3/24/20 12:31 PM
XStreet			County SHASTA	Loc Rt: 1470	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540092 / -122.566132		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Dog			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P64 4WAY ON DRWY @ PSTD ADD

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Interior Live Oa Side	Routine	35	18	14	1	4/28/20	1	TR	0		██████████		458
Com:														
Tline:	Owner: Private				Clearance: 14									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.540322/-122.566195				Worked Reason:								

Tree Com: .7S/W/OF P64 4WAY; N/SD;

Worked Comments:

Psc Com:

Alerts:

██████████	Interior Live Oa Side	Routine	42	38	14	1	4/28/20	1	BB	0		██████████		462
Com:														
Tline:	Owner: Private				Clearance: 14									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.540792/-122.566790				Worked Reason:								

Tree Com: .9S/W/OF P64 4WAY; S/SD; TRM FOR NXT SPN NORT

Worked Comments:

Psc Com: SNOW BENT; FLOPPY TOPS

Alerts:

Notes:

**Location Num: 67**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 67

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:17 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1480	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540333 / -122.566352		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
[REDACTED] IGO			C-6	-	P-25	3/24/20 12:17 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1480	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540333 / -122.566352		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: P64 4WAY ON DRWY @ PSTD ADD STEEP DRWY! SMALL TA!

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	80	21	14	1	4/28/20	1	BO	0		[REDACTED]		463
Com:														
Tline:	Owner: Private				Clearance: 14									
Wire Type: Raychem	VELB Area: No	Tree Lat/Lon: 40.539910/-122.566190				Worked Reason:								

Tree Com: .9S/S/OF P64 4WAY;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 68

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 68

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:21 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
[REDACTED] IGO			C-6	-	P-25		3/24/20 12:21 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: P2 ON DRWY @ PSTD ADD; STEEP DRIVEWAY , AND VERY SMALL TA; PLEASE DO GOOD CLEANUP

Location Summary: Units: 5		Notification:										
<----- Completed ----->												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak TopDirecti	Routine	30	25	13	1	4/28/20	1	TR	0			[REDACTED]	466
<b>Com:</b>														
Tline:	Owner: Private			Clearance: 13										
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.539525/-122.566288			Worked Reason:									

Tree Com: .4S/S/OF P2 XSTEM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Interior Live Oak TopDirecti	Routine	30	12	13	1	4/28/20	1	TR	0			[REDACTED]	467
<b>Com:</b>														
Tline:	Owner: Private			Clearance: 13										
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.539525/-122.566290			Worked Reason:									

Tree Com: .4S/S/OF P2;

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 68

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
[REDACTED]			IGO	C-6	-	P-25	3/24/20 12:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: P2 ON DRWY @ PSTD ADD; STEEP DRIVEWAY , AND VERY SMALL TA; PLEASE DO GOOD CLEANUP

Location Summary: Units: 5		Notification:												
Completed													>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak TopDirecti	Routine	30	12	13	1	4/28/20	1	TR	0			[REDACTED]	468

Tline: Owner: Private Clearance: 13

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.539525/-122.566290 Worked Reason:

Tree Com: .4S/S/OF P2; Worked Comments:

Psc Com:

Alerts:

X [REDACTED] Ponderosa Pine Rmv 1-B	Routine	26	7	1	4/28/20	1	R1	0		[REDACTED]				469
Tline:	Owner: Private	Clearance:												
Wire Type: None	VELB Area: No	40.539427/-122.566457	Worked Reason:											

Tree Com: .5S/S/OF P2; E/SD Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 68

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:21 PM
XStreet	Group	County SHASTA		Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Dog		Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855		NTW Number 4051291	
[REDACTED]		IGO C-6 -		P-25		3/24/20 12:21 PM	
XStreet	Group	County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Dog		Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855		NTW Number 4051291	

Loc Comments: P2 ON DRWY @ PSTD ADD; STEEP DRIVEWAY , AND VERY SMALL TA; PLEASE DO GOOD CLEANUP

Location Summary: Units: 5		Notification:												
← Completed →														
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Gray Pine	Rmv 2-B	Accelerat	65	18	1	1	4/28/20	1	R2	0	[REDACTED]	[REDACTED]	470
Com:														
Tline:			Owner: Private			Clearance:								
Wire Type: None			Tree Lat/Lon: 40.539373/-122.566482			Worked Reason:								

Tree Com: .7S/S/OF P2; W/SD

Worked Comments:

Psc Com: PLEASE DO GOOD CLEANUP ; TREE IS NEXT TO DRIVEWAY

Alerts:

Notes:

Location Num: 69

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 69

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:43 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1500	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED] IGO			C-6	-	P-25		3/24/20 12:43 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1500	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P66 AP N/OF HSE @ 1ST DRWY N/OF ADD [REDACTED] E/SD/OF RD; LG NO VEHICLE ACCESS

Location Summary: Units: 6		Notification:											
← Completed →													

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	50	12	11	1	4/22/20	1	TR	0			[REDACTED]	472
<b>Com:</b>														
Tline:	Owner: Private	Clearance: 11												
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.540682/-122.567093	Worked Reason:											

Tree Com: .3S/E/OF P66; TTB

Worked Comments:

Psc Com: TREE ON STEEP HILLSIDE

Alerts:

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	50	17	11	1	4/22/20	1	TR	0			[REDACTED]	473
<b>Com:</b>														
Tline:	Owner: Private	Clearance: 11												
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.540623/-122.566940	Worked Reason:											

Tree Com: .4S/E/OF P66; TTB

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 69**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:43 PM
XStreet		Group	County SHASTA	Loc Rt: 1500	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/24/20 12:43 PM
XStreet		Group	County SHASTA	Loc Rt: 1500	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			
Loc Comments: P66 AP N/OF HSE @ 1ST DRWY N/OF ADD [REDACTED] E/SD/OF RD; LG NO VEHICLE ACCESS							

**Location Summary: Units: 6 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	45	20	14	1	5/7/20	1	TR	0		[REDACTED]	474

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.540688/-122.566483

Worked Reason:

Tree Com: .7S/E/OF P66; UNDR LINE

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O	TopDirecti	Routine	45	38	14	1	5/7/20	1	TR	0		[REDACTED]	475
Com:	Tline:	Owner: Private	Clearance: 14											

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.540603/-122.566490

Worked Reason:

Tree Com: .8S/E/OF P66; UNDR LINE

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 69

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:43 PM		
XStreet		Group	County SHASTA	Loc Rt: 1500	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1	Customer Phone #1			
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855					
			IGO	C-6	-	P-25	3/24/20 12:43 PM		
XStreet		Group	County SHASTA	Loc Rt: 1500	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1	Customer Phone #1			
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855					
Loc Comments: P66 AP N/OF HSE @ 1ST DRWY N/OF ADD [REDACTED] E/SD/OF RD; LG NO VEHICLE ACCESS									

Location Summary: Units: 6 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	45	43	16	1	5/7/20	1	TR	0			[REDACTED]	476
Com:														
Tline: Owner: Private Clearance: 16														
Tree Lat/Lon: 40.540672/-122.566448														
Wire Type: None VELB Area: No Worked Reason:														

Tree Com: .8S/E/OF P66; UP HILL XSTEM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Ponderosa Pin Side	Routine	75	21	16	1	5/7/20	1	TR	0			[REDACTED]	477
Com:														
Tline: Owner: Private Clearance: 16														
Tree Lat/Lon: 40.540625/-122.566460														

Tree Com: .8S/E/OF P66; UP HILL FROM LINES

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 70



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 70

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 3:18 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1510	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED]			IGO		C-6	-	P-25
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1510	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

Loc Comments: P66 N/OF HSE @ 1ST DRWY N/OF ADD [REDACTED] E/SD/OF RD

Location Summary: Units: 5		Notification:										
< ----- Completed ----- >												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	50	14	12	1	4/22/20	1	TR	0			[REDACTED]	478
<b>Com:</b>														
Tline:	Owner: Private	Clearance: 12												
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.540841/-122.567436	Worked Reason:											

Tree Com: .4S/W/OF P66; TTB

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Ponderosa Pin Top	Routine	23	5	14	1	4/22/20	1	TR	0			[REDACTED]	479
<b>Com:</b>														
Tline:	Owner: Private	Clearance: 14												
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.540910/-122.567587	Worked Reason:											

Tree Com: .7S/W/OF P66; UNDR LINES

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 70

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 3:18 PM
XStreet		Group	County SHASTA	Loc Rt: 1510	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/24/20 3:18 PM
XStreet		Group	County SHASTA	Loc Rt: 1510	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540550 / -122.567218		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P66 N/OF HSE @ 1ST DRWY N/OF ADD [REDACTED] E/SD/OF RD

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	35	7	14	1	1	4/22/20	1	TR	0		[REDACTED]	480

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.540892/-122.567635

Worked Reason:

Tree Com: .7S/W/OF P66;

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Ponderosa Pin Top	Routine	22	5	14	2	4/22/20	2	TR	0		[REDACTED]	481
------------	-------------------	---------	----	---	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.540892/-122.567635

Worked Reason:

Tree Com: .8S/W/OF P66; UNDR LINES

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts:

Notes:

Location Num: 71

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 71

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 4:09 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1520	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541118 / -122.568957		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/24/20 4:09 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1520	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541118 / -122.568957		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN FLAG ALL TR MS CUSTOMER MUST BE PRESENT FOR TRIMS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Alder - White	Side	Routine	50	13	13	1	4/13/20	1	TR	0		[REDACTED]	494

Com:

Tline: Owner: Private Clearance: 13

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.540820/-122.568777

Worked Reason:

Tree Com: .8S/W/O P67 NXT TO MAPLE W/WHITE FLG

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Bigleaf Maple	TopDirecti	Routine	40	21	15	1	4/13/20	1	TR	0		[REDACTED]	495
------------	---------------	------------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.540860/-122.568858

Worked Reason:

Tree Com: .8S/W/O P67 FLGD/PTD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 72


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 72

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 4:52 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1530	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541595 / -122.568878		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]	[REDACTED]	[REDACTED]	IGO	C-6	-	P-25	3/24/20 4:52 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1530	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541595 / -122.568878		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

**Loc Comments:** P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TRIMS.NO HERBICIDE ! DNP EP 2017; P [REDACTED] MUST BE PRESENT FOR ALL TR MS.

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Locust, Black	TopDirecti	Routine	32	13	12	1	4/13/20	1	TR	0		[REDACTED]	497

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541503/-122.568810

Worked Reason:

Tree Com: IBO EP FLGD

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Locust, Black	Rmv1-B+Trt	Routine	30	8	1	4/13/20	1	R1	0		[REDACTED]	498
--------------	---------------	------------	---------	----	---	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541498/-122.568873

Worked Reason:

Tree Com: @ EP; GROWTH

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 72

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 4:52 PM
XStreet		Group	County SHASTA	Loc Rt: 1530	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541595 / -122.568878		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]	IGO		C-6	-	P-25	3/24/20 4:52 PM	
XStreet		Group	County SHASTA	Loc Rt: 1530	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541595 / -122.568878		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TRIMS.NO HERBICIDE ! DNP EP 2017; P [REDACTED] MUST BE PRESENT FOR ALL TR MS.

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Walnut	TopDirecti	Routine	40	54	14	1	4/13/20	1	TR	0		[REDACTED]	499

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541440/-122.568827

Worked Reason:

Tree Com: .1S/W/OF EP XSTM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 73

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 73

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 9:01 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1540	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED] IGO			C-6	-	P-25	3/25/20 9:01 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1540	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD P69 TP 1S/W/OF EP FLAG ALL TRIMS  
CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 1 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Walnut	TopDirecti	Routine	45	15	15	1	4/13/20	1	TR	0		[REDACTED]	507

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541512/-122.569300

Worked Reason:

Tree Com: .1S/S/OF P69 TP5; SD/TOO 12',

Worked Comments:

Psc Com: FLAGGED

Alerts:

Notes:

Location Num: 74

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 74

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 9:09 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED] IGO			C-6	-	P-25	3/25/20 9:09 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD P69 TP 1S/W/OF EP FLAG ALL TRIMS  
CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	35	44	14	1	1	4/20/20	1	TR	0		[REDACTED]	511
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.541800/-122.569806														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/W/OF P69 TP XSTM FLGD/PTD

Worked Comments:

Psc Com: TRIM ABOVE LINES, SNOW BENT

Alerts:

[REDACTED]	Canyon Live O Side	Routine	35	25	14	1	1	4/20/20	1	TR	0		[REDACTED]	512
Com:														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.541777/-122.569783														

Tree Com: .3S/W/OF P69 TP 2XSTM FLGD/PTD

Worked Comments:

Psc Com: TRIM ABOVE LINES, SNOW BENT

Alerts:



Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 74

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 9:09 AM
XStreet		Group	County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/25/20 9:09 AM
XStreet		Group	County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD P69 TP 1S/W/OF EP FLAG ALL TRIMS  
CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	30	8	12	1	4/20/20	1	TR	0		[REDACTED]	518

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541932/-122.569865

Worked Reason:

Tree Com: .6S/W/OF P69 TP; FLGD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O	TopDirecti	Routine	30	12	14	1	4/20/20	1	TR	0		[REDACTED]	522
Com:														

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542003/-122.570062

Worked Reason:

Tree Com: .7S/W/OF P69 TP;

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 74**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 9:09 AM
XStreet		Group	County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO	C-6	-	P-25	3/25/20 9:09 AM
XStreet		Group	County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

**Loc Comments:** P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD P69 TP 1S/W/OF EP FLAG ALL TRIMS  
CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

**Location Summary: Units: 5 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	30	17	14	1	4/20/20	1	TR	0		[REDACTED]	523

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542072/-122.570060

Worked Reason:

Tree Com: .7S/W/OF P69 TP. 2XSTEM; FLAGGED

Worked Comments:

Psc Com: FLAGGED

Alerts:

Notes:

**Location Num: 75**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 75

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 10:02 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO	C-6	-	P-25	3/25/20 10:02 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

**Loc Comments:** P2 S/OF HSE ON 1ST DRWY ON RIGHT GATE CODE [REDACTED] FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 7 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	60	50	14	1	[REDACTED]	4/20/20	1	BA	0		[REDACTED]	533
<b>Com:</b>														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.542388/-122.570398														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/W/OF P2; SD 12' ALSO

Worked Comments:

Psc Com: REMOVE SINGLE SNOW BENT LIMB ABOVE LINE

Alerts:

[REDACTED]	Ponderosa Pin Side	Routine	45	12	10	3	[REDACTED]	4/20/20	3	TR	0		[REDACTED]	539
<b>Com:</b>														
Tline: Owner: Private Clearance: 10														
Tree Lat/Lon: 40.542645/-122.570365														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .5S/W/OF P2; SWAY

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 75

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 10:02 AM
XStreet		Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO	C-6	-	P-25	3/25/20 10:02 AM
XStreet		Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

**Loc Comments:** P2 S/OF HSE ON 1ST DRWY ON RIGHT GATE CODE [REDACTED] FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 7 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Overhang	Routine	47	21	15	1	[REDACTED]	4/20/20	1	TR	0	[REDACTED]	[REDACTED]	540

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542703/-122.570423

Worked Reason:

Tree Com: .5S/W/OF P2

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Slope	Routine	50	18	14	1	[REDACTED]	4/20/20	1	BO	0	[REDACTED]	[REDACTED]	542
------------	---------------------	---------	----	----	----	---	------------	---------	---	----	---	------------	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.543163/-122.570478

Worked Reason:

Tree Com: .8S/W/OF P2;

Worked Comments:

Psc Com: LIFT ACCESS, BUT MAYBE CHECK FIRST

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 75

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 10:02 AM
XStreet		Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO	C-6	-	P-25	3/25/20 10:02 AM
XStreet		Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

**Loc Comments:** P2 S/OF HSE ON 1ST DRWY ON RIGHT GATE CODE [REDACTED] FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 7 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	42	28	14	1	[REDACTED]	4/20/20	1	TR	0	[REDACTED]	[REDACTED]	547

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.543080/-122.570630

Worked Reason:

Tree Com: .9S/W/OF P2;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 76


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 76**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 12:40 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1570	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.543108 / -122.570247		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED]			IGO	C-6	-	P-25	3/25/20 12:40 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1570	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.543108 / -122.570247		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

**Loc Comments:** P3 ON 1ST DRWY ON RIGHT GATE CODE [REDACTED] FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TRIMS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS

Location Summary:	Units: 2	Notification:
-------------------	----------	---------------

← Completed →

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Slope	Routine	50	30	14	1	[REDACTED]	4/20/20	1	TR	0		[REDACTED]	551
<b>Com:</b>														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.543059/-122.570369														
Wire Type: None VELB Area: No Worked Reason:														

Tree Com: .3S/W/OF P3 FLGD, @ GATE, XSTEM

Worked Comments:

Psc Com: TREE TAGGED HN IMMEDIATE 3-25-20; REMOVE FLOPPY TOPS

Alerts:

[REDACTED]	Canyon Live O Top	Routine	50	38	15	1	[REDACTED]	4/20/20	1	BA	0		[REDACTED]	552
<b>Com:</b>														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: 40.543197/-122.570492														

Tree Com: .3S/W/OF P3 FLGD, @ GATE, XSTEM

Worked Comments:

Psc Com: REMOVE FLOPPY TOP

Alerts:

Notes:

**Location Num: 77**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 77

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 8:59 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1580	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.545285 / -122.570838		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number
[REDACTED] IGO			C-6	-	P-25	3/30/20 8:59 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1580	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.545285 / -122.570838		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number

**Loc Comments:** P2 1ST POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. LOW LINES

Location Summary: Units: 3	Notification:	<----- Completed ----->									
----------------------------	---------------	-------------------------	--	--	--	--	--	--	--	--	--

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Side	Routine	35	18	14	1	5/11/20	1	TR	0		[REDACTED]	556

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.545183/-122.571035

Worked Reason:

Tree Com: .3S/W/OF P2 2XSTM; WEST SD; PTD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Live Oak	Side	Routine	35	22	12	1	5/11/20	1	TR	0		[REDACTED]	560
Com:	Tline:	Owner: Private	Clearance: 12											

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544962/-122.571208

Worked Reason:

Tree Com: .6S/S/OF P2; 3 XSTEM, W/SD

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 77**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 8:59 AM
XStreet		Group	County SHASTA	Loc Rt: 1580	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.545285 / -122.570838		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			
[REDACTED]			IGO	C-6	-	P-25	3/30/20 8:59 AM
XStreet		Group	County SHASTA	Loc Rt: 1580	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.545285 / -122.570838		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			

**Loc Comments:** P2 1ST POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. LOW LINES**Location Summary: Units: 3 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Live Oak	TopDirecti	Routine	30	6	14	1	5/11/20	1	TR	0		[REDACTED]	561

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.545243/-122.570905

Worked Reason:

Tree Com: .7S/W/O P2

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 78**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 78

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:19 AM
XStreet			Group County SHASTA	Loc Rt: 1610	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.545592 / -122.570208		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number
			IGO	C-6	-	P-25	3/30/20 9:19 AM
XStreet			Group County SHASTA	Loc Rt: 1610	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.545592 / -122.570208		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number

**Loc Comments:** P3 TP 2ND POLE ON ROAD. S/O OF PSTD ADD. GATE CODE █████ INF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Black Oak	Side	Routine	30	14	12	1	5/11/20	1	TR	0		██████████	567

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.546075/-122.569822 Worked Reason:

Tree Com: .3S/N/OF P3 TP;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 79

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 79

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:23 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
[REDACTED] IGO			C-6	-	P-25	3/30/20 9:23 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

**Loc Comments:** P4 3RD POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Top	Routine	25	8	14	1	[REDACTED]	4/15/20	1	TR	0	[REDACTED]	[REDACTED]	568

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546125/-122.569750

Worked Reason:

Tree Com: .1S/N/OF P4; XSTEM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Overhang	Routine	36	24	16	1	[REDACTED]	4/15/20	1	TR	0	[REDACTED]	[REDACTED]	569
Com:	Tline: Owner: Private Clearance: 16													

Tline:

Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546112/-122.569835

Worked Reason:

Tree Com: .2S/N/OF P4; XSTEM

Worked Comments:

Psc Com: REMOVE FLOPPY TOPS; SNOW BENT

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 79**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:23 AM
XStreet		Group	County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
[REDACTED]			IGO	C-6	-	P-25	3/30/20 9:23 AM
XStreet		Group	County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

**Loc Comments:** P4 3RD POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED**Location Summary: Units: 3 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	35	12	14	1	4/15/20	2	TR	0		[REDACTED]		574

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546307/-122.569743

Worked Reason:

Tree Com: .6S/N/OF P4

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 80**

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 80**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:44 AM
XStreet	Group	County SHASTA	Loc Rt: 1630	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546602 / -122.569677		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			
[REDACTED]			IGO	C-6	-	P-25	3/30/20 9:44 AM
XStreet	Group	County SHASTA	Loc Rt: 1630	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546602 / -122.569677		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			

**Loc Comments:** P5 4TH POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

**Location Summary: Units: 2 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	40	14	16	2	4/15/20	2	TR	0		[REDACTED]		585
<b>Com:</b>														
Tline:		Owner: Private		Clearance: 16										
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.546797/-122.569635		Worked Reason:										

Tree Com: .7S/N/OF P5; ABV LINES

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts:

Notes:

**Location Num: 81**


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 81**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 2:40 PM
XStreet		Group	County SHASTA	Loc Rt: 1640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.512023 / -122.573268		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number
[REDACTED]			IGO	C-6	-	P-25	3/25/20 2:40 PM
XStreet		Group	County SHASTA	Loc Rt: 1640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.512023 / -122.573268		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number

**Loc Comments:** EP E/OF HSE END/OF 1ST DRWY WITH GREEN GATE ON LEFT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS [REDACTED]

**Location Summary: Units: 6 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Side	Routine	50	16	13	1	5/11/20	1	TR	0		[REDACTED]	587

**Com:**

Tline: Owner: Private Clearance: 13

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547927/-122.571138

Worked Reason:

Tree Com: IBO EP

Worked Comments:

Psc Com: SMALL TA. SQUIRT BOOM

Alerts:

[REDACTED]	Redwood, Coa	Side	Routine	47	12	11	1	5/11/20	1	TR	0		[REDACTED]	589
[REDACTED]														

Tline: Owner: Private Clearance: 11

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547996/-122.571077

Worked Reason:

Tree Com: .2S/S/OF EP; DNP/FLGD

Worked Comments:

Psc Com: FLAGGED; TREE IN BACKYARD ; PROBABLY LIFT ACCESS

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 81**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 2:40 PM
XStreet		Group	County SHASTA	Loc Rt: 1640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.512023 / -122.573268		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number [REDACTED]
[REDACTED]			IGO	C-6	-	P-25	3/25/20 2:40 PM
XStreet		Group	County SHASTA	Loc Rt: 1640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.512023 / -122.573268		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number [REDACTED]

**Loc Comments:** EP E/OF HSE END/OF 1ST DRWY WITH GREEN GATE ON LEFT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS [REDACTED]

**Location Summary: Units: 6 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Redwood, Coa Side	Routine	47	12	11	1	5/11/20	1	TR	0			[REDACTED]	590

Com:

Tline: Owner: Private Clearance: 11

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547865/-122.571135

Worked Reason:

Tree Com: .2S/S/OF EP; DNP/FLGD

Worked Comments:

Psc Com: FLAGGED; IN PORCH/DECK

Alerts:

[REDACTED]	Maple	TopDirecti	Routine	47	12	11	1	5/11/20	1	TR	0		[REDACTED]	591
Com:														

Tline: Owner: Private Clearance: 11

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547678/-122.571035

Worked Reason:

Tree Com: .2S/S/OF EP; DNP/FLGD; IN DECK XSTEM

Worked Comments:

Psc Com: FLAGGED; IN PORCH/DECK

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 81**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 2:40 PM
XStreet		Group	County SHASTA	Loc Rt: 1640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.512023 / -122.573268		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number [REDACTED]
[REDACTED]			IGO	C-6	-	P-25	3/25/20 2:40 PM
XStreet		Group	County SHASTA	Loc Rt: 1640	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.512023 / -122.573268		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number [REDACTED]

**Loc Comments:** EP E/OF HSE END/OF 1ST DRWY WITH GREEN GATE ON LEFT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS [REDACTED]

**Location Summary: Units: 6 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	49	28	14	1	1	5/11/20	1	TR	0		[REDACTED]	592

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547781/-122.570880

Worked Reason:

Tree Com: .3S/S/OF EP; PAINTED

Worked Comments:

Psc Com: SIDE, AT AND ABOVE LINE

Alerts:

[REDACTED]	Canyon Live O Slope	Routine	35	25	12	1	5/11/20	1	TR	0		[REDACTED]	593
------------	---------------------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547555/-122.570935

Worked Reason:

Tree Com: .6S/S/OF EP; 2 XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 82**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 82

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 3:54 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1660	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546903 / -122.570672		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1660	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546903 / -122.570672		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

**Loc Comments:** P1 ON 1ST DRWY WITH GREEN GATE ON LEFT P2 1S/S/OF P1 GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Top	Routine	25	10	14	1	[REDACTED]	5/7/20	1	BB	0	[REDACTED]	[REDACTED]	598
<b>Com:</b>														
Tline: Owner: Private Clearance: 14														
Tree Lat/Lon: 40.546617/-122.570640 Worked Reason:														

Tree Com: .4S/S/OF P2; 2XSTEM

Worked Comments:

Psc Com: REMOVE SNOW BENT LIMB DOWN TO LINE HEIGHT

Alerts:

[REDACTED]	Canyon Live O Overhang	Routine	50	20	14	1	[REDACTED]	5/7/20	1	BO	0	[REDACTED]	[REDACTED]	601
<b>Com:</b>														
Tline: Owner: Private Clearance: 14														
Wire Type: None VELB Area: No 40.546390/-122.570615 Worked Reason:														

Tree Com: .8S/S/OF P2; SD/TOO 12'

Worked Comments:

Psc Com: REMOVE FLOPPY TOPS TO BELOW LINES . SNOW BENT

Alerts:

Notes:

Location Num: 83


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 83**

Address [REDACTED]			City IGO	Quad Map -	Thomas Guide P-25	Inspection Date / Time 3/25/20 4:10 PM
XStreet	Group	County SHASTA	Loc Rt: 1670	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546187 / -122.570425		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223		NTW Number
[REDACTED]			IGO	-	P-25	3/25/20 4:10 PM
XStreet	Group	County SHASTA	Loc Rt: 1670	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546187 / -122.570425		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223		NTW Number

**Loc Comments:** P1 ON 1ST DRWY WITH GREEN GATE ON LEFT P3 2S/S/OF P1 GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS

**Location Summary: Units: 1 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Side	Routine	64	24	16	1	5/7/20	1	TR	0		[REDACTED]	602
<b>Com:</b>														
Tline:	Owner: Private				Clearance: 16									
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.546130/-122.570425				Worked Reason:								

Tree Com: .1S/S/OF/P3; WEST SD; TTB

Worked Comments:

Psc Com: REMOVE CLOSEST LINE SIDE LEAD ABOVE LINES SNOW BENT

Alerts: First Patrol

Notes:

**Location Num: 84**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 84

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 4:20 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1680	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547463 / -122.569382		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Riparian Area Riparian			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number
[REDACTED]			IGO		C-6	-	P-25
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1680	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547463 / -122.569382		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Riparian Area Riparian			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number

Loc Comments: P6 TP 5TH POLE ON ROAD P1 LB 1S/NE/OF P6 TP GATE CODE [REDACTED]

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	30	13	14	1	5/7/20	1	TR	0		[REDACTED]	604

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon: 40.546633/-122.569592

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .5S/S/OF P1 LB.,XSTEM

Worked Comments:

Psc Com: WIND SWAY

Alerts:

[REDACTED]	Canyon Live O	Side	Routine	30	24	13	1	5/7/20	1	TR	0		[REDACTED]	605
------------	---------------	------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 13

Tree Lat/Lon: 40.546645/-122.569530

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .6S/S/OF P1 LB; 2XSTEM; LINE SD LEAD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 85

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 85**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:17 PM
XStreet		Group	County SHASTA	Loc Rt: 1690	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON				Loc Lat/Lon 40.547415 / -122.569410		Customer Name #1	Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number
			IGO	C-6	-	P-25	3/26/20 3:17 PM
XStreet		Group	County SHASTA	Loc Rt: 1690	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON				Loc Lat/Lon 40.547415 / -122.569410		Customer Name #1	Customer Phone #1
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number

**Loc Comments:** P6 TP 5TH POLE ON ROAD GATE CODE [REDACTED] TREES ALONG ROAD NW OF P6 TP. ON THE WAY TO P7. P1 LB IS UP HILL FROM P6 TP.

Location Summary:		Units: 1	Notification:	Completed										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	50	13	12	1	5/5/20	1	TR	0		[REDACTED]		609

Com:

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.547618/-122.569672Clearance: 12  
Worked Reason:

Tree Com: .4S/N/OF P6 TP

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 86**


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 86**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:21 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:21 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051280

**Loc Comments:** P7 6TH POLE ON ROAD. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED]

Location Summary: Units: 7		Notification:										
		<----- Completed ----->										

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	55	14	12	1	1	5/7/20	1	TR	0		[REDACTED]	614

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548000/-122.570015

Worked Reason:

Tree Com: .1S/N/OF P7; E/SD/RD TTB

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Bigleaf Maple Side	Routine	30	4	12	1	1	5/7/20	1	TR	0		[REDACTED]	617
------------	--------------------	---------	----	---	----	---	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548203/-122.569907

Worked Reason:

Tree Com: .4S/N/OF P7.PTD

Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 86

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051280

Loc Comments: P7 6TH POLE ON ROAD. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED]

Location Summary: Units: 7			Notification:											
			Completed											
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	50	17	14	1	5/7/20	1	TR	0		[REDACTED]	618	
Com:														
Tline: Owner: Private			Clearance: 14											
Tree Lat/Lon: 40.548320/-122.569965			Worked Reason:											

Tree Com: .5S/N/OF P7 W/OF RD ; NXT TO CREEK

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Side	Routine	45	12	14	1	5/7/20	1	TR	0		[REDACTED]	619
Com:													
Tline: Owner: Private			Clearance: 14										
Tree Lat/Lon: 40.548283/-122.569937			Worked Reason:										

Tree Com: .5S/N/OF P7 W/SD/OF RD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 86

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051280

Loc Comments: P7 6TH POLE ON ROAD. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED]

Location Summary: Units: 7 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Bigleaf Maple	Slope	Routine	30	12	12	1	5/5/20	1	TR	0		[REDACTED]	620

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548314/-122.570077

Worked Reason:

Tree Com: .6S/N/OF P7. 2XSTM; PTD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Alder - White	Side	Routine	55	18	12	1	5/5/20	1	TR	0		[REDACTED]	622
------------	---------------	------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548477/-122.570018

Worked Reason:

Tree Com: .7S/N/OF P7

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 86**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051280

**Loc Comments:** P7 6TH POLE ON ROAD. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED]**Location Summary: Units: 7 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	65	14	10	1	1	5/7/20	1	TR	0		[REDACTED]	624

Com:

Tline: Owner: Private Clearance: 10

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548622/-122.569957

Worked Reason:

Tree Com: .8S/N/OF P7;

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 87**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 87

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:46 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1705	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548288 / -122.569898		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 00000-0000	SSD #: 7223	NTW Number 4051285		
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1705	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548288 / -122.569898		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223	NTW Number 4051285		

Loc Comments: P7 6TH POLE ON ROAD.. GATE CODE [REDACTED] EAST SD LINES

Location Summary:		Units: 2	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #

X [REDACTED]	Ponderosa Pin Rmv 1-B	Routine	24	4	1	5/5/20	1	R1	0			[REDACTED]	628
--------------	-----------------------	---------	----	---	---	--------	---	----	---	--	--	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.548047/-122.569985

Worked Reason:

Tree Com: .3S/N/OF/P7; EAST SD/ROADSIDE

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Ponderosa Pin Rmv 1-B	Routine	24	4	1	5/5/20	1	R1	0			[REDACTED]	630
--------------	-----------------------	---------	----	---	---	--------	---	----	---	--	--	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.548438/-122.569898

Worked Reason:

Tree Com: .6S/N/OF/P7; EAST SD/ROADSIDE

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 88

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 88

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/16/20 12:15 PM
XStreet			Group	County SHASTA	Loc Rt: 1710	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548410 / -122.573510		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Dog Locked Gate Notify First			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/16/20 12:15 PM
XStreet			Group	County SHASTA	Loc Rt: 1710	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548410 / -122.573510		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Dog Locked Gate Notify First			Struct1		Struct2	Customer Name #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051280

**Loc Comments:** EP N/OF HSE END/OF 2ND DRWY ON LEFT. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED] CALL ONE DAY IN ADVANCE SO CUST CAN PUT DOG UP. 11-2 BEST-LATE SLEEPER.

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	40	25	14	1	1	5/11/20	1	TR	0		[REDACTED]	643

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548142/-122.574067

Worked Reason:

Tree Com: .9S/W/OF EP; XSTEM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Side	Routine	26	18	12	1	1	5/11/20	1	TR	0		[REDACTED]	644
------------	--------------------	---------	----	----	----	---	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548158/-122.574115

Worked Reason:

Tree Com: .9S/W/OF EP; XSTEM/ N/SD; FLGD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 89

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 89

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 10:09 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1730	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548403 / -122.569645		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051284
[REDACTED]			IGO	C-6	-	P-25	3/18/20 10:09 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1730	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548403 / -122.569645		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051284

**Loc Comments:** P8 LB @ 2ND DRWY ON LEFT P9 TP 1S/E/OF P8 LB GATE CODE [REDACTED] WILL SET APPOINTMENT TIME AND NOTIFY TREE CREW. MUST DO GOOD CLEANUP .

Location Summary: Units: 4 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Slope	Routine	30	26	12	1	1	4/7/20	1	TR	0		[REDACTED]	651

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548978/-122.569515

Worked Reason:

Tree Com: .7S/N/OF P9 TP 2XSTEM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Slope	Routine	30	21	12	1	1	4/7/20	1	TR	0		[REDACTED]	652
Com:	Tline:	Owner: Private	Clearance: 12											

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548863/-122.569412

Worked Reason:

Tree Com: .8S/N/OF P9; 2XSTEM

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 89

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 10:09 AM
XStreet		Group	County SHASTA	Loc Rt: 1730	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548403 / -122.569645		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			
[REDACTED]			IGO	C-6	-	P-25	3/18/20 10:09 AM
XStreet		Group	County SHASTA	Loc Rt: 1730	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548403 / -122.569645		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			
Loc Comments: P8 LB @ 2ND DRWY ON LEFT P9 TP 1S/E/OF P8 LB GATE CODE [REDACTED] WILL SET APPOINTMENT TIME AND NOTIFY TREE CREW. MUST DO GOOD CLEANUP .							

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	33	13	12	1	4/7/20	1	TR	0		[REDACTED]	653

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548968/-122.569152

Worked Reason:

Tree Com: .8S/N/OF P9 TP; UNDERLINE

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O	TopDirecti	Routine	30	16	12	1	4/7/20	1	TR	0		[REDACTED]	654
Com:	Tline:	Owner: Private	Clearance: 12											

Tline:

Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.549003/-122.569202

Worked Reason:

Tree Com: .9S/N/OF P9 TP

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 90


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 90**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 9:19 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051284
[REDACTED] IGO			C-6	-	P-25	3/18/20 9:19 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051284

**Loc Comments:** P12 LB S/OF PSTD ADD @ DRWY ENT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT!!! IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. [REDACTED] WILL SET APPOINTMENT FOR TREE CREW

Location Summary: Units: 4	Notification:
----------------------------	---------------

← Completed →

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine Side	Routine	60	18	9	1	1	4/7/20	1	XX	0		[REDACTED]	655

Com:

Tline: Owner: Private Clearance: 9

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.549928/-122.568493

Worked Reason:

Tree Com: .2S/W/OF P12 LB; PRUNE SD 12' TOO

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O TopDirecti	Routine	40	29	12	1	4/7/20	1	TR	0		[REDACTED]	656
------------	--------------------------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.549868/-122.568638

Worked Reason:

Tree Com: .2S/W/OF P12 LB; S/SD DOWN HILL

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 90

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 9:19 AM
XStreet		Group	County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			
[REDACTED]			IGO	C-6	-	P-25	3/18/20 9:19 AM
XStreet		Group	County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			

**Loc Comments:** P12 LB S/OF PSTD ADD @ DRWY ENT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT!!! IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. [REDACTED] WILL SET APPOINTMENT FOR TREE CREW

Location Summary: Units: 4 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine Side	Routine	52	11	9	1	[REDACTED]	4/7/20	1	TR	0	[REDACTED]	[REDACTED]	657

Com:

Tline: Owner: Private Clearance: 9

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.549840/-122.568830

Worked Reason:

Tree Com: .2S/W/OF P12 LB;

Worked Comments:

Psc Com: NXT TO DRWY

Alerts:

[REDACTED]	Knobcone Pine Side	Routine	40	9	9	1	[REDACTED]	4/7/20	1	TR	0	[REDACTED]	[REDACTED]	659
------------	--------------------	---------	----	---	---	---	------------	--------	---	----	---	------------	------------	-----

Com:

Tline: Owner: Private Clearance: 9

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.550017/-122.568897

Worked Reason:

Tree Com: .5S/W/OF P12 LB; TTB

Worked Comments:

Psc Com: S/SD/LNS

Alerts:

Notes:

Location Num: 91

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 91

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 9:47 AM
XStreet	Group	County SHASTA	Loc Rt: 1770	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550603 / -122.569370		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First Past Refusal			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			
[REDACTED]			IGO	C-6	-	P-25	3/18/20 9:47 AM
XStreet	Group	County SHASTA	Loc Rt: 1770	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550603 / -122.569370		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First Past Refusal			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			

**Loc Comments:** P13 ON DRWY @ PSTD ADD @ DRWY ENT GATE CODB [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT!!! IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. CUST WILL LEAD YOU TO THE LN'S

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	TopDirecti	Routine	35	16	12	1	4/7/20	1	TR	0		[REDACTED]	672

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.550548/-122.569277

Worked Reason:

Tree Com: .8S/N/OF P13

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 92


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 92**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 10:52 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1800	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 00000-0000	SSD #: 7223			NTW Number 4051294
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1800	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

**Loc Comments:** RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P3 LB ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 7		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Br Rmv	Routine	30	3	1		1	5/12/20	1	BR	0		[REDACTED]	675

Com:

Tline: Owner: Private  
 Tree Lat/Lon:  
 Wire Type: None VELB Area: Yes 40.547278/-122.568148 Worked Reason:

Tree Com: .2S/W/OF P3 LB; DEAD, N/SD

Worked Comments:

Psc Com: DOT, NO X

Alerts: First Patrol

[REDACTED]	Ponderosa Pin Br Rmv	Routine	29	3	3	5/12/20	3	BR	0		[REDACTED]	[REDACTED]	677
------------	----------------------	---------	----	---	---	---------	---	----	---	--	------------	------------	-----

Tline: Owner: Private  
 Tree Lat/Lon:  
 Wire Type: None VELB Area: Yes 40.547328/-122.568298 Worked Reason:

Tree Com: .3S/W/OF P3 LB; 3 STEMS

Worked Comments:

Psc Com: DOT, NO X

Alerts: First Patrol


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 92**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 10:52 AM
XStreet		Group	County SHASTA	Loc Rt: 1800	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			
[REDACTED]			IGO	C-6	-	P-25	3/30/20 10:52 AM
XStreet		Group	County SHASTA	Loc Rt: 1800	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			

**Loc Comments:** RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P3 LB ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 7		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Slope	Routine	50	18	14	1	5/12/20	1	TR	0		[REDACTED]	679

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547325/-122.568233

Worked Reason:

Tree Com: .3S/W/OF P3 LB; , N/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

Com:	Canyon Live O Side	Routine	33	20	14	1	5/12/20	1	TR	0		[REDACTED]	681
Tline:	Owner: Private	Clearance: 14											

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547257/-122.568340

Worked Reason:

Tree Com: .5S/W/OF P3 LB; N/SD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 92

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 10:52 AM
XStreet		Group	County SHASTA	Loc Rt: 1800	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051294
[REDACTED]			IGO	C-6	-	P-25	3/30/20 10:52 AM
XStreet		Group	County SHASTA	Loc Rt: 1800	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

Loc Comments: RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P3 LB ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 7 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Side	Routine	40	16	14	1	5/12/20	1	TR	0		[REDACTED]	683

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547353/-122.568365

Worked Reason:

Tree Com: .6S/W/OFP3 LB; TRM ABV LNS

Worked Comments:

Psc Com: REMOVE FLOPPY TOPS

Alerts:

Notes:

Location Num: 93


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 93**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 11:17 AM		
XStreet			Group County SHASTA	Loc Rt: 1810	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/ON HORSE CANYON WAY			Loc Lat/Lon 40.547147 / -122.567933		Customer Name #1	Customer Phone #1			
Alerts Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223					
			IGO	C-6	-	P-25	3/30/20 11:17 AM		
XStreet			Group County SHASTA	Loc Rt: 1810	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/ON HORSE CANYON WAY			Loc Lat/Lon 40.547147 / -122.567933		Customer Name #1	Customer Phone #1			
Alerts Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223					
Loc Comments: RIGHT @ FORK @ RED BARN END/O/RD PAST 1ST HSE TO P3 LB ON DRWY GATE CODE [REDACTED]									

**Location Summary: Units: 2 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Br Rmv+Trt	Routine	20	3	1		1	5/12/20	1	BX	0		[REDACTED]	688
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.547320/-122.568023 Worked Reason:														
Wire Type: None VELB Area: Yes														

Tree Com: .2S/N/OF P3 LB

Worked Comments:

Psc Com: LIFT ACCESS MIGHT BE POSSIBLE, BUT VERY SMALL TURNAROUND . DOT, NO X

Alerts: First Patrol

[REDACTED]	Ponderosa Pin Br Rmv	Routine	28	3	1	5/12/20	1	BR	0		[REDACTED]		[REDACTED]	689
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.547343/-122.567957 Worked Reason:														

Tree Com: .2S/N/OF P3 LB

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

**Location Num: 94**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 94**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 11:28 AM
XStreet			County SHASTA	Loc Rt: 1820	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547815 / -122.567830		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051294
			IGO	C-6	-	P-25	3/30/20 11:28 AM
XStreet			County SHASTA	Loc Rt: 1820	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547815 / -122.567830		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

**Loc Comments:** RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P4 ON DRWY GATE CODE ██████████

Location Summary:		Units: 3	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Black Oak	Side	Routine	50	18	14	1	5/12/20	1	TR	0		██████████	697

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547750/-122.567938

Worked Reason:

Tree Com: .2S/N/OF P4;

Worked Comments:

Psc Com:

Alerts:

██████████	Ponderosa Pine	Side	Routine	100	27	16	1	5/12/20	1	TR	0		██████████	699
Com:														

Tline:

Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547915/-122.567897

Worked Reason:

Tree Com: .3S/N/OF P4;

Worked Comments:

Psc Com: ABV LINES

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 94**

Address			City	Quad Map	Thomas Guide	Area	Inspection Date / Time
			IGO	C-6	-	P-25	3/30/20 11:28 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	1820	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			40.547815 / -122.567830				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0000-0000	7223			4051294
			IGO	C-6	-	P-25	3/30/20 11:28 AM
XStreet	Group	County	Loc Rt:	U-Bld	Insp		Inspection Company
			SHASTA	1820	No		CN Utility
Location Directions			Loc Lat/Lon		Customer Name #1	Customer Phone #1	
W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			40.547815 / -122.567830				
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	
Locked Gate							
SRA	Tag Number	Tag Type	Packet Project #	SSD #:			NTW Number
Yes			0018-1363	7223			4051294

**Loc Comments:** RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P4 ON DRWY GATE CODE [REDACTED]**Location Summary: Units: 3 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Ponderosa Pin	Rmv 1-B	Routine	35	5		1	5/12/20	1	R1	0		[REDACTED]	705

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548335/-122.567803

Worked Reason:

Tree Com: AT P5; PAINTED

Worked Comments:

Psc Com: PLEASE DO GOOD CLEANUP

Alerts:

Notes:

**Location Num: 95**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 95**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 4:32 PM
XStreet			County SHASTA	Loc Rt: 1850	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1		Customer Phone #1
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051293
			IGO	C-6	-	P-25	3/30/20 4:32 PM
XStreet			County SHASTA	Loc Rt: 1850	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1		Customer Phone #1
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051293

**Loc Comments:** P4 1ST POLE RDSD N/OF HORSE CANYON WAY

Location Summary: Units: 1			Notification:											
			Completed											
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
■	Canyon Live O Side	Routine	45	15	16	1	5/7/20	1	TR	0			713	
Com:														
Tline:		Owner: Private		Clearance: 16										
Wire Type: None		VELB Area: Yes		Tree Lat/Lon: 40.543794/-122.570634		Worked Reason:								

Tree Com: .5S/N/OF P4

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 96**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 96

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 4:45 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1870	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544772 / -122.571287		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7241			NTW Number 3/30/20 4:45 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1870	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544772 / -122.571287		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7241			NTW Number [REDACTED]

**Loc Comments:** P6 TP SSD#7223 RDSD N/OF HORSE CANYON WAY. NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	35	12	12	1	5/12/20	1	TR	0		[REDACTED]	718

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.543335/-122.570693

Worked Reason:

Tree Com: AT P6 TP SSD#7223 ; W/SID

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O	Side	Routine	45	17	14	2	5/12/20	2	TR	0		[REDACTED]	723
------------	---------------	------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.543357/-122.570777

Worked Reason:

Tree Com: .7S/W/O P6 TP SSD#7223; ABV RD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 97

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 97

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 10:47 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7241			NTW Number [REDACTED]
[REDACTED]			IGO	C-6	-	P-25	3/31/20 10:47 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7241			NTW Number [REDACTED]

**Loc Comments:** P7 RDSD N/OF HORSE CANYON WAY. ADD IS PSTD ON GATE. IC, NF: PI & TT MUST CONTACT BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT : [REDACTED]

Location Summary: Units: 7 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	25	15	14	1	4/16/20	1	TR	0		[REDACTED]	724

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.543297/-122.570813

Worked Reason:

Tree Com: @ P7 FLGD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O	Side	Routine	45	25	16	1	4/16/20	1	TR	0		[REDACTED]	730
------------	---------------	------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544817/-122.572722

Worked Reason:

Tree Com: .5S/W/OF P7; HILL SIDE; 2XSTEM

Worked Comments:

Psc Com: GET RID OF FLOPPY TOPS . SNOW BENT

Alerts:


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 97

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 10:47 AM
XStreet		Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2 ██████████
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 7241			NTW Number
██████████			IGO	C-6	-	P-25	3/31/20 10:47 AM
XStreet		Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2 ██████████
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7241			NTW Number

**Loc Comments:** P7 RDSD N/OF HORSE CANYON WAY. ADD IS PSTD ON GATE. IC, NF: PI & TT MUST CONTACT BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT : ██████████

Location Summary: Units: 7 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Canyon Live O Side	Routine	30	18	16	1	4/16/20	1	TR	0		██████████		731

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544782/-122.572533 Worked Reason:

Tree Com: .4S/W/OF P7; XSTEM

Worked Comments:

Psc Com:

Alerts:

██████████	Canyon Live O Side	Routine	45	40	16	1	4/16/20	1	TR	0		██████████		732
------------	--------------------	---------	----	----	----	---	---------	---	----	---	--	------------	--	-----

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544497/-122.572843 Worked Reason:

Tree Com: .6S/W/OF P7; XSTEM

Worked Comments:

Psc Com: GET RID OF FLOPPY TOPS

Alerts:


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 97**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 10:47 AM
XStreet		Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7241			
[REDACTED]			IGO	C-6	-	P-25	3/31/20 10:47 AM
XStreet		Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7241			

**Loc Comments:** P7 RDSD N/OF HORSE CANYON WAY. ADD IS PSTD ON GATE. IC, NF: PI & TT MUST CONTACT BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT : [REDACTED]

Location Summary: Units: 7	Notification:
----------------------------	---------------

← Completed →

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	45	28	16	1	[REDACTED]	4/16/20	1	TR	0	[REDACTED]	[REDACTED]	734

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544512/-122.573027 Worked Reason:

Tree Com: .7S/W/OF P7; HILL SIDE

Worked Comments:

Psc Com: REMOVE FLOPPY TOPS

Alerts:

[REDACTED]	Ponderosa Pin Top	Routine	30	5	16	1	[REDACTED]	4/16/20	1	TR	0	[REDACTED]	[REDACTED]	737
------------	-------------------	---------	----	---	----	---	------------	---------	---	----	---	------------	------------	-----

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544385/-122.573140 Worked Reason:

Tree Com: .8S/W/OF P7; UNDR LINE

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 97**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 10:47 AM
XStreet	Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7241			NTW Number
[REDACTED]			IGO	C-6	-	P-25	3/31/20 10:47 AM
XStreet	Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7241			NTW Number

**Loc Comments:** P7 RDSD N/OF HORSE CANYON WAY. ADD IS PSTD ON GATE. IC, NF: PI & TT MUST CONTACT BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT ; [REDACTED]**Location Summary: Units: 7 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Accelerat	30	14	15	1	4/16/20	1	TR	0		[REDACTED]	738

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544395/-122.573155

Worked Reason:

Tree Com: .9S/W/OF P7 2XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 98**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 98**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 11:38 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051279
[REDACTED]			IGO	C-6	-	P-25	3/31/20 11:38 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051279

**Loc Comments:** P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT ; [REDACTED]
**Location Summary: Units: 8 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pine Overhang	Routine	100	24	16	1	4/16/20	1	TR	0			[REDACTED]	748

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544517/-122.573588

Worked Reason:

Tree Com: .2S/W/OFP8 SSD#6091

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Bigleaf Maple Slope	Routine	40	38	14	1	4/16/20	1	TR	0			[REDACTED]	750
------------	---------------------	---------	----	----	----	---	---------	---	----	---	--	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544265/-122.573868

Worked Reason:

Tree Com: .3S/W/OF P8 SSD#6091 3XSTM

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 98

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 11:38 AM
XStreet		Group	County SHASTA	Loc Rt: 1890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051279
[REDACTED]			IGO	C-6	-	P-25	3/31/20 11:38 AM
XStreet		Group	County SHASTA	Loc Rt: 1890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051279

Loc Comments: P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI &amp; TT MUST BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT ; [REDACTED]

Location Summary:		Units: 8	Notification:		Completed								>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin	Overhang	Routine	100	24	16	1	4/16/20	1	TR	0		[REDACTED]	755

Tree Com: .4S/W/OF P8 SSD#6091

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Ponderosa Pin	Overhang	Routine	100	27	16	1	4/16/20	1	TR	0		[REDACTED]	756

Tree Com: .5S/W/OF P8 SSD#6091

Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 98**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 11:38 AM
XStreet		Group	County SHASTA	Loc Rt: 1890	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051279
[REDACTED]			IGO	C-6	-	P-25	3/31/20 11:38 AM
XStreet		Group	County SHASTA	Loc Rt: 1890	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051279

**Loc Comments:** P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT ; [REDACTED]

Location Summary:	Units: 8	Notification:
-------------------	----------	---------------

← Completed →

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Canyon Live O Rmv1-B+Trt	Routine	25	9	2		2	4/16/20	2	R1	0		[REDACTED]	763

Com:

Tline: Owner: Private

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544380/-122.574030

Worked Reason:

Tree Com: .8S/W/OF P8 SSD#6091

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Side	Routine	28	19	13	1	4/16/20	1	TR	0		[REDACTED]	764
Com:													

Tline: Owner: Private

Clearance: 13

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544347/-122.573903

Worked Reason:

Tree Com: .8S/W/OF P8 SSD#6091

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 98**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 11:38 AM
XStreet	Group	County SHASTA		Loc Rt: 1890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY		Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue		Struct1		Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051279
[REDACTED]			IGO	C-6	-	P-25	3/31/20 11:38 AM
XStreet	Group	County SHASTA		Loc Rt: 1890	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY		Loc Lat/Lon 40.544487 / -122.573845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue		Struct1		Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051279

**Loc Comments:** P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT ; [REDACTED]**Location Summary: Units: 8 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Bigleaf Maple	TopDirecti	Routine	35	24	14	1	4/16/20	1	TR	0		[REDACTED]	765

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544482/-122.574252

Worked Reason:

Tree Com: .9S/W/OF P8 SSD#6091; RDSD XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 99**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 99**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 2:49 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051279
[REDACTED]			IGO		C-6	-	P-25 3/31/20 2:49 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051279

**Loc Comments:** P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. TREES ALONG SECONDARY TO NORTH; I WILL MAKE APPOINTMENT [REDACTED]

**Location Summary: Units: 1 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Cedar	Sec Strain	Routine	38	13	4	1	4/16/20	1	XX	0		[REDACTED]	766

Com:

Tline: Owner: Private Clearance: 4

Tree Lat/Lon: 40.544380/-122.573962

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .1S/N/OF/P9; FLAGGED

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 100**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 100**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 3:08 PM
XStreet			County SHASTA	Loc Rt: 1910	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1		Customer Phone #1
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
			IGO	C-6	-	P-25	3/31/20 3:08 PM
XStreet			County SHASTA	Loc Rt: 1910	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1		Customer Phone #1
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

**Loc Comments:** P9 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. MINIMUM CLEARANCE.

Location Summary: Units: 9		Notification:										
----- Completed -----												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Bigleaf Maple	Top	Routine	27	7	14	1	4/16/20	1	TR	0		██████████	774
<b>Com:</b>														
Tline:	Owner: Private				Clearance: 14									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.544405/-122.574005				Worked Reason:								

Tree Com: .2S/W/OF P9; 2XSTM, W/SD/OF DRIVEWAY

Worked Comments:

Psc Com:

Alerts:

██████████	Bigleaf Maple	TopDirecti	Routine	30	13	12	1	4/16/20	1	TR	0		██████████	775
<b>Com:</b>														
Tline:	Owner: Private				Clearance: 12									
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.544525/-122.574173				Worked Reason:								

Tree Com: .2S/W/OF P9; 2XSTM, W/SD/OF DRIVEWAY

Worked Comments:

Psc Com: GROWTH

Alerts:


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 100**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 3:08 PM
XStreet		Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/31/20 3:08 PM
XStreet		Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P9 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI &amp; TT MUST BEFORE DOING ANY WORK. MINIMUM CLEARANCE.

Location Summary: Units: 9			Notification:														
Completed																	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #			
[REDACTED]	Bigleaf Maple	TopDirecti	Routine	35	7	14	1	4/16/20	1	TR	0		[REDACTED]	776			
Com:																	
Tline: Owner: Private			Clearance: 14														
Tree Lat/Lon: 40.544543/-122.574167																	
Wire Type: None VELB Area: Yes			Worked Reason:														

Tree Com: .2S/W/OF P9; W/SD/OF DRIVEWAY

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Bigleaf Maple	TopDirecti	Routine	35	14	14	1	4/16/20	1	TR	0		[REDACTED]	777			
Com:																	
Tline: Owner: Private			Clearance: 14														
Tree Lat/Lon: 40.544480/-122.573988			Worked Reason:														

Tree Com: .2S/W/OF P9; S/SD/ROAD

Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 100**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 3:08 PM
XStreet		Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/31/20 3:08 PM
XStreet		Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

**Loc Comments:** P9 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. MINIMUM CLEARANCE.

Location Summary: Units: 9			Notification:														
Completed																	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #			
[REDACTED]	Cedar	Side	Routine	55	13	11	1	4/16/20	1	TR	0		[REDACTED]	778			
Com:																	
Tline:	Owner: Private			Clearance: 11													
Wire Type: None	VELB Area: Yes			Tree Lat/Lon: 40.544533/-122.574462													
Worked Reason:																	

Tree Com: .3S/W/OF P9;

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Bigleaf Maple	Side	Routine	30	10	14	1	4/16/20	1	TR	0		[REDACTED]	779			
Com:																	
Tline:	Owner: Private			Clearance: 14													
Wire Type: None	VELB Area: Yes			Tree Lat/Lon: 40.544428/-122.574345													

Tree Com: .3S/W/OF P9; S/SD/RD

Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 100**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 3:08 PM
XStreet		Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY				Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1	Customer Phone #1
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue				Struct1	Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number
			IGO	C-6	-	P-25	3/31/20 3:08 PM
XStreet		Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY				Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1	Customer Phone #1
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue				Struct1	Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number

**Loc Comments:** P9 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. MINIMUM CLEARANCE.**Location Summary: Units: 9 Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
	Ponderosa Pin Side	Routine	60	12	14	1		4/16/20	1	TR	0			782

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.545030/-122.574627 Worked Reason:

Tree Com: .5S/W/OF P9; FLGD/PTD; N/SD

Worked Comments:

Psc Com:

Alerts:

	Bigleaf Maple	TopDirecti	Routine	60	46	14	1	4/16/20	1	TR	0			790
--	---------------	------------	---------	----	----	----	---	---------	---	----	---	--	--	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544472/-122.574683 Worked Reason:

Tree Com: .7S/W/OF P9; XSTEM, ON RD, TTB

Worked Comments:

Psc Com: TAGGED OUT 10-15-18

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 100**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 3:08 PM
XStreet	Group	County SHASTA		Loc Rt: 1910	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY		Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue		Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number
[REDACTED]		IGO		C-6	-	P-25	3/31/20 3:08 PM
XStreet	Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY		Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]	
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue		Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number

**Loc Comments:** P9 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. MINIMUM CLEARANCE.

Location Summary: Units: 9			Notification:											
			Completed											
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Cedar	Side	Routine	100	45	11	1	4/16/20	1	BO	0		[REDACTED]	792
Com:														
Tline: Owner: Private			Clearance: 11											
Tree Lat/Lon: 40.544515/-122.575070			Worked Reason:											
Wire Type: None VELB Area: Yes														

Tree Com: .8S/W/OF P9. CREEKSIDE

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 101**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 101

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/11/20 8:29 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1920	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544548 / -122.574998		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/11/20 8:29 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1920	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544548 / -122.574998		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

**Loc Comments:** P10 RDSD W/O ADD [REDACTED] IC,NF: PI & TT CALL AHEAD TO SET AN APPOINTMENT TO PERFORM WORK. PI: CUST WILL WALK LINE WITH YOU & DO NOT PAINT TREES ONLY FLGD. TT: CUST MUST BE PRESENT FOR TRIMS. LEAVE OFFICE # SO HE CAN RETURN CALLS

Location Summary: Units: 4 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Side	Routine	95	17	12	1	1	4/15/20	1	TR	0		[REDACTED]	793

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544550/-122.575090

Worked Reason:

Tree Com: .1S/W/OF P10; ABV AND BELOW ; FLAGGED

Worked Comments:

Psc Com: FLAGGED AT BASE ON SMALL BLACK OAK

Alerts:

[REDACTED]	Cedar	Side	Routine	30	18	10	1	4/15/20	1	TR	0		[REDACTED]	798
------------	-------	------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 10

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544413/-122.575303

Worked Reason:

Tree Com: .4S/W/OF P10. S/OF LN. ABV AND BELOW; FLGD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 101

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/11/20 8:29 AM
XStreet		Group	County SHASTA	Loc Rt: 1920	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544548 / -122.574998		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/11/20 8:29 AM
XStreet		Group	County SHASTA	Loc Rt: 1920	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544548 / -122.574998		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

**Loc Comments:** P10 RDSD W/O ADD [REDACTED] IC,NF: PI & TT CALL AHEAD TO SET AN APPOINTMENT TO PERFORM WORK. PI: CUST WILL WALK LINE WITH YOU & DO NOT PAINT TREES ONLY FLGD. TT: CUST MUST BE PRESENT FOR TRIMS. LEAVE OFFICE # SO HE CAN RETURN CALLS

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Side	Routine	35	39	12	1	4/15/20	1	TR	0		[REDACTED]	800

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544388/-122.575162 Worked Reason:

Tree Com: .5S/W/OF P10 XSTM FLGD

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Bigleaf Maple	TopDirecti	Routine	30	36	15	1	4/15/20	1	TR	0		[REDACTED]	805
------------	---------------	------------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 15

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544456/-122.575331 Worked Reason:

Tree Com: .9S/W/OF P10 XSTM. UNDER LN. FLGD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 102

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 102

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/11/20 8:29 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1930	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544465 / -122.575523		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/11/20 8:29 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1930	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544465 / -122.575523		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P11 TP RDSD W/OF ADD [REDACTED] IC,NF: PI & TT CALL AHEAD TO SET AN APPOINTMENT TO PERFORM WORK. PI: CUST WILL WALK LINE WITH YOU & DO NOT PAINT TREES ONLY FLGD. TT: CUST MUST BE PRESENT FOR TRIMS. LEAVE OFFICE# SO HE CAN RETURN CALLS DEC 1 OF E2

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	40	18	14	1	1	4/15/20	1	TR	0		[REDACTED]	807

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544567/-122.575627 Worked Reason:

Tree Com: .1S/N/OF P11 TP FLGD

Worked Comments:

Psc Com: SNOW BENT

Alerts:

[REDACTED]	Cedar	Top	Routine	25	28	10	1	4/15/20	1	TR	0		[REDACTED]	808
------------	-------	-----	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 10

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544618/-122.575406 Worked Reason:

Tree Com: .2S/N/OF P11 TP 2XSTM FLGD

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 103


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 103**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:01 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1935	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544522 / -122.575528		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Name #2 [REDACTED]	Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 6091	NTW Number 4051299		
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1935	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544522 / -122.575528		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Name #2 [REDACTED]	Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091	NTW Number 4051299		

Loc Comments: P11 TP RDSD; ALL TREES WEST OF LINE; REC 2 OF 2

Location Summary: Units: 4		Notification:											
		<----- Completed ----->											

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Ponderosa Pin	Rmv 1-B	Routine	35	8	1	1	4/15/20	1	R1	0	[REDACTED]	[REDACTED]	813
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.544617/-122.575672 Worked Reason:														

Tree Com: .2S/N/OF/P11 TP;

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Ponderosa Pin	Rmv 1-B	Routine	40	11	1	1	4/15/20	1	R1	0	[REDACTED]	[REDACTED]	814
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.544658/-122.575668 Worked Reason:														

Tree Com: .3S/N/OF/P11 TP; WEST SIDE

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 103

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:01 PM		
XStreet		Group	County SHASTA	Loc Rt: 1935	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544522 / -122.575528		Customer Name #1	Customer Phone #1			
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 6091					
			IGO	C-6	-	P-25	3/26/20 2:01 PM		
XStreet		Group	County SHASTA	Loc Rt: 1935	U-Bld No	Insp	Inspection Company CN Utility		
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544522 / -122.575528		Customer Name #1	Customer Phone #1			
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2			
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091					
Loc Comments: P11 TP RDSD; ALL TREES WEST OF LINE; REC 2 OF 2									

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Ponderosa Pin	Rmv 1-B	Routine	39	7	1	1	4/15/20	1	R1	0			816

Com:

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: No 40.544723/-122.575635

Clearance:

Worked Reason:

Tree Com: .3S/N/OF/P11 TP; WEST SIDE

Worked Comments:

Psc Com:

Alerts:

X	Ponderosa Pin	Rmv 1-B	Routine	40	8	1	1	4/15/20	1	R1	0			817
Com:	Tline:	Owner: Private	Clearance:	Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.544747/-122.575670	Worked Reason:							

Tree Com: .4S/N/OF/P11 TP; WEST SIDE

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 104

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 104**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/11/20 8:30 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1940	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.545255 / -122.575543		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/11/20 8:30 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1940	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.545255 / -122.575543		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

**Loc Comments:** P11 TP RDSD W/OF ADD [REDACTED] P2 1S/N/OF P11TP NOT PAINTED IC,NF; PI & TT CALL AHEAD TO SET AN APPOINTMENT TO PERFORM WORK. PI: CUST WILL WALK LINE WITH YOU & DO NOT PAINT TREES ONLY FLGD. TT:CUST MUST BE PRESENT FOR TRIMS. LEAVE OFFICE# SO HE CAN RETURN CALL

**Location Summary: Units: 1 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Side	Routine	50	40	14	1	4/15/20	1	TR	0		[REDACTED]	819

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.545188/-122.575480 Worked Reason:

Tree Com: .1S/N/OF P2 E/SD; FLGD

Worked Comments:

Psc Com: SNOW BENT, TRIM FOR BOTH SPANS

Alerts:

Notes:

**Location Num: 105**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 105**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/16/20 11:36 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1970	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.546192 / -122.575393		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/16/20 11:36 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1970	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.546192 / -122.575393		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Concerned Customer Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

**Loc Comments:** P11 TP RDSD WOF ADD [REDACTED] P4 3S/N/O P11 TP. IC,NF: PI & TT CALL AHEAD TO SET AN APPT TO PERFORM WORK. PI: CUST WILL WALK LINE WITH YOU & DO NOT PAINT TREES OR POLES ONLY FLGD. TT: CUST MUST BE PRESENT FOR TR MS. LEAVE OFFICE# SO HE CAN RETURN CALLS.

**Location Summary: Units: 1 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	HV dbh	Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	Side	Routine	60	32	16	1	4/15/20	1	TR	0		[REDACTED]	821

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546325/-122.575363 Worked Reason:

Tree Com: .4S/NW/OF P4

Worked Comments:

Psc Com: NOT PAINTED OR FLAGGED. POLE NOT PAINTED EITHER; TREE DOWN HILL TO WEST ON S/SD/LINES

Alerts:

Notes:

**Location Num: 106**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 106

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 1:30 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1990	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544532 / -122.575583		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25	4/2/20 1:30 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1990	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544532 / -122.575583		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: P11 TP RDSD W/OF ADD [REDACTED] PLEASE DO GOOD CLEANUP							

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X [REDACTED]	Ponderosa Pin	Rmv 1-B	Routine	23	4	1	1	4/15/20	1	R1	0		[REDACTED]	830

Com:

Tline: Owner: Private Clearance:  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.544558/-122.576122 Worked Reason:

Tree Com: .4S/W/OF P11 TP FLGD/PTD

Worked Comments:

Psc Com: PLEASE DO GOOD CLEANUP

Alerts:

Com:	Canyon Live O Side	Routine	70	32	14	1	4/15/20	1	TR	0		[REDACTED]	835
------	--------------------	---------	----	----	----	---	---------	---	----	---	--	------------	-----

Tline: Owner: Private Clearance: 14  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.544375/-122.576250 Worked Reason:

Tree Com: .9S/W/OF P11 TP; N/SD/OF RD

Worked Comments:

Psc Com: TRIM ABOVE LINES

Alerts:

Notes:

Location Num: 107

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 107

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 1:44 PM
XStreet			County SHASTA	Loc Rt: 2000	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544185 / -122.576432		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051299
			IGO	C-6	-	P-25	4/2/20 1:44 PM
XStreet			County SHASTA	Loc Rt: 2000	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544185 / -122.576432		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051299

Loc Comments: P12 RDSD E/OF PSTD ADD; PLEASE DO GOOD CLEANUP

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Black Oak	TopDirecti	Routine	26	12	10	1	4/15/20	1	TR	0		██████████	841

Com:

Tline: Owner: Private Clearance: 10

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544530/-122.576808

Worked Reason:

Tree Com: .7S/W/OF P12; FLAGGED

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 108

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 108

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 4:11 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2030	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544982 / -122.577845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051297
[REDACTED] IGO			C-6	-	P-25		3/31/20 4:11 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2030	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544982 / -122.577845		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051297

Loc Comments: P14 RDSD E/OF PSTD ADD

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	30	19	14	1	5/4/20	1	TR	0		[REDACTED]	845

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544692/-122.577942

Worked Reason:

Tree Com: .1S/W/OF P14 2XSTM

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Canyon Live O Rmv2-B+Trt	Routine	45	14	1	5/4/20	1	R2	0		[REDACTED]	851
--------------	--------------------------	---------	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544867/-122.578467

Worked Reason:

Tree Com: .7S/W/OF P14; N/SD

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 108

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 4:11 PM
XStreet		Group	County SHASTA	Loc Rt: 2030	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544982 / -122.577845		Customer Name #1		Customer Phone #1
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051297
			IGO	C-6	-	P-25	3/31/20 4:11 PM
XStreet		Group	County SHASTA	Loc Rt: 2030	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544982 / -122.577845		Customer Name #1		Customer Phone #1
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051297

Loc Comments: P14 RDSD E/OF PSTD ADD

Location Summary:		Units: 3	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Canyon Live O	Rmv2-B+Trt	Routine	30	20	1	1	5/4/20	1	R2	0			852

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544790/-122.578355

Worked Reason:

Tree Com: .8S/W/OF P14; 4XSTEM

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 109

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 109

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 4:00 PM
XStreet			Group	County SHASTA	Loc Rt: 2040	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544813 / -122.579248			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2 [REDACTED]	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	3/31/20 4:00 PM
XStreet			Group	County SHASTA	Loc Rt: 2040	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544813 / -122.579248			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2 [REDACTED]	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P15 RDSD E/OF PSTD ADD. COSTUMER WILL SIGN FOR [REDACTED] PROPERTY

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	25	15	14	1	5/7/20	1	TR	0		[REDACTED]	857

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544735/-122.578638

Worked Reason:

Tree Com: @ P15; 2 XSTEM

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O	Side	Routine	65	28	14	1	5/7/20	1	TR	0		[REDACTED]	859
------------	---------------	------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.545053/-122.578515

Worked Reason:

Tree Com: .2S/W/OF P15

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 109**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 4:00 PM
XStreet		Group	County SHASTA	Loc Rt: 2040	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544813 / -122.579248		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
			IGO	C-6	-	P-25	3/31/20 4:00 PM
XStreet		Group	County SHASTA	Loc Rt: 2040	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544813 / -122.579248		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P15 RDSD E/OF PSTD ADD. COSTUMER WILL SIGN FOR █████ PROPERTY

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Canyon Live O Side	Routine	65	30	14	1	5/7/20	1	TR	0		██████████	860	

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544888/-122.578785

Worked Reason:

Tree Com: .2S/W/OF P15

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 110**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 110

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 2:51 PM
XStreet			County SHASTA	Loc Rt: 2050	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544397 / -122.579398		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
			IGO	C-6	-	P-25	4/1/20 2:51 PM
XStreet			County SHASTA	Loc Rt: 2050	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544397 / -122.579398		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: P16 LB RDSD S/OF PSTD ADD							

Location Summary: Units: 1      Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
████	Black Oak	Side	Accelerat	35	18	12	1	4/30/20	1	BA	0		██████████	868

Com:

Tline: Owner: Private      Clearance: 12

Tree Lat/Lon:

Wire Type: None      VELB Area: Yes 40.544894/-122.579499

Worked Reason:

Tree Com: .3S/S/OF P16 LB; FLAGGED/PTD

Worked Comments:

Psc Com: SNOW BENT

Alerts:

Notes:

Location Num: 111


**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 111**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:05 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2060	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544398 / -122.579398		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25		4/1/20 3:05 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2060	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544398 / -122.579398		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P17 RDSD S/OF PSTD ADD

Location Summary: Units: 1		Notification:										
		<----- Completed ----->										

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin Br Trim	Routine	27	3	14	1	4/30/20	1	BT	0		[REDACTED]		878

Com:

Tline: Owner: Private Clearance: 14  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.544103/-122.580048 Worked Reason:

Tree Com: .7S/S/OF P17

Worked Comments:

Psc Com: ROADSIDE

Alerts:

Notes:

**Location Num: 112**

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 112**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:15 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 2070	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543902 / -122.580157			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/1/20 3:15 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 2070	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543902 / -122.580157			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: P18 RDSD S/OF PSTD ADD							

**Location Summary: Units: 3      Notification:**

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	45	15	11	1	1	4/30/20	1	TR	0		[REDACTED]	884
Com:														
Tline: Owner: Private Clearance: 11														
Tree Lat/Lon: 40.543647/-122.580205														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .4S/S/OF P18 FLGD ROADSIDE

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Douglas Fir	Side	Routine	30	6	12	1	4/30/20	1	TR	0		[REDACTED]	885
Com:														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: 40.543223/-122.580333														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .4S/S/OF P18; FLGD AT RD WITH OAK

Worked Comments:

Psc Com: GROWING IN CANYON LIVE OAK

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 112

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:15 PM
XStreet	Group	County SHASTA	Loc Rt: 2070	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543902 / -122.580157		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/1/20 3:15 PM
XStreet	Group	County SHASTA	Loc Rt: 2070	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543902 / -122.580157		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P18 RDSD S/OF PSTD ADD

Location Summary: Units: 3		Notification:												
Completed														
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	45	12	12	1	4/30/20	1	TR	0		[REDACTED]	888

Tline: Owner: Private Clearance: 12  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.543178/-122.580220 Worked Reason:

Tree Com: .8S/S/OF P18 TTB;

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 113

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 113**

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:34 PM
XStreet			County SHASTA	Loc Rt: 2080	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543173 / -122.580353		Customer Name #1 [REDACTED]		Customer Phone #1 530-243-0735
Alerts Access Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/1/20 3:34 PM
XStreet			County SHASTA	Loc Rt: 2080	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543173 / -122.580353		Customer Name #1 [REDACTED]		Customer Phone #1 530-243-0735
Alerts Access Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P19 RDSD S/OF PSTD ADD

Location Summary:		Units: 1	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	35	16	1		1	4/30/20	1	BA	0		[REDACTED]	893

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.543127/-122.580423

Worked Reason:

Tree Com: AT P19; UP HILL; 2XSTEM; FLGD AT ROADSIDE

Worked Comments:

Psc Com: TRIM BACK FLOPPY SNOW BENT TOP

Alerts:

Notes:

**Location Num: 114**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 114**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 4:17 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2090	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542687 / -122.580560		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25	4/1/20 4:17 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2090	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542687 / -122.580560		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P20 RDSD A/F PSTD ADD

Location Summary:		Units: 4	Notification:
		← Completed →	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	45	24	12	1	1	5/4/20	1	TR	0		[REDACTED]	904

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542615/-122.580778

Worked Reason:

Tree Com: .1S/S/OF P20 2XSTM TTB

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Side	Routine	45	48	14	1	1	5/4/20	1	TR	0		[REDACTED]	905
Com:														

Tline:

Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542667/-122.580813

Worked Reason:

Tree Com: .1S/S/OF P20; UP HILL; TTB; 4XSTEM

Worked Comments:

Psc Com:

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 114

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 4:17 PM
XStreet		Group	County SHASTA	Loc Rt: 2090	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542687 / -122.580560		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/1/20 4:17 PM
XStreet		Group	County SHASTA	Loc Rt: 2090	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542687 / -122.580560		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: P20 RDSD A/F PSTD ADD							

Location Summary: Units: 4 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	45	28	12	1	1	5/4/20	1	TR	0		[REDACTED]	907

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542635/-122.580927 Worked Reason:

Tree Com: .6S/S/OF P20; UP HILL; TTB;

Worked Comments:

Psc Com: ABOVE LINES 14'

Alerts:

[REDACTED]	Canyon Live O Slope	Routine	40	37	12	1	1	5/4/20	1	TR	0		[REDACTED]	910
------------	---------------------	---------	----	----	----	---	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 12

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542253/-122.581156 Worked Reason:

Tree Com: .8S/S/OF P20 2XSTM TTB

Worked Comments:

Psc Com: SNOW BENT

Alerts:

Notes:

Location Num: 115

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 115**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 4:30 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2120	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541950 / -122.581675		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25	4/1/20 4:30 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2120	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541950 / -122.581675		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P22 RDSD E/OF PSTD ADD

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	TopDirecti	Routine	30	14	13	1	5/5/20	1	TR	0		[REDACTED]	915

Com:

Tline: Owner: Private Clearance: 13

Tree Lat/Lon: 40.541813/-122.582007

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .7S/W/OF P22

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 116**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 116**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 4:32 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541797 / -122.582147		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25	4/1/20 4:32 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541797 / -122.582147		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P23 RDSD @ PSTD ADD @ DRWY ENT; GATE COMBO [REDACTED]

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	45	37	14	1	1	5/5/20	1	TR	0		[REDACTED]	918

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541803/-122.582432 Worked Reason:

Tree Com: .2S/W/OF P23 XSTM; SD ABV LINES

Worked Comments:

Psc Com: SNOW BENT

Alerts:

X [REDACTED]	Ponderosa Pin Rmv 1-B	Routine	33	9	1	5/5/20	1	R1	0		[REDACTED]	[REDACTED]	920
--------------	-----------------------	---------	----	---	---	--------	---	----	---	--	------------	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541825/-122.582548 Worked Reason:

Tree Com: .4S/W/OF P23;

Worked Comments:

Psc Com:

Alerts:

**Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 116**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 4:32 PM
XStreet		Group	County SHASTA	Loc Rt: 2130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541797 / -122.582147		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051298
[REDACTED]			IGO	C-6	-	P-25	4/1/20 4:32 PM
XStreet		Group	County SHASTA	Loc Rt: 2130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541797 / -122.582147		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051298

Loc Comments: P23 RDSD @ PSTD ADD @ DRWY ENT; GATE COMBO [REDACTED]

Location Summary: Units: 3		Notification:											<----- Completed ----->	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Ponderosa Pin	Rmv 2-B	Routine	70	19	1	1	5/5/20	1	R2	0	[REDACTED]	[REDACTED]	924
Com:														

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.541802/-122.582873

Clearance:

Worked Reason:

Tree Com: .9S/W/OF P23; TTB

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 117**


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 117**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 9:56 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2140	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542210 / -122.583368		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051298
[REDACTED] IGO			C-6	-	P-25		4/2/20 9:56 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2140	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542210 / -122.583368		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051298

**Loc Comments:** AX DRWY @ PSTD ADD EP ON DRWY, CAN WALK UP HILL WEST OF PSTD ADD. VERY SMALL T.A. TREE CREW SCOUT FIRST. GATE COMBO [REDACTED] GO IN ANYTIME; PLEASE DO GOOD CLEANUP ;

**Location Summary: Units: 2 Notification:**

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O Side	Routine	30	15	10	1	1	5/5/20	1	TR	0		[REDACTED]	925

Com:

Tline: Owner: Private Clearance: 10

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542120/-122.583506

Worked Reason:

Tree Com: @ EP.; PTD

Worked Comments:

Psc Com:

Alerts:

X [REDACTED]	Canyon Live O Rmv 1-B	Routine	28	11	1	5/5/20	1	R1	0		[REDACTED]	[REDACTED]	930
--------------	-----------------------	---------	----	----	---	--------	---	----	---	--	------------	------------	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541970/-122.583498

Worked Reason:

Tree Com: .8S/S/OF EP; XSTEM, UNDERLINE

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 118**

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 118

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 8:23 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 2150	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541712 / -122.582997		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 00000-0000	SSD #: 6091			NTW Number 4051298
[REDACTED]			C-6	-	P-25		4/2/20 8:23 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 2150	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541712 / -122.582997		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051298

Loc Comments: AX DRWY @ PSTD ADD P24 ON DRWY; GATE COMBO [REDACTED] GO IN ANYTIME ; PLEASE DO GOOD CLEANUP

Location Summary: Units: 3		Notification:															
Completed																	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #			
[REDACTED]	Canyon Live O Side	Routine	40	12	14	1	5/5/20	1	TR	0			[REDACTED]	934			
Com:																	
Tline:	Owner: Private			Clearance: 14													
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.541802/-122.582997			Worked Reason:												

Tree Com: .2S/W/OF P24; SIDE ABV LINES

Worked Comments:

Psc Com: NEW CONSTRUCTION AND SNOW BENT; POSSIBLE LIFT ACCESS

Alerts:

[REDACTED]	Canyon Live O Side	Routine	55	55	14	1	5/5/20	1	TR	0			[REDACTED]	936			
Com:																	
Tline:	Owner: Private			Clearance: 14													
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.541820/-122.583128			Worked Reason:												

Tree Com: .3S/W/OF P24; 2 XSTEM

Worked Comments:

Psc Com: SIDE ABOVE LINES ; POSSIBLE LIFT ACCESS

Alerts:

Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 118

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 8:23 AM
XStreet		Group	County SHASTA	Loc Rt: 2150	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541712 / -122.582997		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/2/20 8:23 AM
XStreet		Group	County SHASTA	Loc Rt: 2150	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541712 / -122.582997		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: AX DRWY @ PSTD ADD P24 ON DRWY; GATE COMBO [REDACTED] GO IN ANYTIME ; PLEASE DO GOOD CLEANUP							

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
X	Ponderosa Pin	Rmv 1-B	Routine	30	11	1	1	5/5/20	1	R1	0		[REDACTED]	939

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541979/-122.583457

Worked Reason:

Tree Com: .8S/W/OF P24

Worked Comments:

Psc Com:

Alerts:

Notes:

Location Num: 119


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

**Location Num: 119**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 10:35 AM
XStreet			County SHASTA	Loc Rt: 2170	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541898 / -122.582668		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Dog			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/2/20 10:35 AM
XStreet			County SHASTA	Loc Rt: 2170	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541898 / -122.582668		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Dog			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P26 W/OF PSTD ADD ABOVE ROAD

Location Summary: Units: 1		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	Side	Routine	50	27	14	1	5/6/20	1	TR	0		[REDACTED]	942

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon: 40.542200/-122.585058

Wire Type: None VELB Area: No Worked Reason:

Tree Com: .7S/W/OF P26; ROADSIDE , S/SD

Worked Comments:

Psc Com:

Alerts:

Notes:

**Location Num: 120**

Pacific Gas & Electric  
Vegetation Management  
Work Request SHNV1029070

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 120

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 10:45 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 2190	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542457 / -122.585813			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Access Dog			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED]			IGO	C-6	-	P-25	4/2/20 10:45 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 2190	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542457 / -122.585813			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Access Dog			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: P28 W/OF PSTD ADD ABOVE ROAD EP 1SW RDSD.							

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Douglas Fir	Side	Routine	48	15	14	1	5/6/20	1	TR	0		[REDACTED]	947

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542538/-122.586022

Worked Reason:

Tree Com: .2S/W/OF P28;

Worked Comments:

Psc Com:

Alerts:

[REDACTED]	Canyon Live O Side	Routine	60	40	14	1	5/6/20	1	TR	0		[REDACTED]	948
------------	--------------------	---------	----	----	----	---	--------	---	----	---	--	------------	-----

Com:

Tline: Owner: Private Clearance: 14

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542636/-122.586205

Worked Reason:

Tree Com: .3S/W/OF P28; , ON RD S/SD

Worked Comments:

Psc Com:

Alerts:


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request SHNV1029070**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number:

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 120

General Comments: ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= SHNV1029070 and TL.sAcctType= 'M'

Location Num: 120

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 10:45 AM
XStreet	Group	County SHASTA	Loc Rt: 2190	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542457 / -122.585813		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Dog			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091	NTW Number		
[REDACTED]			IGO	C-6	-	P-25	4/2/20 10:45 AM
XStreet	Group	County SHASTA	Loc Rt: 2190	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.542457 / -122.585813		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Dog			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091	NTW Number		

Loc Comments: P28 W/OF PSTD ADD ABOVE ROAD EP 1SW RDSD.

Location Summary: Units: 3		Notification:															
← Completed →																	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #			
[REDACTED]	Canyon Live O Side	Routine	60	27	14	1	5/6/20	1	TR	0		[REDACTED]		949			
Com:																	
Tline:	Owner: Private			Clearance: 14													
Wire Type: None	VELB Area: Yes	40.542557/-122.586155	Tree Lat/Lon: Worked Reason:														

Tree Com: .3S/W/OF P28; , ON RD N/SD

Worked Comments:

Psc Com: TRIM ABOVE LINES ; GET BIG CLEARANCE

Alerts:

Notes:

Totals for Work Request: SHNV1029070 Units: 376

R = TGR

W = Warranty

! = Special Equipment

X = Brush Cut

X = Removal

X = Fac Prot

# **EXHIBIT A-4**



**Vegetation Management  
Work Request C1NV1002839**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

**Contractor: Wright Tree**

### **Contract:**

### Work Type: Distribution

**Acct Type: Maintenance**

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

**Location Num:** 1

Address [REDACTED]		City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:02 AM	
XStreet [REDACTED]		Group	County SHASTA	Loc Rt: 680	U-Bld No	Insp [REDACTED]	
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513852 / -122.548012		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 10:02 AM
XStreet [REDACTED]		Group	County SHASTA	Loc Rt: 680	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.513852 / -122.548012		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number

**Loc Comments:** P2 RDSD S/OE PSTD ADD @ DRWY ENT AX [REDACTED] POLES THRU GATE PG&E LOCK

Tree Com: .2S/E/OF P2; 60' S/OF/LINE; DEAD

### **Worked Comments:**

Psc Com: MAKE TREE SAFE

## Alerts: First Patrol

### Notes:

**Location Num:** 2



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/320 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 2

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:17 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 710	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514772 / -122.546605		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4051289
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 710	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.514772 / -122.546605		Customer Name #1 [REDACTED]		Customer Phone #1 530-396-2511
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4051289

Loc Comments: P2 RDSD S/O PSTD ADD @ DRWY ENT P4 TP 2S/E THRU GATE S/O PSTD ADD PG&amp;E LOCK

Location Summary:		Units: 1	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	FP-Rmv3 B	Routine	98	31	15	1	5/5/20	1	B3	0		[REDACTED]	5
Com:														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: 40.514837/-122.546615														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/E/OF P4 TP;

Worked Comments:

Psc Com: TREE FADING QUICKLY; PLEASE CHIP AS MUCH AS POSSIBLE ; THIS TREE IS LIFT ACCESSIBLE , AND CLOSE TO ROAD , JUST EAST OF GREEN SHOP

Alerts: First Patrol

Notes:

Location Num: 3


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request C1NV1002839**

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

**Location Num: 3**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/17/20 10:20 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 720	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 [REDACTED]		Customer Phone #1 530-396-2511
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4051289
[REDACTED]			IGO	C-6	-	Q-25	3/17/20 10:20 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 720	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.516560 / -122.549347		Customer Name #1 [REDACTED]		Customer Phone #1 530-396-2511
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4051289

Loc Comments: P2 RDSD S/OF PSTD ADD @ DRWY ENT P5 3S/E THRU GATE S/OF PSTD ADD PG&amp;E LOCK

Location Summary:	Units: 1	Notification:
-------------------	----------	---------------

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	FP-Rmv2 B	Routine	75	17		1	4/23/20	1	B2	0		[REDACTED]	11

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.515233/-122.545775

Worked Reason:

Tree Com: .7S/E/OF P5; N/SD/LN; DEAD

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts: First Patrol

Notes:

**Location Num: 4**

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 4

Address			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/18/20 3:24 PM
XStreet			County SHASTA	Loc Rt: 859	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon /		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Dog Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 3489			NTW Number 4051287
██████████			IGO	C-6	-	Q-25	3/18/20 3:24 PM
XStreet			County SHASTA	Loc Rt: 859	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon /		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Dog Locked Gate			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 3489			NTW Number 4051287

Loc Comments: AX GATE @ PSTD ADD RIGHT @ FORK TO P8 TP ON DRWY PG&amp;E LOCK

Location Summary:		Units: 1	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Gray Pine	FP-Rmv2 B	Routine	75	21		1	4/7/20	1	B2	0		██████████	18
Com:														
Tline: Owner: Priv/State Clearance: Tree Lat/Lon: Wire Type: None VELB Area: Yes 40.516762/-122.545533 Worked Reason:														

Tree Com: .4S/W/OF P8 TP; 35' FROM ROAD ;

Worked Comments:

Psc Com: PLEASE CHIP AS MUCH AS POSSIBLE ; THANK YOU

Alerts: First Patrol

Notes:

Location Num: 5

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3/20  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 5

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area Q-25	Inspection Date / Time 3/18/20 4:03 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 880	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.517115 / -122.546328		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 3489	NTW Number 4051287		
[REDACTED]			IGO	C-6	-	Q-25	3/18/20 4:03 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 880	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.517115 / -122.546328		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Access Dog Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 3489	NTW Number 4051287		

Loc Comments: AX GATE @ PSTD ADD. GO RIGHT @ FORK WALK UP HILL TO EP TURN AROUND @ END/OF DRWY PG&amp;E LOCK; P1 AT BOTTOM , ROADSIDE ;

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak FS-R3B+Trt	Routine	42	25	1	[REDACTED]	1	4/7/20	1	D3	0		[REDACTED]	20
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.517080/-122.546005 Worked Reason:														
Wire Type: Raychem VELB Area: Yes														

Tree Com: .2S/E/OF EP; S/SD

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts: First Patrol

[REDACTED]	Gray Pine	FP-Rmv3 B	Routine	90	33	1	4/7/20	1	B3	0		[REDACTED]		21
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.517412/-122.546145 Worked Reason:														

Tree Com: .4S/E/OF EP

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts: First Patrol

Notes:

Location Num: 6



**Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839**

Apr 3, 2020

Division: INOZ Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

**Location Num: 6**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 3:20 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.525315 / -122.559068		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051290
[REDACTED] IGO			C-6	-	P-25		3/19/20 3:20 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.525315 / -122.559068		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051290

**Loc Comments:** THRU GATE RIGHT @ FORK TO P40 P39 1S/S/OF P40 SEC EP 1S/E/OF P39 GATE CODE [REDACTED]

Location Summary: Units: 1		Notification:										
← Completed →												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv3 B	Routine	80	27	1		1	4/9/20	1	B3	0		[REDACTED]	29
<b>Com:</b>														
Tline:	Owner: Private			Clearance:										
Wire Type: None	VELB Area: No	40.524733/-122.558463	Tree Lat/Lon: Worked Reason:											

Tree Com: .1S/W/OF/SEC EP

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

**Location Num: 7**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 8:45 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1190	U-Bld	Insp [REDACTED]	Inspection Company Wright Tree
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon /		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number AddedTree	Tag Type A	Packet Project #	SSD #: 1861			NTW Number

Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 7

Address		City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 8:45 AM
XStreet		Group	County SHASTA	Loc Rt: 1190	U-Bld	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN		Loc Lat/Lon /		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate		Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number AddedTree	Tag Type A	Packet Project #	SSD #: 1861	NTW Number	

## Loc Comments:

This is a copy of the original location record. It was added as a TAG to support work complete tree records added by the contractor.

Location Summary: Units: 0			Notification:										Completed	
Completed													>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Alder	FP-Rmv2 B	Routine	0	0	0	0	4/13/20	3	B2	0	0	[REDACTED]	431
Com: Added by contractor.														

## Alerts:

[REDACTED]	Alder	FP-Major B	Routine	0	0	0	0	5/7/20	1	BB	0	0	[REDACTED]	432
Com: Added by contractor.														

## Alerts:

Notes:

Location Num: 8


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request C1NV1002839**

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

**Location Num: 8**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/19/20 4:49 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1190	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527707 / -122.557128		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051281
[REDACTED] IGO			C-6	-	P-25		3/19/20 4:49 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1190	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.527707 / -122.557128		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051281

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD 8210. TREE CREW CALL [REDACTED] FOR ACCESS. [REDACTED] SHE WILL LET YOU IN

Location Summary: Units: 2	Notification:
----------------------------	---------------

← Completed →

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak FP-Trim B	Routine	50	24	25	1	4/7/20	1	BA	0			[REDACTED]	32
<b>Com:</b>														
Tline: Owner: Private Clearance: 25														
Tree Lat/Lon: 40.527263/-122.557392 Worked Reason:														

Tree Com: .7S/S/OF P44 TP SSD#4191

Worked Comments:

Psc Com: TOP TREE DOWN TO BELOW LINE HEIGHT ; REMOVE FLOPPY TOPS; SQUIRREL NEST IN TREE

Alerts: First Patrol

[REDACTED]	Interior Live Oak FP-Major B	Routine	50	40	20	1	4/7/20	1	BB	0			[REDACTED]	34
<b>Com:</b>														
Tline: Owner: Private Clearance: 20														
Tree Lat/Lon: 40.527207/-122.557480 Worked Reason:														

Tree Com: .8S/S/OF P44 TP SSD#4191 XSTEM

Worked Comments:

Psc Com: TOP TREE DOWN TO BELOW LINE HEIGHT ; REMOVE FLOPPY TOPS; SQUIRREL NEST IN TREE

Alerts: First Patrol

Notes:

**Location Num: 9**



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/320 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 9

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 10:07 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1220	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.528362 / -122.556693		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051295
[REDACTED]			IGO	C-6	-	P-25	3/23/20 10:07 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1220	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.528362 / -122.556693		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051295

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD; P45 1S/NE UP HILL

Location Summary: Units: 3		Notification:											
		< ----- Completed ----- >											

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Interior Live Oak FP-Trim A	Routine	35	14	15	1	4/14/20	1	B2	0			[REDACTED]	35
Com:														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: 40.528370/-122.556682														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .2S/N/OF P45; E/SD/OF LNS

Worked Comments:

Psc Com: VERY LARGE CAVITY; TREE APPEARS TO BE DEAD; SIDE TRIM 12 FEET

Alerts: First Patrol

[REDACTED]	Gray Pine	FP-Rmv2 B	Routine	65	18	1	4/14/20	1	B2	0			[REDACTED]	38
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.528562/-122.556472														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/N/OF P45; E/OF/LINES

Worked Comments:

Psc Com:

Alerts: First Patrol


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request C1NV1002839**

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 9

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 10:07 AM
XStreet		Group	County SHASTA	Loc Rt: 1220	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.528362 / -122.556693		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 1861			NTW Number 4051295
[REDACTED]			IGO	C-6	-	P-25	3/23/20 10:07 AM
XStreet		Group	County SHASTA	Loc Rt: 1220	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.528362 / -122.556693		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 1861			NTW Number 4051295

Loc Comments: P44 TP SSD#4191 RDSD N/OF PSTD ADD; P45 1S/NE UP HILL

Location Summary: Units: 3		Notification:												
		Completed											>	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	FP-Rmv4 B	Routine	95	37	1	1	4/14/20	1	B4	0		[REDACTED]	39
Com:														
Tline:			Owner: Private			Clearance:								
Wire Type: None			VELB Area: Yes			Tree Lat/Lon: 40.528587/-122.556315								Worked Reason:

Tree Com: .3S/N/O P45. E/OF/LINES; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 10

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 10

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 11:56 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1255	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number
[REDACTED] IGO			C-6	-	P-25	3/23/20 11:56 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1255	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.532485 / -122.557167		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number

Loc Comments: P48 SSD#4855 RDSD N/OF PSTD ADD [REDACTED] P49 1S/W AX GATE A/F P48; TREE CREW NF FOR ACCESS

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Valley Oak	FP-Trim B	Routine	55	24	15	1	4/27/20	1	BB	0		[REDACTED]	45
Com:														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: 40.532118/-122.556730														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .4S/E/OF P49 TP;

Worked Comments:

Psc Com: TOP BELOW LINES; TREE FADING

Alerts: First Patrol

[REDACTED]	Poplar	FP-Trim B	Routine	60	14	20	1	4/27/20	1	BB	0		[REDACTED]	48
Com:														
Tline: Owner: Private Clearance: 20														
Tree Lat/Lon: 40.532097/-122.556738														

Tree Com: .5S/E/OF P49 TP; DEAD

Worked Comments:

Psc Com: TOP BELOW LINES

Alerts: First Patrol

Notes:

Location Num: 11

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 11

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:54 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855	NTW Number 4051296		
[REDACTED]			IGO	C-6	-	P-25	3/23/20 2:54 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855	NTW Number 4051296		

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST GET KEY FROM [REDACTED] STEEP DRWY! CAN AXS FRM RD FLGD BEFORE GT

Location Summary: Units: 8 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	FP-Rmv2 B	Routine	60	19		1	4/13/20	1	B2	0		[REDACTED]	55
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.538028/-122.560618 Worked Reason:														

Tree Com: .3S/E/OF P58; DEAD; N/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Gray Pine	FP-Rmv3 B	Routine	100	29		1	4/13/20	1	B3	0		[REDACTED]	56
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.538017/-122.560603 Worked Reason:														

Tree Com: .3S/E/OF P58 TP; N/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 11

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST GET KEY FROM [REDACTED] STEEP DRWY! CAN AXS FRM RD FLGD BEFORE GT

Location Summary: Units: 8 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FS-R1B+Trt	Routine	31	9	1		1	4/9/20	1	D1	0		[REDACTED]	57

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537922/-122.560395

Worked Reason:

Tree Com: .5\$E/OF P58 TP

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Canyon Live O FS-R3B+Trt	Routine	45	24	1	4/13/20	1	D3	0		[REDACTED]			58
------------	--------------------------	---------	----	----	---	---------	---	----	---	--	------------	--	--	----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537898/-122.560417

Worked Reason:

Tree Com: .5\$E/OF P58 TP; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 11

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST GET KEY FROM [REDACTED] STEEP DRWY! CAN AXS FRM RD FLGD BEFORE GT

Location Summary: Units: 8 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FS-R2B+Trt	Routine	45	19	1		1	4/13/20	1	D2	0		[REDACTED]	59

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537863/-122.560432

Worked Reason:

Tree Com: .5S/E/OF P58 TP; N/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Canyon Live O FS-R2B+Trt	Routine	50	18	1	4/9/20	1	D2	0		[REDACTED]		60
------------	--------------------------	---------	----	----	---	--------	---	----	---	--	------------	--	----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537967/-122.560221

Worked Reason:

Tree Com: .5S/E/OF P58 TP; S/SD

Worked Comments:

Psc Com: FLAGGED

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 11

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/23/20 2:54 PM
XStreet		Group	County SHASTA	Loc Rt: 1340	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538033 / -122.560768		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] GT FLGD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST GET KEY FROM [REDACTED] STEEP DRWY! CAN AXS FRM RD FLGD BEFORE GT

Location Summary: Units: 8 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	FP-Rmv3 B	Routine	95	25		1	4/9/20	1	B3	0		[REDACTED]	61

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537867/-122.560453

Worked Reason:

Tree Com: .5\$E/OF P58 TP; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Gray Pine	FP-Rmv2 B	Routine	65	16		1	4/9/20	1	B2	0		[REDACTED]	62
Com:	Tline:	Owner: Private	Clearance:											

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.537902/-122.560377

Worked Reason:

Tree Com: .6\$E/OF P58; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 12

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 12

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/23/20 3:52 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1365	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.537256 / -122.560898		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1		Struct2	Customer Name #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO		C-6	-	P-25 3/23/20 3:52 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1365	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.537256 / -122.560898		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1		Struct2	Customer Name #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT P59 1SW/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST CALL TO HAVE GT OPENED.

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FP-Rmv2 B	Routine	35	12	1	1	4/14/20	1	B2	0		[REDACTED]	71

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544472/-122.575661 Worked Reason:

Tree Com: .2S/E/OF P59;DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 13

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 13

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:37 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1370	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538997 / -122.562920		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1		Struct2	Customer Name #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO C-6		-	P-25	3/26/20 2:37 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1370	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538997 / -122.562920		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1		Struct2	Customer Name #2 [REDACTED]	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT P59 1S/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST CALL TO HAVE GT OPENED.

Location Summary: Units: 4	Notification:	<----- Completed ----->									
----------------------------	---------------	-------------------------	--	--	--	--	--	--	--	--	--

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FS-R2B+Trt	Routine	40	16	1		1	4/14/20	1	B3	0		[REDACTED]	73

Com:

Tline: Owner: Private Clearance:  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.538677/-122.562037 Worked Reason:

Tree Com: .3S/W/OF P59; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Canyon Live O FP-Trim B	Routine	34	32	14	1	4/14/20	1	BA	0		[REDACTED]	77
Com:	Tline: Owner: Private Clearance: 14 Tree Lat/Lon: Wire Type: None VELB Area: Yes 40.532147/-122.556123 Worked Reason:												

Tree Com: .7S/W/OF P59;XSTM

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 13

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:37 PM
XStreet		Group	County SHASTA	Loc Rt: 1370	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538997 / -122.562920		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED]			IGO	C-6	-	P-25	3/26/20 2:37 PM
XStreet		Group	County SHASTA	Loc Rt: 1370	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.538997 / -122.562920		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY @ 1ST DRWY ENT PAST [REDACTED] ADD FLGD GT P59 1S/W/OF P58 TP ABOVE ZOGG MINE RD CUST WANTS TO KNOW WHO IS ON PROPERTY.MUST CALL TO HAVE GT OPENED.

Location Summary: Units: 4	Notification:	<----- Completed ----->									
----------------------------	---------------	-------------------------	--	--	--	--	--	--	--	--	--

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Gray Pine	FS-R3B+Trt	Routine	40	24		1	4/14/20	1	D3	0		[REDACTED]	78

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.539843/-122.566332

Worked Reason:

Tree Com: .9S/W/OF P59; S/SD/LNS

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Canyon Live O	FS-R2B+Trt	Routine	33	15	1	4/14/20	1	D2	0		[REDACTED]	79
------------	---------------	------------	---------	----	----	---	---------	---	----	---	--	------------	----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.538212/-122.561195

Worked Reason:

Tree Com: .9S/W/OF P59;

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 14

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 14

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:46 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1390	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539067 / -122.563743		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051296
[REDACTED] IGO			C-6	-	P-25	3/26/20 2:46 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1390	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539067 / -122.563743		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051296

Loc Comments: P58 TP ON DRWY 1ST DRWY ENT PAST PSTD ADD [REDACTED] FLGD GT P61 3S/W/OF P58 TP ABOVE ZOGG MINE RD CAN AX FROM RD UP HILL CUST WANTS TO KNOW WHO IS ON PROPERTY.

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	FS-R2B+Trt	Routine	35	15	1	1	4/30/20	1	D2	0		[REDACTED]	80
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.539322/-122.563670 Worked Reason:														

Tree Com: .1S/W/OF P61; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Gray Pine	FP-Rmv1 B	Routine	35	11	1	1	4/30/20	1	B1	0		[REDACTED]	83
Com:														
Tline: Owner: Private Clearance:														
Wire Type: None VELB Area: No 40.539837/-122.566323 Worked Reason:														

Tree Com: .7S/W/OF P61

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 15


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request C1NV1002839**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

**Location Num: 15**

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 1:38 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1414	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540708 / -122.569018		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051286
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1414	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540708 / -122.569018		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051286

**Loc Comments:** AX DRWY @ PSTD ADD RIGHT @ FORK X BRDG RIGHT @ FORK TO EP IFO HSE.SMALL TAI DROP CHIPPER. NF IN PERSON. SMALL TRUCK ONLY. NO PHONE, STOP BY, OR CALL CELL PHONE.

Location Summary: Units: 2		Notification:										
		<----- Completed ----->										

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FS-R4B+Trt	Routine	65	44	1		1	4/29/20	1	D4	0		[REDACTED]	87
<b>Com:</b>														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.540505/-122.568930														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/N/OF EP

Worked Comments:

Psc Com: PLEASE PILE BRUSH; THIS IS A VERY DANGEROUS TREE WITH LARGE OVERHANG. IT MAY NEED A LINE DROP.

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Ov B	Routine	80	25	16	1	4/29/20	1	BO	0		[REDACTED]	90
<b>Com:</b>													
Tline: Owner: Private Clearance: 16													
Tree Lat/Lon: 40.540632/-122.569026													
Wire Type: None VELB Area: Yes Worked Reason:													

Tree Com: .4S/N/OF EP

Worked Comments:

Psc Com: REMOVE DEAD WOOD ABOVE LINES

Alerts: First Patrol

Notes:

**Location Num: 16**

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 16

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 2:16 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1416	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540793 / -122.567255		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051286
[REDACTED]			IGO	C-6	-	P-25	3/18/20 2:16 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1416	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; E/OF HORSE CANYON WAY			Loc Lat/Lon 40.540793 / -122.567255		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Notify First PI Notify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051286

Loc Comments: AX DRWY @ PSTD ADD RIGHT @ FORK X BRDG RIGHT @ FORK TO EP IFO HSE P68 TP 1S/NW NF IN PERSON, NO PHONE, STOP BY, OR CALL CELL PHONE

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Alder - White	FS-R1B+Trt	Routine	50	11	1	1	4/28/20	1	D1	0		[REDACTED]	97

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.540927/-122.569325

Worked Reason:

Tree Com: .1S/N/OF P68 TP

Worked Comments:

Psc Com: FADING OUT PLUS BASE DAMAGED

Alerts: First Patrol

Notes:

Location Num: 17

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 17

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:17 PM
XStreet			County SHASTA	Loc Rt: 1480	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540333 / -122.566352		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Dog			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
██████████			IGO	C-6	-	P-25	3/24/20 12:17 PM
XStreet			County SHASTA	Loc Rt: 1480	U-Bld No	Insp	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.540333 / -122.566352		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Dog			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: P64 4WAY ON DRWY @ PSTD ADD STEEP DRWY! SMALL TA!

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Ponderosa Pin	FP-Rmv3 B	Routine	100	28	1	1	4/23/20	1	XX	0		██████████	101
Com:														
Tline: Owner: Private														
Tree Lat/Lon:														
Wire Type: Raychem VELB Area: No 40.540603/-122.565885 Worked Reason:														

Tree Com: .9S/S/OF P64 4WAY; W/OF/LINE 60'

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 18

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 18

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 12:21 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051291
[REDACTED] IGO			C-6	-	P-25	3/24/20 12:21 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1490	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.539807 / -122.566173		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051291

Loc Comments: P2 ON DRWY @ PSTD ADD; STEEP DRIVEWAY , AND VERY SMALL TA; PLEASE DO GOOD CLEANUP

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	88	20	1		1	4/16/20	1	B2	0		[REDACTED]	102
Com:														
Tline:	Owner: Private			Clearance:										
Wire Type: None	VELB Area: No	40.540890/-122.566098	Tree Lat/Lon: Worked Reason:											

Tree Com: .1S/S/OF P2; E/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 19

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 19

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/24/20 4:41 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1525	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541058 / -122.568978		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO	C-6	-	P-25	3/24/20 4:41 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1525	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541058 / -122.568978		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN P68 TP 1S/W FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TRIMS; PI [REDACTED] MUST BE PRESENT FOR ALL TR MS.

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Alder - White	FP-Rmv2 B	Routine	50	12	2	2	4/13/20	2	B2	0		[REDACTED]	108
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.540910/-122.569250 Worked Reason:														
Wire Type: None VELB Area: No														

Tree Com: .2S/N/OF P68 TP TREES @ CREEK- DEAD

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts: First Patrol

[REDACTED]	Alder - White	FP-Rmv2 B	Routine	50	14	1	4/13/20	1	B2	0		[REDACTED]	109
Com:													
Tline: Owner: Private Clearance:													
Tree Lat/Lon: 40.540820/-122.569328 Worked Reason:													

Tree Com: .2S/N/OF P68 TP TREES @ CREEK- DEAD

Worked Comments:

Psc Com: PLEASE PILE BRUSH

Alerts: First Patrol

Notes:

Location Num: 20

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 20

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 9:09 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO C-6		-	P-25	3/25/20 9:09 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1550	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF LARRY HORSE LN			Loc Lat/Lon 40.541548 / -122.569517		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Concerned Customer Notify First PI No ify First			Struct1		Struct2	Customer Name #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

Loc Comments: P67 N/OF ADD [REDACTED] @ ONE LANE NEXT 400 FEET SIGN EP 400 FT N/OF P67 E/SD/OF RD P69 TP 1S/W/OF EP FLAG ALL TRIMS  
CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FS-R3B+Trt	Routine	52	25	1		1	4/20/20	BB	0			[REDACTED]	131

Com:

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.542252/-122.570247

Worked Reason:

Tree Com: .9S/W/OF P69 TP; DEAD

Worked Comments:

Psc Com: PLEASE CHIP BRUSH

Alerts: First Patrol

Notes:

Location Num: 21

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/320 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 21

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 10:02 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			
[REDACTED]			IGO	C-6	-	P-25	3/25/20 10:02 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			

Loc Comments: P2 S/OF HSE ON 1ST DRWY ON RIGHT GATE CODE [REDACTED] FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	70	22	1		1	4/20/20	1	XX	0		[REDACTED]	133

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542288/-122.570345

Worked Reason:

Tree Com: .1S/W/OF P2; DYING

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Canyon Live O FP-Rmv2 B	Routine	48	22	1	4/20/20	1	B2	0				[REDACTED]	140
Com:	Tline: Owner: Private Clearance:													

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542686/-122.570435

Worked Reason:

Tree Com: .4S/W/OF P2 FLGD/PTD

Worked Comments:

Psc Com: PLEASE CHIP AS MUCH AS POSSIBLE FROM THIS TREE

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3rd Party

Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 21

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 10:02 AM
XStreet		Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051292
[REDACTED]			IGO	C-6	-	P-25	3/25/20 10:02 AM
XStreet		Group	County SHASTA	Loc Rt: 1560	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.542173 / -122.570290		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051292

Loc Comments: P2 S/OF HSE ON 1ST DRWY ON RIGHT GATE CODE [REDACTED] FLAG ALL TRIMS CUSTOMER MUST BE PRESENT FOR TR MS; PI [REDACTED] MUST BE PRESENT FOR ALL TRIMS.

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FP-Ov B	Routine	55	38	16	1	[REDACTED]	4/20/20	1	BO	0	[REDACTED]	[REDACTED]	144

Com:

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.542808/-122.570420

Worked Reason:

Tree Com: .7S/W/OF P2;

Worked Comments:

Psc Com: LIFT ACCESS, BUT MAYBE CHECK FIRST

Alerts: First Patrol

Notes:

Location Num: 22

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 22

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:23 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
[REDACTED]			IGO	C-6	-	P-25	3/30/20 9:23 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

Loc Comments: P4 3RD POLE ON ROAD. S/O OF PSTD ADD. GATE CODE [REDACTED] NF: PI &amp; TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

Location Summary:		Units: 3	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #

[REDACTED]	Knobcone Pine FP-Rmv1 B	Routine	65	10	1	4/15/20	1	B1	0					158
------------	-------------------------	---------	----	----	---	---------	---	----	---	--	--	--	--	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546457/-122.569660

Worked Reason:

Tree Com: .6S/N/OF P4

Worked Comments:

Psc Com: TREE HAS MAJOR DEFECT ON SIDE

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	75	11	1	4/15/20	1	B1	0					159
------------	-------------------------	---------	----	----	---	---------	---	----	---	--	--	--	--	-----

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546575/-122.569755

Worked Reason:

Tree Com: .6S/N/OF P4 TAL W/OF RD

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3rd Party

Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 22

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:23 AM
XStreet		Group	County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
[REDACTED]			IGO	C-6	-	P-25	3/30/20 9:23 AM
XStreet		Group	County SHASTA	Loc Rt: 1620	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546107 / -122.569862		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

Loc Comments: P4 3RD POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	50	7	1	[REDACTED]	4/15/20	2	B1	0		[REDACTED]		160

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546605/-122.569687

Worked Reason:

Tree Com: .8S/N/OF P4

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 23



Apr 3, 2020

Division: INO/3 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 23

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 9:44 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1630	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546602 / -122.569677		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
[REDACTED] IGO			C-6	-	P-25	3/30/20 9:44 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1630	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546602 / -122.569677		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

Loc Comments: P5 4TH POLE ON ROAD. S/OF PSTD ADD. GATE CODE [REDACTED] NF: PI &amp; TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	35	5	1		1	4/15/20	1	B1	0		[REDACTED]	163

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546662/-122.569727

Worked Reason:

Tree Com: .2S/N/OF P5; ROADSIDE

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Black Oak	FP-Ov B	Routine	45	17	16	1	4/15/20	1	BO	0		[REDACTED]	169
Com:	Tline:	Owner: Private	Clearance: 16											

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.546953/-122.569583

Worked Reason:

Tree Com: .8S/N/OF P5; 2XSTEM; ON HILL ABV ROAD

Worked Comments:

Psc Com: REMOVE DEAD AND GREEN OVERHANG

Alerts: First Patrol

Notes:

Location Num: 24

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 24

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 3:43 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1650	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547378 / -122.570835		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1650	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547378 / -122.570835		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

Loc Comments: P1 ON 1ST DRWY WITH GREEN GATE ON LEFT GATE CODE [REDACTED] INF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS [REDACTED]

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv3 B	Routine	100	30	1		1	5/7/20	1	B3	0		[REDACTED]	173
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: [REDACTED]														
Wire Type: None VELB Area: Yes 40.546968/-122.570807 Worked Reason:														

Tree Com: .9S/S/OF P1;, 45' W/OF/LINE

Worked Comments:

Psc Com: PLEASE PILE BRUSH; THANK YOU

Alerts: First Patrol

Notes:

Location Num: 25

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 25

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/25/20 3:54 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1660	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546903 / -122.570672		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051293
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1660	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.546903 / -122.570672		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051293

Loc Comments: P1 ON 1ST DRWY WITH GREEN GATE ON LEFT P2 1S/S/OF P1 GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME CUST WOULD LIKE A HEADS UP BEFORE LINE IS TO BE PATROLED AND TREES WORKED. AX: SMALL TURN AROUND. GATE COMB @ DRIVEWAY IS

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine FP-Rmv2 B	Routine	75	17	1	[REDACTED]	5/7/20	1	B2	0		[REDACTED]		174
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.546897/-122.570920 Worked Reason:														

Tree Com: AT P2; 50' WEST

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	35	8	1	5/7/20	1	B1	0		[REDACTED]		177
Com:													
Tline: Owner: Private Clearance:													
Tree Lat/Lon: 40.546582/-122.570647 Worked Reason:													

Tree Com: .7S/S/OF P2

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 26

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 26

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:21 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:21 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051280

Loc Comments: P7 6TH POLE ON ROAD. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED]

Location Summary:		Units: 6	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #

[REDACTED]	Canyon Live O FP-Trim A	Routine	35	15	14	1	5/7/20	1	AA	0		[REDACTED]	182
Com:													
Tline: Owner: Private Clearance: 14													
Tree Lat/Lon: 40.548384/-122.569999 Worked Reason:													

Tree Com: .3S/N/OF P7 W/OF RD; 3XSTEM-DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	65	10	3	5/7/20	3	B1	0		[REDACTED]	191
Com:												
Tline: Owner: Private Clearance:												
Tree Lat/Lon: 40.548568/-122.569993 Worked Reason:												

Tree Com: .8S/N/OF P7; WEST SD 45'

Worked Comments:

Psc Com: AVG HT AND DBH

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 26

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:21 PM
XStreet		Group	County SHASTA	Loc Rt: 1700	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547803 / -122.569990		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Bad Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051280

Loc Comments: P7 6TH POLE ON ROAD. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED]

Location Summary:		Units: 6	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	32	6	1		1	5/7/20	1	B1	0		[REDACTED]	192

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548640/-122.569912

Worked Reason:

Tree Com: .9S/N/OF P7;

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Canyon Live O FP-Trim A	Routine	35	6	14	1	5/7/20	1	AA	0		[REDACTED]		193
Com:	Tline:	Owner: Private	Clearance: 14											

Tree Com: .3S/N/OF P7 W/OF RD;-DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 27

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3 Valley

Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 27

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 3:46 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1705	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548288 / -122.569898		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051285
[REDACTED]			IGO	C-6	-	P-25	3/26/20 3:46 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1705	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548288 / -122.569898		Customer Name #1 [REDACTED]		Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051285

Loc Comments: P7 6TH POLE ON ROAD.. GATE CODE [REDACTED] EAST SD LINES

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	70	9	1		1	5/7/20	1	B1	0		[REDACTED]	195

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.548407/-122.569888 Worked Reason:

Tree Com: .6S/N/OF/P7; UPHILL 50' FROM LINES

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 28

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 28

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/16/20 12:15 PM
XStreet			Group	County SHASTA	Loc Rt: 1710	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548410 / -122.573510			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Access Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051280
[REDACTED]			IGO	C-6	-	P-25	3/16/20 12:15 PM
XStreet			Group	County SHASTA	Loc Rt: 1710	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548410 / -122.573510			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Access Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051280

Loc Comments: EP N/OF HSE END/OF 2ND DRWY ON LEFT. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE [REDACTED] CALL ONE DAY IN ADVANCE SO CUST CAN PUT DOG UP. 11-2 BEST-LATE SLEEPER.

Location Summary: Units: 3 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FS-R2B+Trt	Routine	45	17		1	5/11/20	1	D2	0		[REDACTED]	202
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.548477/-122.573533 Worked Reason:														

Tree Com: .2S/W/OF EP; S/OF LN

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Black Oak	FS-R2B+Trt	Routine	48	22		1	5/11/20	1	D2	0		[REDACTED]	203
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.548638/-122.573280 Worked Reason:														

Tree Com: .3S/W/OF EP; N/OF LN

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 28

Address			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/16/20 12:15 PM
XStreet		Group	County SHASTA	Loc Rt: 1710	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548410 / -122.573510		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051280
			IGO	C-6	-	P-25	3/16/20 12:15 PM
XStreet		Group	County SHASTA	Loc Rt: 1710	U-Bld No	Insp	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548410 / -122.573510		Customer Name #1 ██████████		Customer Phone #1 ██████████
Alerts Access Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 ██████████		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051280

**Loc Comments:** EP N/OF HSE END/OF 2ND DRWY ON LEFT. FAMILY NAME IS PSTD ON TREE AT DRWY ENT. GATE CODE █████ CALL ONE DAY IN ADVANCE SO CUST CAN PUT DOG UP. 11-2 BEST-LATE SLEEPER.

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
██████████	Ponderosa Pin	FP-Rmv3 B	Routine	90	25	1	1	5/11/20	1	B3	0		██████████	206

Com:

Tline: Owner: Private

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548610/-122.573848

Worked Reason:

Tree Com: .6S/W/OF EP, N/SD DEAD FLAGGED

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 29

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 29

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 10:09 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1730	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548403 / -122.569645		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051284
[REDACTED]			IGO	C-6	-	P-25	3/18/20 10:09 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1730	U-Bld No	Insp [REDACTED]
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548403 / -122.569645		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051284

Loc Comments: P8 LB @ 2ND DRWY ON LEFT P9 TP 1S/E/OF P8 LB GATE CODE [REDACTED] WILL SET APPOINTMENT TIME AND NOTIFY TREE CREW. MUST DO GOOD CLEANUP .

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine FP-Rmv2 B	Routine	70	22	1		1	4/8/20	1	B2	0		[REDACTED]	213
Com:														
Tline:	Owner: Private			Clearance:										
Wire Type: None	VELB Area: Yes	40.548733/-122.569363	Tree Lat/Lon: Worked Reason:											

Tree Com: .3S/N/OF P9 TP

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 30



Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 30

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 10:04 AM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1745	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.549168 / -122.568540		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051285
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1745	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.549168 / -122.568540		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Locked Gate			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051285

Loc Comments: P11 LB S/OF PSTD ADD @ DRWY ENT GATE CODE [REDACTED] REC 2/2

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	60	14	1		4/8/20	2	B2	0			[REDACTED]	221
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.548545/-122.571750 Worked Reason:														

Tree Com: .2S/W/OF P11 LB; DEAD

Worked Comments:

Psc Com: NEAR ROAD, TO FAR FOR LIFT

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	95	19	1	4/8/20	1	B2	0				[REDACTED]	222
Com:														
Tline: Owner: Private Clearance:														
Wire Type: None VELB Area: No Tree Lat/Lon: 40.548310/-122.571635 Worked Reason:														

Tree Com: .4S/W/OF P11 LB;

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 31


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request C1NV1002839**

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 31

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 9:19 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051284
[REDACTED] IGO			C-6	-	P-25	3/18/20 9:19 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051284

**Loc Comments:** P12 LB S/OF PSTD ADD @ DRWY ENT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT!!! IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. [REDACTED] WILL SET APPOINTMENT FOR TREE CREW

Location Summary: Units: 3		Notification: <----- Completed ----->												
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine FP-Rmv2 B	Routine	50	12	1	[REDACTED]	4/7/20	1	B2	0		[REDACTED]	229	
Com:														
Tline:		Owner: Private					Clearance:							
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.550048/-122.568770					Worked Reason:							

Tree Com: .5\$W/OF P12 LB; N/SD; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Knobcone Pine FP-Rmv3 B	Routine	60	29	1	4/7/20	1	B3	0		[REDACTED]	231
Com:												
Tline:		Owner: Private					Clearance:					
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.550105/-122.569063					Worked Reason:					

Tree Com: .8\$W/OF P12 LB; N/SD; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3rd Party

Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 31

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/18/20 9:19 AM
XStreet		Group	County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051284
[REDACTED]			IGO	C-6	-	P-25	3/18/20 9:19 AM
XStreet		Group	County SHASTA	Loc Rt: 1760	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.550048 / -122.568933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Locked Gate Notify First PI Notify First Past Refusal			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051284

Loc Comments: P12 LB S/OF PSTD ADD @ DRWY ENT GATE CODE [REDACTED] NF: PI & TT CONTACT AHEAD OF TIME TO SCHEDULE AN APPOINTMENT!!! IC: CUST WANT TO BE PRESENT WHEN WORK IS BEING PERFORMED. [REDACTED] WILL SET APPOINTMENT FOR TREE CREW

Location Summary: Units: 3 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine FP-Rmv3 B	Routine	70	25	1		1	4/7/20	1	B3	0		[REDACTED]	232

Com:

Tline: Owner: Private

Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.550075/-122.569062

Worked Reason:

Tree Com: .8S/W/OF P12 LB; S/SD; DEAD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 32

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 32

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 10:52 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1800	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051294
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1800	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547350 / -122.568192		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Access Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

Loc Comments: RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P3 LB ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 1		Notification:											< Completed >	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	32	4	1		1	5/12/20	B1	0			[REDACTED]	235
Com: [REDACTED]														
Tline: Owner: Private Clearance: [REDACTED]														
Tree Lat/Lon: [REDACTED]														
Wire Type: None VELB Area: Yes 40.547273/-122.568170 Worked Reason: [REDACTED]														

Tree Com: .3S/W/OF P3 LB; DEAD, N/SD

Worked Comments:

Psc Com: DOT, NO X

Alerts: First Patrol

Notes:

Location Num: 33



Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 33

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 11:17 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1810	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/ON HORSE CANYON WAY			Loc Lat/Lon 40.547147 / -122.567933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051294
[REDACTED] IGO			C-6	-	P-25		3/30/20 11:17 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1810	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/ON HORSE CANYON WAY			Loc Lat/Lon 40.547147 / -122.567933		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

Loc Comments: RIGHT @ FORK @ RED BARN END/O/RD PAST 1ST HSE TO P3 LB ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 2 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Knobcone Pine FP-Rmv2 B	Routine	70	18	1		1	5/12/20	1	B2	0		[REDACTED]	251

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547442/-122.567890

Worked Reason:

Tree Com: .4S/N/OF P3 LB

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Black Oak	FP-Trim B	Routine	40	19	16	1	5/12/20	1	BA	0		[REDACTED]	254
Com:														

Tline: Owner: Private Clearance: 16

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.547495/-122.567908

Worked Reason:

Tree Com: .8S/N/OF P3 LB;

Worked Comments:

Psc Com: SNOW BENT AND DYING OFF

Alerts: First Patrol

Notes:

Location Num: 34



Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 34

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 11:28 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1820	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547815 / -122.567830		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051294
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1820	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.547815 / -122.567830		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

Loc Comments: RIGHT @ FORK @ RED BARN END/OF RD PAST 1ST HSE TO P4 ON DRWY GATE CODE [REDACTED]

Location Summary: Units: 4 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	85	22	1	[REDACTED]	5/12/20	1	B2	0		[REDACTED]		260

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.548043/-122.567955

Worked Reason:

Tree Com: .8S/N/OF P4; EAST SD 60

Worked Comments:

Psc Com: LIFT ACCESS FROM OTHER DRIVEWAY

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	32	5	3	5/12/20	3	B1	0		[REDACTED]		263
Com:	Tline:	Owner: Private	Clearance:										

Tree Lat/Lon: 40.547915/-122.567897

Worked Reason:

Tree Com: AT P5; PAINTED

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 35

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 35

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 11:42 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1830	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548127 / -122.567928		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 7223			NTW Number 4051294
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1830	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions W/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE>E/ON HORSE CANYON			Loc Lat/Lon 40.548127 / -122.567928		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Locked Gate			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 7223			NTW Number 4051294

Loc Comments: LEFT @ FORK @ RED BARN END/OF RD TO P5 LB ON DRWY, WALK AROUND LOCKED GATE CODE [REDACTED]

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	42	7	1		1	5/12/20	B1	0			[REDACTED]	265

Com:

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.548250/-122.567772

Clearance:

Worked Reason:

Tree Com: .3S/E/OF P5 LB; S/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 36



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 36

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 4:32 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1850	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051293
[REDACTED] IGO			C-6	-	P-25		3/30/20 4:32 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1850	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051293

Loc Comments: P4 1ST POLE RDSD N/OF HORSE CANYON WAY

Location Summary: Units: 6			Notification:														
Completed																	
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #			
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	65	11	1	1	5/6/20	1	B1	0			[REDACTED]	269			
Com:																	
Tline:	Owner: Private			Clearance:													
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.543375/-122.570737			Worked Reason:												

Tree Com: .2S/NW/OF P4; DEAD

Worked Comments:

Psc Com: NEAR ROAD, BUT TOO FAR FOR LIFT.

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	75	14	1	5/6/20	1	B2	0				[REDACTED]	270	
Com:															
Tline:	Owner: Private			Clearance:											
Wire Type: None	VELB Area: Yes	Tree Lat/Lon: 40.543362/-122.570730			Worked Reason:										

Tree Com: .2S/NW/OF P4; DEAD

Worked Comments:

Psc Com: NEAR ROAD, BUT TOO FAR FOR LIFT.

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 36

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 4:32 PM
XStreet		Group	County SHASTA	Loc Rt: 1850	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 00000-0000	SSD #: 4855			NTW Number 4051293
[REDACTED]			IGO	C-6	-	P-25	3/30/20 4:32 PM
XStreet		Group	County SHASTA	Loc Rt: 1850	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051293

Loc Comments: P4 1ST POLE RDSD N/OF HORSE CANYON WAY

Location Summary:		Units: 6	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	65	10	1		1	5/6/20	1	B1	0		[REDACTED]	271
Com:														
Tline: Owner: Private Clearance: Tree Lat/Lon: 40.543378/-122.570733														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .2S/NW/OF P4; DEAD

Worked Comments:

Psc Com: NEAR ROAD, BUT TOO FAR FOR LIFT.

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	65	9	1	5/6/20	1	B1	0		[REDACTED]			272
Com:														
Tline: Owner: Private Clearance: Tree Lat/Lon: 40.543333/-122.570768														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .3S/NW/OF P4; DEAD

Worked Comments:

Psc Com: NEAR ROAD, BUT TOO FAR FOR LIFT.

Alerts: First Patrol



Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 36

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/30/20 4:32 PM
XStreet		Group	County SHASTA	Loc Rt: 1850	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 4855			NTW Number 4051293
[REDACTED]			IGO	C-6	-	P-25	3/30/20 4:32 PM
XStreet		Group	County SHASTA	Loc Rt: 1850	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; N/OF HORSE CANYON WAY			Loc Lat/Lon 40.544790 / -122.571347		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 4855			NTW Number 4051293

Loc Comments: P4 1ST POLE RDSD N/OF HORSE CANYON WAY

Location Summary:		Units: 6	Notification:	<----- Completed ----->										
Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv2 B	Routine	68	12	1		1	5/7/20	1	B2	0		[REDACTED]	273
Com:														
Tline: Owner: Private Clearance: Tree Lat/Lon:														
Wire Type: None	VELB Area: Yes	40.543328/-122.570765	Worked Reason:											

Tree Com: .3S/NW/OF P4; DEAD

Worked Comments:

Psc Com: NEAR ROAD, BUT TOO FAR FOR LIFT.

Alerts: First Patrol

[REDACTED]	Canyon Live O FS-R3B+Trt	Routine	38	24	1	5/7/20	1	D3	0		[REDACTED]			274
Com:														
Tline:	Owner: Private	Clearance:												
Wire Type: None	VELB Area: Yes	40.543873/-122.570567	Worked Reason:											

Tree Com: .3S/N/OF P4; 2XSTEM

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 37



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3rd Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 37

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 10:47 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 7241			
[REDACTED]			IGO	C-6	-	P-25	3/31/20 10:47 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1880	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544743 / -122.572508		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Concerned Customer Notify First PI No ify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 7241			

Loc Comments: P7 RDSD N/OF HORSE CANYON WAY. ADD IS PSTD ON GATE. IC, NF: PI & TT MUST CONTACT BEFORE DOING ANY WORK. I WILL MAKE APPOINTMENT ; [REDACTED]

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FP-Ov B	Routine	90	38	16	1	4/16/20	1	BO	0		[REDACTED]	297
Com:														
Tline: Owner: Private Clearance: 16														
Tree Lat/Lon: 40.544412/-122.573252														
Wire Type: None VELB Area: No Worked Reason:														

Tree Com: .9S/W/OF P7; SD TOO 12'

Worked Comments:

Psc Com: GET DEAD LIMBS ABOVE, AND SIDE TRIM ALL SPROUTS, TTB; TRIM FOR BOTH SPANS; OV ON BOTH SPANS

Alerts: First Patrol

Notes:

Location Num: 38



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 38

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 2:49 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 6091	NTW Number 4051279		
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091	NTW Number 4051279		

Loc Comments: P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK TREES ALONG SECONDARY TO NORTH; I WILL MAKE APPOINTMENT [REDACTED]

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Bigleaf Maple	FS-R1B+Trt	Routine	45	10		1	4/16/20	1	XX	0		[REDACTED]	299

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544643/-122.573848

Worked Reason:

Tree Com: .5S/N/OF/P9; PTD

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Bigleaf Maple	FS-R2B+Trt	Routine	45	12		1	4/16/20	1	XX	0		[REDACTED]	300
Com:														

Tline:

Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544630/-122.573793

Worked Reason:

Tree Com: .5S/N/OF/P9; PTD

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 38

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 2:49 PM
XStreet		Group	County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091	NTW Number 4051279		
[REDACTED]			IGO	C-6	-	P-25	3/31/20 2:49 PM
XStreet		Group	County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091	NTW Number 4051279		

Loc Comments: P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI &amp; TT MUST BEFORE DOING ANY WORK TREES ALONG SECONDARY TO NORTH; I WILL MAKE APPOINTMENT [REDACTED]

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Bigleaf Maple	FS-R2B+Trt	Routine	45	21		1	4/16/20	1	XX	0		[REDACTED]	301

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544693/-122.573817 Worked Reason:

Tree Com: .7S/N/OF/P9; PTD; XSTEM

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Bigleaf Maple	FS-R2B+Trt	Routine	45	13		1	4/16/20	1	XX	0		[REDACTED]	302
Com:	Tline:	Owner: Private	Clearance:											

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544617/-122.573913 Worked Reason:

Tree Com: .7S/N/OF/P9; PTD;

Worked Comments:

Psc Com:

Alerts: First Patrol

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 38

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 2:49 PM
XStreet		Group	County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091	NTW Number 4051279		
[REDACTED]			IGO	C-6	-	P-25	3/31/20 2:49 PM
XStreet		Group	County SHASTA	Loc Rt: 1900	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544382 / -122.574023		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091	NTW Number 4051279		

Loc Comments: P8 SSD#6091 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI & TT MUST BEFORE DOING ANY WORK. TREES ALONG SECONDARY TO NORTH; I WILL MAKE APPOINTMENT [REDACTED]

Location Summary: Units: 5 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Bigleaf Maple	FS-R3B+Trt	Routine	45	29	1	1	4/16/20	1	XX	0		[REDACTED]	303

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: No 40.544573/-122.573887 Worked Reason:

Tree Com: .7S/N/OF/P9; PTD;

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 39



Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 39

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 3:08 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number [REDACTED]
[REDACTED]			IGO	C-6	-	P-25	3/31/20 3:08 PM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 1910	U-Bld No	Insp [REDACTED] Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544287 / -122.574805		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Concerned Customer Notify First PI Notify First Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number [REDACTED]

Loc Comments: P9 E/OF PSTD ADD @ DRWY ENT. IC, NF: PI &amp; TT MUST BEFORE DOING ANY WORK. MINIMUM CLEARANCE.

Location Summary: Units: 1 Notification:

&lt;----- Completed -----&gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Ov A	Routine	110	27	15	1	4/16/20	1	BO	0		[REDACTED]		315
Com:														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: [REDACTED]														
Wire Type: None VELB Area: Yes 40.544903/-122.574580 Worked Reason:														

Tree Com: .5S/W/OF P9; FLGD/PTD; S/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 40

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 40

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/26/20 2:01 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1935	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544522 / -122.575528		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051299
[REDACTED]			IGO	C-6	-	P-25	3/26/20 2:01 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1935	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544522 / -122.575528		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #1
Alerts			Struct1	Struct2	Customer Name #2	Customer Phone #2	Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051299

Loc Comments: P11 TP RDSD; ALL TREES WEST OF LINE; REC 2 OF 2

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	45	9	1		1	4/15/20	1	B1	0		[REDACTED]	327
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.544660/-122.575657 Worked Reason:														
Wire Type: None VELB Area: No														

Tree Com: .3S/N/OF/P11 TP; WEST SIDE

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	40	8	1	4/15/20	1	B1	0		[REDACTED]	330	
Com:													
Tline: Owner: Private Clearance:													
Tree Lat/Lon: 40.544745/-122.575658 Worked Reason:													
Wire Type: None VELB Area: No													

Tree Com: .4S/N/OF/P11 TP; WEST SIDE

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 41

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 41

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 1:30 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1990	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544532 / -122.575583		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25	4/2/20 1:30 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 1990	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544532 / -122.575583		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2	Customer Phone #2	
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			
Loc Comments: P11 TP RDSD W/OF ADD [REDACTED] PLEASE DO GOOD CLEANUP							

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FS-R1B+Trt	Routine	50	7		1	4/15/20	1	D1	0		[REDACTED]	336
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.544373/-122.576078 Worked Reason:														

Tree Com: .6S/W/OF P11 TP; UP HILL

Worked Comments:

Psc Com: PLEASE DO GOOD CLEANUP

Alerts: First Patrol

[REDACTED]	Canyon Live O	FS-R2B+Trt	Routine	58	19		1	4/15/20	1	D2	0		[REDACTED]	337
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.544358/-122.576178 Worked Reason:														

Tree Com: .7S/W/OF P11 TP @ ROAD

Worked Comments:

Psc Com: PLEASE DO GOOD CLEANUP

Alerts: First Patrol

Notes:

Location Num: 42

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 42

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 1:44 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2000	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544185 / -122.576432		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 6091	NTW Number 4051299		
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2000	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544185 / -122.576432		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091	NTW Number 4051299		

Loc Comments: P12 RDSD E/OF PSTD ADD; PLEASE DO GOOD CLEANUP

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FP-Rmv2 B	Routine	55	12	1	1	4/15/20	1	B2	0		[REDACTED]	344

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.544497/-122.576593 Worked Reason:

Tree Com: .4S/W/OF P12

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 43

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 43

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 2:09 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 2020	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544915 / -122.577835		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4/1/20 2:09 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 2020	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544915 / -122.577835		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091			NTW Number [REDACTED]

Loc Comments: P13 RDSD @ PSTD ADD

Location Summary:		Units: 1	Notification:
<		Completed	>

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	FP-Trim B	Routine	50	33	14	1	4/15/20	1	BA	0		[REDACTED]	352
Com:														
Tline:	Owner: Private			Clearance: 14										
Wire Type: None	VELB Area: No	Tree Lat/Lon: 40.545018/-122.577553			Worked Reason:									

Tree Com: .6S/W/OF P13

Worked Comments:

Psc Com: REMOVE FLOPPY TOPS AND SIDE ; TREE SEEMS TO BE DYING OUT

Alerts: First Patrol

Notes:

Location Num: 44

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 44

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 4:11 PM
XStreet	Group	County SHASTA			Loc Rt: 2030	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544982 / -122.577845			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051297
[REDACTED]			IGO	C-6	-	P-25	3/31/20 4:11 PM
XStreet	Group	County SHASTA			Loc Rt: 2030	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544982 / -122.577845			Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2		Customer Phone #2
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051297

Loc Comments: P14 RDSD E/OF PSTD ADD

Location Summary:		Units: 2	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	FP-Ov B	Routine	60	21	15	1	5/6/20	1	BO	0		[REDACTED]	361
Com:														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: 40.545120/-122.578812														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .9S/W/OF P14

Worked Comments:

Psc Com: REMOVE ENTIRE FLOPPY/SNOW BENT TOPS

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv3 B	Routine	113	25	1	5/6/20	1	B3	0		[REDACTED]			364
Com:														
Tline: Owner: Private Clearance:														
Tree Lat/Lon: 40.544725/-122.578312														

Tree Com: .9S/W/OF P14; S/SD

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 45

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 45

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 3/31/20 4:00 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2040	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544813 / -122.579248		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number
[REDACTED] IGO			C-6	-	P-25	3/31/20 4:00 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2040	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; NW/OF HORSE CANYON WAY			Loc Lat/Lon 40.544813 / -122.579248		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number

Loc Comments: P15 RDSD E/OF PSTD ADD. COSTUMER WILL SIGN FOR [REDACTED] PROPERTY

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FP-Ov A	Routine	60	23	16	1	5/6/20	1	AO	0		[REDACTED]	366
Com:														
Tline: Owner: Private Clearance: 16														
Tree Lat/Lon: 40.544888/-122.578505														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: @ P15; N/SD, GET DEAD LIMBS

Worked Comments:

Psc Com: BOTH SPANS

Alerts: First Patrol

Notes:

Location Num: 46



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/320 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 46

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 2:51 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2050	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544397 / -122.579398		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25		4/1/20 2:51 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2050	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544397 / -122.579398		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P16 LB RDSD S/OF PSTD ADD

Location Summary:		Units: 1	Notification:
<	Completed	>	

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	FP-Trim B	Routine	70	19	15	1	5/4/20	1	BB	0		[REDACTED]	380
Com:														
Tline: Owner: Private Clearance: 15														
Tree Lat/Lon: 40.544498/-122.579568														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .8S/S/OF P16 LB; 2XSTM, E/SD

Worked Comments:

Psc Com: REMOVE TOP OF LINESIDE LEAD DOWN BELOW LINES

Alerts: First Patrol

Notes:

Location Num: 47



Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

0018-1363

GIRVAN 1101-ZOGG MINE

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 47

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:05 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2060	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544398 / -122.579398		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4/1/20 3:05 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2060	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.544398 / -122.579398		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091			NTW Number [REDACTED]

Loc Comments: P17 RDSD S/OF PSTD ADD

Location Summary: Units: 1		Notification:												
← Completed →														
Crew	Tree - Species	Trim Type	Priority	Est Ht	Est dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FP-Ov B	Routine	65	17	15	1	5/4/20	1	BO	0		[REDACTED]	383
Com:														
Tline:			Owner: Private			Clearance: 15								
Wire Type: None			VELB Area: Yes			Tree Lat/Lon: 40.544320/-122.579802								
Worked Reason:														

Tree Com: .3S/S/OF P17; FLGD ROADSIDE

Worked Comments:

Psc Com: REMOVE DEAD AND ALIVE OV

Alerts: First Patrol

Notes:

Location Num: 48

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 48

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:15 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 2070	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543902 / -122.580157		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4/1/20 3:15 PM
XStreet [REDACTED]			Group County SHASTA	Loc Rt: 2070	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543902 / -122.580157		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number [REDACTED]	Tag Type IGO	Packet Project # 0018-1363	SSD #: 6091			NTW Number [REDACTED]

Loc Comments: P18 RDSD S/OF PSTD ADD

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	FP-Trim A	Routine	36	5	12	1	4/30/20	1	BA	0		[REDACTED]	391

Com:

Tline: Owner: Private Clearance: 12  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.543585/-122.580118 Worked Reason:

Tree Com: .3S/S/OF P18 FLGD ROADSIDE-DEAD

Worked Comments:

Psc Com: TREE UPHILL ABV RD; MAKE SAFE

Alerts: First Patrol

Notes:

Location Num: 49



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/3 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 49

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 3:34 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2080	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543173 / -122.580353		Customer Name #1 [REDACTED]		Customer Phone #1 530-243-0735
Alerts Access Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 415-309-7889
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			
[REDACTED] IGO			C-6	-	P-25		4/1/20 3:34 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2080	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.543173 / -122.580353		Customer Name #1 [REDACTED]		Customer Phone #1 530-243-0735
Alerts Access Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 415-309-7889
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			

Loc Comments: P19 RDSD S/OF PSTD ADD

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O	FP-Trim A	Routine	28	5	12	1	4/30/20	1	BA	0		[REDACTED]	402
Com:														
Tline: Owner: Private Clearance: 12														
Tree Lat/Lon: 40.543048/-122.580460														
Wire Type: None VELB Area: Yes Worked Reason:														

Tree Com: .1S/S/OF P19; DEAD, UP HILL; FLGD BELOW

Worked Comments:

Psc Com: TRIM SIDE DEAD LIMBS

Alerts: First Patrol

Notes:

Location Num: 50

Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 50

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/1/20 4:32 PM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541797 / -122.582147		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051298
[REDACTED] IGO			C-6	-	P-25	4/1/20 4:32 PM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2130	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541797 / -122.582147		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Locked Gate Notify First			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051298

Loc Comments: P23 RDSD @ PSTD ADD @ DRWY ENT; [REDACTED]

Location Summary: Units: 2 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Canyon Live O FS-R1B+Trt	Routine	33	10	1	[REDACTED]	5/4/20	1	D1	0		[REDACTED]		414

Com:

Tline: Owner: Private Clearance:

Tree Lat/Lon:

Wire Type: None VELB Area: Yes 40.541820/-122.582337

Worked Reason:

Tree Com: .3S/W/OF P23; 3XSTM

Worked Comments:

Psc Com:

Alerts: First Patrol

[REDACTED]	Ponderosa Pin FP-Rmv1 B	Routine	32	5	1	5/4/20	1	B1	0		[REDACTED]		416
Com:	Tline: Owner: Private Clearance:	Tree Lat/Lon:	Wire Type: None VELB Area: Yes 40.541748/-122.582505	Worked Reason:									

Tree Com: .4S/W/OF P23;

Worked Comments:

Psc Com:

Alerts: First Patrol

Notes:

Location Num: 51



Pacific Gas & Electric  
Vegetation Management  
Work Request C1NV1002839

Apr 3, 2020

Division: INO/320 Valley  
Circuit: GIRVAN 1101 #0103401101

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 51

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 8:23 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 2150	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541712 / -122.582997		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091			NTW Number 4051298
[REDACTED]			IGO	C-6	-	P-25	4/2/20 8:23 AM
XStreet [REDACTED]			Group	County SHASTA	Loc Rt: 2150	U-Bld No	Insp [REDACTED]
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541712 / -122.582997		Customer Name #1 [REDACTED]		Customer Phone #1 [REDACTED]
Alerts Dog Traffic Issue			Struct1	Struct2	Customer Name #2 [REDACTED]		Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091			NTW Number 4051298

Loc Comments: AX DRWY @ PSTD ADD P24 ON DRWY; [REDACTED] GO IN ANYTIME ; PLEASE DO GOOD CLEANUP

Location Summary: Units: 2		Notification:										
----- Completed -----												

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Black Oak	FS-R3B+Trt	Routine	45	25		1	5/5/20	1	D3	0		[REDACTED]	422

Com:

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.541745/-122.582967

Clearance:

Worked Reason:

Tree Com: .2S/W/OF P24;

Worked Comments:

Psc Com: NEW CONSTRUCTION AND STORM DAMAGE

Alerts: First Patrol

[REDACTED]	Canyon Live O FP-Major B	Routine	50	25	40	1	5/5/20	1	BB	0		[REDACTED]	427
Com:													

Tline: Owner: Private  
Tree Lat/Lon:  
Wire Type: None VELB Area: Yes 40.541887/-122.583178

Clearance: 40

Worked Reason:

Tree Com: .5S/W/OF P24

Worked Comments:

Psc Com: REMOVE ENTIRE LINE SIDE LEAD AT GREEN PAINT LINE, 10 FEET ABOVE BASE OF TREE; SNOW BENT

Alerts: First Patrol

Notes:

Location Num: 52


**Pacific Gas & Electric**  
**Vegetation Management**  
**Work Request C1NV1002839**

Apr 3, 2020

0018-1363

GIRVAN 1101-ZOGG MINE

Order Number: 8191258

SSD Routing #: 50

Contractor: Wright Tree

Contract:

Work Type: Distribution

Acct Type: Maintenance

Total Loc # 52

General Comments: 2020 FIRST PATROL - ISSUED TO WRIGHT TREE - GIRVAN 1101 - RTE 50 - ZOGG MINE

Work Request= C1NV1002839 and TL.sAcctType= 'M'

Location Num: 52

Address [REDACTED]			City IGO	Quad Map C-6	Thomas Guide -	Area P-25	Inspection Date / Time 4/2/20 10:09 AM
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2160	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541965 / -122.583565		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #2 [REDACTED]
Alerts Access Dog Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0000-0000	SSD #: 6091	NTW Number 4051298		
[REDACTED] IGO			C-6	-	P-25	4/2/20 10:09 AM	
XStreet [REDACTED] Group			County SHASTA	Loc Rt: 2160	U-Bld No	Insp [REDACTED]	Inspection Company CN Utility
Location Directions S/ON PLACER>W/ON SOUTH FORK RD>N/ON ZOGG MINE; W/OF HORSE CANYON WAY			Loc Lat/Lon 40.541965 / -122.583565		Customer Name #1 [REDACTED]	Customer Phone #1 [REDACTED]	Customer Phone #2 [REDACTED]
Alerts Access Dog Riparian			Struct1	Struct2	Customer Name #2 [REDACTED]	Customer Phone #2 [REDACTED]	Customer Phone #2 [REDACTED]
SRA Yes	Tag Number	Tag Type	Packet Project # 0018-1363	SSD #: 6091	NTW Number 4051298		

Loc Comments: P25 TP W/OF PSTD ADD TREES N/SD/OF RD; [REDACTED] GO IN ANYTIME ; PLEASE DO GOOD CLEANUP

Location Summary: Units: 1 Notification:

&lt; ----- Completed ----- &gt;

Crew	Tree - Species	Trim Type	Priority	Est Ht	dbh	HV Clr	Est Qty.	Date	Qty	T&M	OT	Hrs	By	Tree #
[REDACTED]	Live Oak	FP-Major B	Routine	40	37	40	1	5/6/20	1	BB	0		[REDACTED]	429
Com:														
Tline: Owner: Private Clearance: 40														
Tree Lat/Lon: 40.541930/-122.583702 Worked Reason:														
Wire Type: None VELB Area: No														

Tree Com: .2S/W/OF P25 TP; 3XSTEM

Worked Comments:

Psc Com: REMOVE BOTH LEADS WITH X'S TO GROUND AT PAINT LINE

Alerts: First Patrol

Notes:

Totals for Work Request: C1NV1002839 Units: 104

R = TGR

W = Warranty

! = Special Equipment

X = Brush Cut

X = Removal

X = Fac Prot

# **EXHIBIT A-5**

Search Info									
Division: North Valley			Project Category:ALL					Circuit:	
Budget Year:2020			Options: ALL					Trans Line:	
Trans\Dist: D			Quarter:					Current DT:10/30/2020	
Cycle:									

Project Name	Proj#	Qtr	Pry	Plan Units	PI FCst Dt	PI FCst Units	PI Act Start Dt	PI Act Comp Dt	PI Act Units	TT FCst Dt	TT Act Start Dt	TT Act Comp Dt	TT Units	TT Adds	TT No Work
GIRVAN 1101-	178573	Q2	160	1450	03/26/2020	1450	02/12/2020	03/26/2020	1450	07/15/2020	04/22/2020	07/15/2020	1450	116	44
GIRVAN 1101-ZOGG MINE-	181363	Q2	170	300	04/03/2020	623	03/04/2020	04/03/2020	623	05/21/2020	03/25/2020	05/21/2020	623	30	25